


## Series DRVI

USE AND MAINTENANCE MANUAL  
ETHERCAT V 1.9

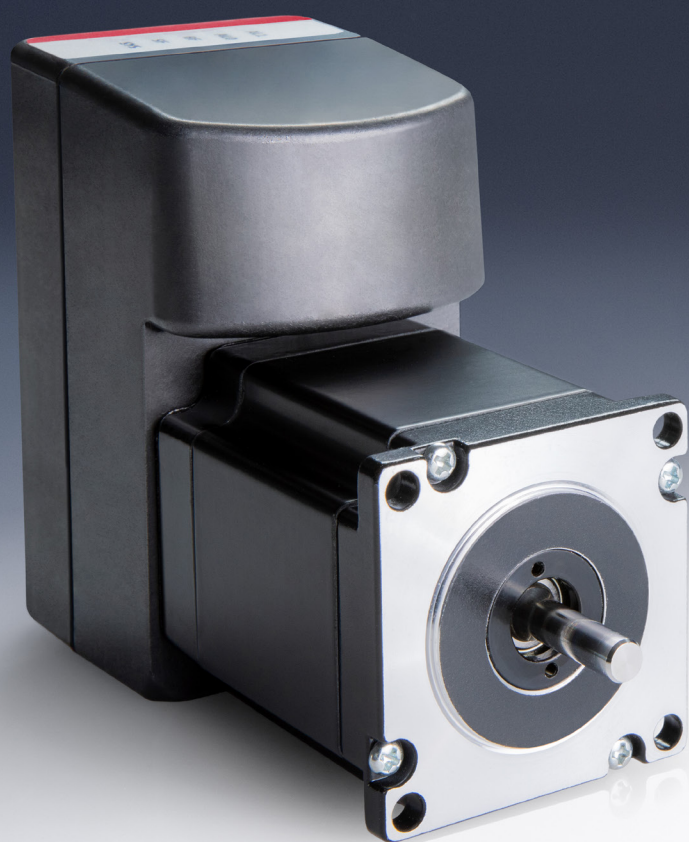

# Contents

<b>Chapter 1 General recommendations</b>	<b>1</b>
1.1 Product storage and transport . . . . .	2
1.2 Use . . . . .	2
1.3 Limitations of use . . . . .	2
1.4 Maintenance . . . . .	2
1.5 Ecological Information . . . . .	3
<b>Chapter 2 Introduction</b>	<b>4</b>
2.1 About this manual . . . . .	4
2.2 Unit overview . . . . .	4
<b>Chapter 3 Technical data</b>	<b>5</b>
3.1 Environmental conditions . . . . .	5
3.2 Electrical specifications . . . . .	5
3.2.1 Power supply . . . . .	5
3.2.2 Wiring . . . . .	6
3.2.3 Encoder . . . . .	6
3.3 Electrical connections . . . . .	7
3.3.1 1 - Power supply . . . . .	8
3.3.2 2 - GPIO . . . . .	8
3.3.3 3 - STO (Safety Torque Off) . . . . .	11
3.3.3.1 STO function validation . . . . .	12
3.3.4 4, 5 - Ethernet fieldbus interface . . . . .	13
3.3.5 6 - USB interface . . . . .	14
3.3.6 Earth connection . . . . .	14
3.4 LED indicators . . . . .	14
3.5 Holding Brake . . . . .	16
<b>Chapter 4 Operation Modes</b>	<b>17</b>
4.1 Fieldbus Modes . . . . .	17
4.1.1 Speed . . . . .	17
4.1.2 Positioning . . . . .	18
4.1.2.1 Relative Positioning . . . . .	19
4.1.2.2 Absolute Positioning . . . . .	19
4.1.3 Torque . . . . .	19
4.1.4 Jog . . . . .	20
4.1.5 Homing . . . . .	21
4.1.5.1 Positioning homing . . . . .	21
4.1.5.2 Proximity homing: negative direction . . . . .	21
4.1.5.3 Proximity homing: positive direction . . . . .	21

4.1.5.4	Proximity homing: negative direction + zero encoder . . . . .	22
4.1.5.5	Proximity homing: positive direction + zero encoder . . . . .	23
4.1.5.6	Torque homing: negative direction . . . . .	23
4.1.5.7	Torque homing: positive direction . . . . .	23
4.1.5.8	Torque homing: negative direction + zero encoder . . . . .	24
4.1.5.9	Torque homing: positive direction + zero encoder . . . . .	24
4.1.5.10	Homing offset . . . . .	25
4.2	Digital Input mode . . . . .	26
4.2.1	Application example . . . . .	26
4.2.2	Functioning . . . . .	27
4.2.3	Self-holding with positioning . . . . .	29
4.2.4	Error handler . . . . .	29
4.2.5	Proximity lost error . . . . .	30
<b>Chapter 5</b>	<b>Other features</b>	<b>31</b>
5.0.1	Profile software limits . . . . .	31
5.0.2	Torque limit . . . . .	31
5.0.3	Save and restore actual position . . . . .	32
<b>Chapter 6</b>	<b>EtherCAT Protocol</b>	<b>33</b>
6.1	Conventions . . . . .	33
6.1.1	EtherCAT states machine . . . . .	34
6.2	Configuration via ESI file . . . . .	35
6.3	Object dictionary . . . . .	35
6.3.1	Communication Profile - CiA 301 objects . . . . .	35
6.3.2	CiA 301 objects descriptions . . . . .	37
6.3.2.1	1000h Device type . . . . .	37
6.3.2.2	1001h Error register . . . . .	37
6.3.2.3	1008h Manufacturer hardware name . . . . .	37
6.3.2.4	100Ah Manufacturer software version . . . . .	37
6.3.2.5	1018h Identity object . . . . .	37
6.3.2.6	1600h – 1607h Receive PDO Mapping Parameter . . . . .	38
6.3.2.7	1A00h – 1A07h Transmit PDO mapping parameter . . . . .	38
6.3.3	Device Profile - CiA 402 objects . . . . .	39
6.3.4	CiA 402 objects descriptions . . . . .	39
6.3.4.1	603Fh Error code . . . . .	39
6.3.4.2	6040h Controlword . . . . .	40
6.3.4.3	6041h Statusword . . . . .	42
6.3.4.4	6060h Mode of operation . . . . .	43
6.3.4.5	6061h Mode of operation display . . . . .	43
6.3.4.6	6064h Position actual value . . . . .	43
6.3.4.7	606Ch Velocity actual value . . . . .	43
6.3.4.8	6071h Target torque . . . . .	44

6.3.4.9	6074h Torque demand value . . . . .	44
6.3.4.10	6077h Torque actual value . . . . .	44
6.3.4.11	607Ah Target position . . . . .	44
6.3.4.12	607Ch Home offset . . . . .	44
6.3.4.13	607Eh Polarity . . . . .	44
6.3.4.14	6081h Profile velocity in pp-mode . . . . .	44
6.3.4.15	6083h Profile acceleration . . . . .	45
6.3.4.16	6084h Profile deceleration . . . . .	45
6.3.4.17	6087h Torque slope . . . . .	45
6.3.4.18	6091h Motor ratio . . . . .	45
6.3.4.19	6098h Homing method . . . . .	45
6.3.4.20	6099h Homing speeds . . . . .	46
6.3.4.21	609Ah Homing acceleration . . . . .	46
6.3.4.22	60FFh Target velocity . . . . .	46
6.3.4.23	6502h Supported drive modes . . . . .	46
6.3.5	Manufacturer custom objects . . . . .	47
6.3.6	Manufacturer custom objects descriptions . . . . .	47
6.3.6.1	2002h Input status . . . . .	47
6.3.6.2	2003h Output status . . . . .	47
6.3.6.3	2004h Homing ok . . . . .	47
6.3.6.4	2006h Warnings . . . . .	47
6.3.6.5	2020h Diagnostic . . . . .	48
6.4	Startup parameters . . . . .	49
6.4.1	Startup parameters objects . . . . .	51
6.4.2	Startup parameters objects descriptions . . . . .	51
6.4.2.1	800001h System endianness . . . . .	51
6.4.2.2	800002h System start . . . . .	51
6.4.2.3	800003h System Emergencies Enabled . . . . .	52
6.4.2.4	800101h Pid Selection . . . . .	52
6.4.2.5	800201h KP position . . . . .	52
6.4.2.6	800202h KI position . . . . .	52
6.4.2.7	800301h KP Speed . . . . .	52
6.4.2.8	800302h KI Speed . . . . .	52
6.4.2.9	800401h Profile Check . . . . .	52
6.4.2.10	800402h Profile Timeout . . . . .	52
6.4.2.11	8005h Target Scale . . . . .	53
6.4.2.12	8006h Actuator screw pitch . . . . .	53
6.4.2.13	8007h Torque Homing Threshold . . . . .	53
6.4.2.14	8008h Actuator Type . . . . .	53
6.4.2.15	8009h PDS FSA Enable . . . . .	53
6.4.2.16	800Ah CTT . . . . .	53
6.5	Diagnostic behaviour . . . . .	53
6.5.1	Emergency Object . . . . .	54

6.5.2	Errcode codes and Error register bits . . . . .	54
6.5.3	Warnings . . . . .	55
6.6	Profile position . . . . .	56
6.7	Profile velocity . . . . .	58
6.8	Profile Torque . . . . .	59
6.9	Homing mode . . . . .	59
6.10	Jog mode . . . . .	61
6.11	Inputs GPIO . . . . .	62
6.12	Output GPIO . . . . .	62
<b>Chapter 7</b>	<b>Uvix</b>	<b>63</b>
7.1	Introduction . . . . .	63
7.2	General information . . . . .	64
7.3	Status information . . . . .	65
7.4	Details . . . . .	66
7.4.1	Variables . . . . .	66
7.4.2	Alarms . . . . .	68
7.4.3	Commands . . . . .	70
7.4.4	Errors History . . . . .	71
7.4.5	Graphs . . . . .	71
7.5	Configuration . . . . .	73
7.5.1	Actuator . . . . .	73
7.5.2	Motion . . . . .	74
7.5.3	Communication . . . . .	75
7.5.4	GPIO . . . . .	75
7.6	Commissioning . . . . .	76
7.6.1	Standard commissioning page . . . . .	76
7.6.1.1	Mode operation selector . . . . .	77
7.6.1.2	Command of the movement . . . . .	77
7.6.1.3	Mode operation section . . . . .	77
7.6.1.4	Homing section . . . . .	78
7.6.1.5	Speed Profile section . . . . .	80
7.6.1.6	Absolute position section . . . . .	81
7.6.1.7	Relative position section . . . . .	82
7.6.1.8	Torque profile section . . . . .	83
7.6.2	Digital Input mode commissioning page . . . . .	84
7.6.2.1	Jog section . . . . .	85
7.6.3	PID configuration section . . . . .	86
7.7	EtherCAT configuration . . . . .	88
7.8	UVIX USB Gateway . . . . .	89
7.8.1	Main page . . . . .	89
7.8.2	Ethernet device configuration . . . . .	90

# General recommendations

▲ Please comply with the recommendations for safe use described in this document.

- Some hazards can only be associated with the product after it has been installed on the machine/equipment. It is the responsibility of the end user to identify these hazards and reduce the risks associated with them.
- For information regarding the reliability of the components, contact Camozzi Automation.
- Before commissioning, carefully check that the DRVI has been correctly configured with regard to the data relating to the determination of the position and movement of the device. Failure to follow these instructions can result in injury or equipment damage.
- Avoid unprotected contact with hot surfaces. Be sure that the DRVI can dissipate the heat generated during normal operation to avoid equipment damage.
- Read the information in this document carefully before using the product.
- Keep this document in a safe place and close at hand for the whole of the product's life cycle.
- Pass this document on to any subsequent owner or user.
- The instructions in this manual must be observed in conjunction with the instructions and additional information concerning the product in this manual, available from the following reference links:
  - Website [www.camozzi.com](http://www.camozzi.com)
  - Camozzi general catalogue
  - Technical assistance service
- Assembly and commissioning must be performed exclusively by qualified and authorised personnel on the basis of these instructions.
- It is the responsibility of the system/machine designer to ensure the correct selection of the most suitable component according to the intended application.
- Use of appropriate personal protective equipment is recommended to minimise the risk of physical injury.
- For all situations not contemplated in this manual and in situations in which there is the risk of potential damage to property, or injury to persons or animals, contact Camozzi for advice.
- Do not make unauthorised modifications to the product. In this case, any damage or injury to property, persons or animals will be the responsibility of the user.
- It is recommended to comply with all safety regulations that apply to the product.
- Never intervene on the machine/system until you have verified that all working conditions are safe.
- Before installation or maintenance, ensure that the required safety locks are active, and then disconnect the electrical mains (if necessary) and system pressure supply, discharging all residual compressed air from the circuit and deactivating residual energy stored in springs, condensers, recipients and gravity.
- After installation or maintenance, the electrical power supply (if necessary) must be reconnected, and the regular operation of the product must be checked. In the event of a malfunction, the product

## 1.1 Product storage and transport

---

must not be used.

- Avoid covering the equipment with paint or other substances that may reduce heat dissipation.

## 1.1 Product storage and transport

- Adopt all measures possible to avoid accidental damage to the product during transport, and when available use the original packaging.
- Observe the specified storage temperature range of  $-20 \div 70$  °C.

## 1.2 Use

- Make sure that the distribution network voltage and all operating conditions are within the permissible values.
- The product may only be used in observance of the specifications provided; if these requirements are not met, the product may only be used upon authorisation by Camozzi.
- Follow the indications shown on the identification plate.

## 1.3 Limitations of use

- Do not exceed the technical specifications given in Paragraph 2 (General characteristics and conditions of use) and in the Camozzi general catalogue.
- Do not install the product in environments where the air itself may cause hazards.
- With the exception of specific intended uses, do not use the product in environments where direct contact with corrosive gases, chemicals, salt water, water or steam may occur.
- In the event of breakage of the polymer casing (for example following external impacts), where the electronic circuits reside, the DRVI is no longer usable. Remove power from the device and, wearing the necessary PPE (Personal Protection Equipments), proceed with the complete replacement with a new DRVI device.

## 1.4 Maintenance

- Incorrectly performed maintenance operations can compromise the good working order of the product and harm surrounding persons.
- Check conditions to prevent sudden release of parts, then suspend the power supply and allow residual stresses to discharge before taking action.
- Assess the possibility of having the product serviced by a technical service centre.
- Never disassemble a live unit.
- Isolate the product electrically before maintenance.
- Always remove accessories before maintenance.
- Always wear the correct personal protective equipment as envisaged by local authorities and in compliance with current legislation.

## 1.5 Ecological Information

---

- In the event of maintenance, or replacement of worn parts, exclusively use the original Camozzi kits and ensure that operations are performed by specialised and authorised personnel. Otherwise product approval will be rendered invalid.

## 1.5 Ecological Information

- At the end of the product's life cycle, it is recommended to separate the materials for recycling.
- Follow the waste disposal regulations in force in your country.
- The product and relative parts all comply with the ROHS and REACH standards.

# Introduction

## 2.1 About this manual

This manual contains the technical description of the universal integrated servomotor, designed by Camozzi Automation S.p.A.

**▲** Failure to observe the information contained in this manual can result in injury or equipment damage.

Please contact Camozzi Automation S.p.A. for technical assistance.

PRODUCT SPECIFICATIONS AND DATA ARE SUBJECT TO CHANGE WITHOUT NOTICE.

© Camozzi Automation S.p.A. All rights reserved.

## 2.2 Unit overview

The universal integrated servomotor unit is composed of a brushless or stepper motor and a FOC (Field Oriented Control) drive.

The unit is equipped with EtherCAT interface, that provides fieldbus communication capability with other devices, such as PLCs.

An absolute encoder allows to detect the rotor position of the motor, which is a fundamental quantity for the closed-loop control algorithms.

The power supply is divided in two sections: one for the logic stage and one for the power stage. In the following chapter are described the technical data of the drive.

# Technical data

## 3.1 Environmental conditions

⚠ The drive installation must respect the environmental conditions specified in Table 3.1.

Table 3.1: Environmental conditions.

Condition	Value
Protection class	IP65, except motor shaft
Operating ambient temperature	-20 ... 50 °C (*)
Storage ambient temperature	-20 ... 70 °C
Air humidity (non-condensing)	5 ... 95 %
Maximum altitude	1000 m

(\*) for stepper motor (DRVI-23ST012 and DRVI-24ST022) the nominal torque must be derated for temperature over 30°C.

## 3.2 Electrical specifications

### 3.2.1 Power supply

The power supply section of the drive is divided into two parts:

- Logic (VL): provides supply to the logic stage, fieldbus interface and input-outputs.
- Main (VDC): provides supply to the power stage.

It's recommended to supply both Logic and Main power supplies by 2 different PELV (Protective Extra-Low Voltage) electronic circuits compliant to EN 60204-1

In Table 3.8 are shown the power supply operating ranges.

Table 3.2: Power supplies ranges.

Supply	Nominal value	Min/Max values
VL	24 V	24 V ±10%
VDC	48 V	15V / 60 V

The current absorption of the logic stage is <200mA (including auxiliary +24V output at maximum load).

⚠ During deceleration ramps the motor acts as a generator, returning a voltage on the VDC bus. The entity of such regeneration depends on the deceleration value and on the moment of inertia of the load attached to the shaft. If the voltage generated reaches the maximum VDC voltage, **the excess energy must be dissipated using an external braking system**, or changing the deceleration value otherwise the drive or the power supply could be damaged.

⚠ Install fuses for power supply cable in accordance with the electrical requirements of the equipment (be careful about inrush currents). A recommended fuse value is **T4A**.

## 3.2 Electrical specifications

It is also recommended to install a capacitor of 1000  $\mu$ F, rated 100 V, after the output of the power supply.

**⚠** The drive does not have an inrush current limitation, hence you must use the input of the power supply to turn the drive on and off. Never switch the output voltage of the power supply (hot plugging). In Figures 3.1 and 3.2 are shown the wiring examples for VDC and VL.

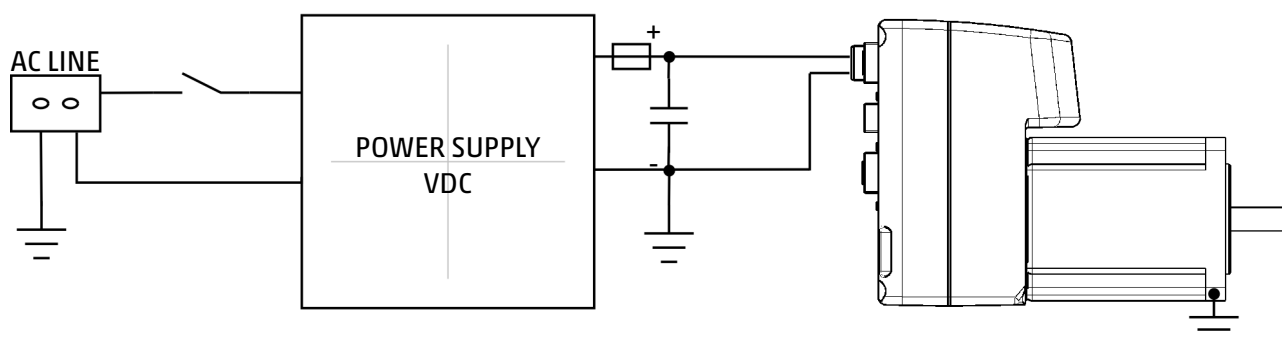


Figure 3.1: VDC wiring example.

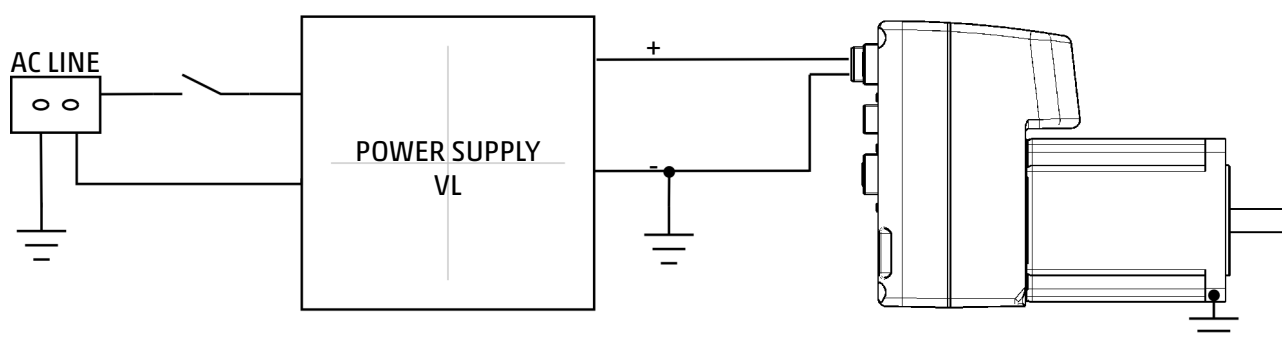


Figure 3.2: VL wiring example.

### 3.2.2 Wiring

The actual cable type, wire gauge, shield type, and filtering devices used are dependent on the environment, application, and system. However, we advise to use the following guidelines, when sizing the cables:

- The minimum section for the power supply cable should be AWG22 when the motor uses the nominal current.
- For length less than 15 m, DC power supply cables can be used. Otherwise AC power supply cables should be used.
- To reduce EMC issues, use twisted and shielded cables.
- The shield should be connected to ground on the power supply side.

### 3.2.3 Encoder

The motor shaft position is measured using an absolute magnetic encoder.

### 3.3 Electrical connections

### 3.3 Electrical connections

In Figure 3.3 is shown the placement of the electrical connectors.



Figure 3.3: Connectors placement.

In Table 3.3 are shown the functionalities of the electrical connectors.

Table 3.3: Electrical connections.

Connection	Name	Functionality
①	PSW	Power supply
②	I/O	Inputs and outputs
③	STO	Safe Torque Off (when present)
④	P1 = IN	EtherCAT Fieldbus Interface
⑤	P2 = OUT	EtherCAT Fieldbus Interface
⑥	-	USB (Micro-B)


NOTE: All connectors are screw type. During the wiring phase, be careful not to tighten the connectors too forcefully. The use of tools to tighten the connectors is absolutely not recommended.

### 3.3 Electrical connections

#### 3.3.1 1 - Power supply

The power supply connector is a 5-poles M12 (male) A-coded. In Table 3.4 is represented the pinout of the power supply connector.

Table 3.4: 1 - Power supply connector pinout.

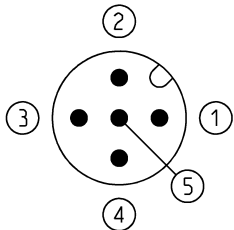PIN	Signal	Function	Symbol
1, 5	VDC	Main power supply	
2	GND	Main power ground	
3	VL	Logic power supply	
4	GND	Logic power ground	

#### Camozzi connector receptacle:

- CS-LF05HC, straight connector M12 5-poles male.
- CS-LF04HB, straight connector M12 5-poles male (Pin 5 is not connected).
- CS-LF05HB-D200, cable with straight M12 5-poles male connector, length 2m.
- CS-LF05HB-D500, cable with straight M12 5-poles male connector, length 5m.

**⚠** The pins with GND indication are internally connected.


#### 3.3.2 2 - GPIO

The GPIO connector is a 12-poles M12 (female) A-coded. The description of pinouts changes depending on the Input mode:

- Fieldbus Input mode: functionality of each pin is described in Table 3.5.
- Digital Input mode (4.2): functionality of each pin is described in Table 3.6.

### 3.3 Electrical connections


Table 3.5: 2 - GPIO connector pinout for Fieldbus Input mode.

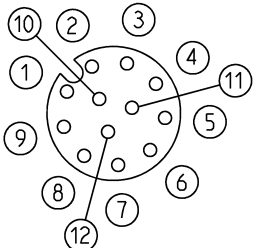PIN	Signal	Function	Symbol
1, 2	IN1	Digital input 1 (compliant to IEC61131-2)	
3, 4	IN2	Digital input 2 (compliant to IEC61131-2)	
5, 6	OUT	Solid state relay output (PTC resettable fuse, 0.5 A hold current)	
7, 8	EXT PROXY	Digital input (24 V) for end-stroke proximity	
9, 10	PROXY HOMING	Digital input (24 V) for homing proximity	
11	GND	Digital ground	
12	+24V	Auxiliary +24 V output, max 130 mA	

NOTE: the EXT PROXY is usually used to connect the optional limit switch sensor, whilst the PROXY HOMING is used for the homing zero position

### 3.3 Electrical connections

Table 3.6: 2 - GPIO connector pinout for Digital Input mode.

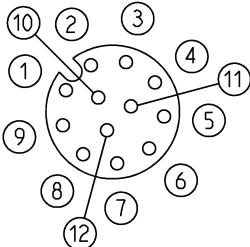PIN	Signal	Function	Symbol
1, 2	IN FW	Forward input (compliant to IEC61131-2)	
3, 4	IN BW	Backward input (compliant to IEC61131-2)	
5, 6	OUT ERR	Solid state relay output (PTC resettable fuse, 0.5 A hold current)	
7, 8	FRONT PROXY	Digital input (24 V) for front proximity	
9, 10	REAR PROXY	Digital input (24 V) for rear proximity	
11	GND	Digital ground	
12	+24V	Auxiliary +24 V output, max 130 mA	

### 3.3 Electrical connections

#### Camozzi connector receptacle:

- CS-LM12HC, circular connector field attachable M12 12-poles (male) A-coded.
- CS-LO12HC-0025, straight connector M12 12-poles (male) and two M8 female (proximity), length 25 cm.
- CS-LM12HC-D500, straight connector M12 12-poles (male), length 5m.

Digital inputs are bidirectional: in Figure 3.4 is represented the input hardware stage.

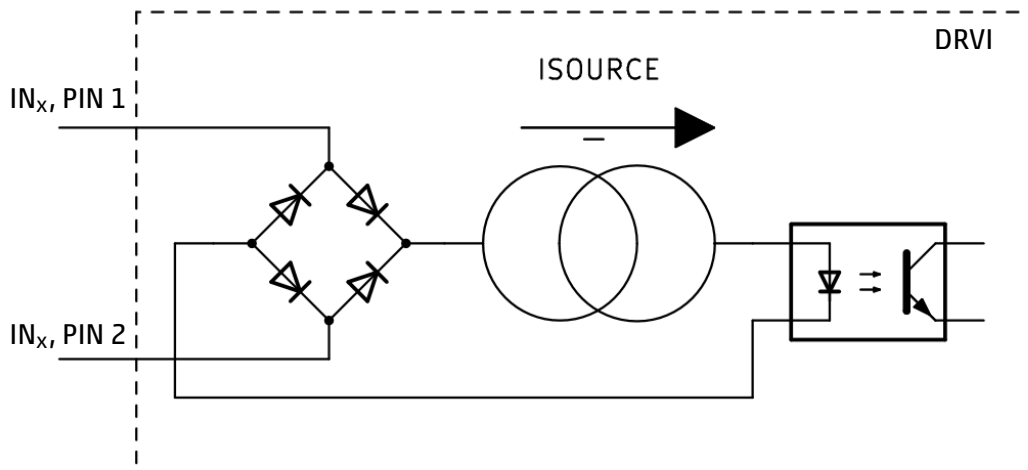


Figure 3.4: GPIO IN stage.

In Figure 3.5 is represented the output hardware stage.

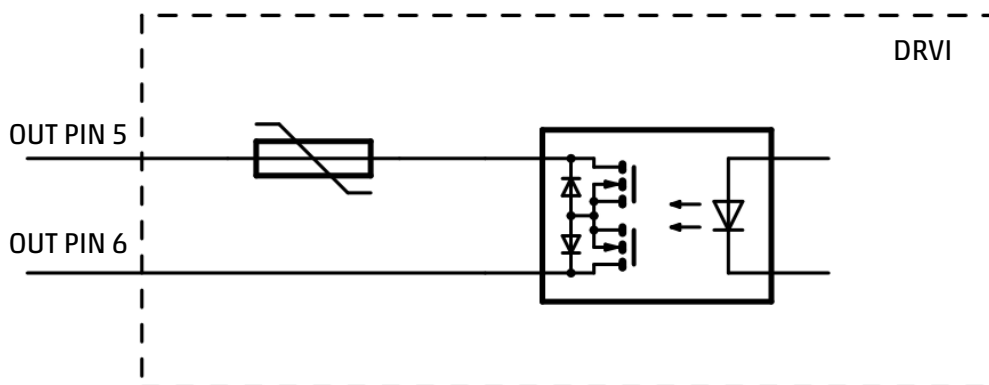


Figure 3.5: GPIO OUT stage.

#### 3.3.3 3 - STO (Safety Torque Off)


The STO connector (when present) is 4-poles M8 (female) A-coded. In Table 3.7 is shown the connector pinout and is displayed the STO connector. To allow the motor movement, IN1 and IN2 must be connected to +24 V, while COM1 and COM2 to GND. If IN1 or IN2 voltages are missing, the STO intervenes disconnecting the motor phases.

#### Camozzi connector receptacle:

- CS-DM04HB, circular connector field attachable M8 4-poles (male) A-coded.
- CS-LM04HB-D500, straight connector M8 4-poles (male), length 5m.

### 3.3 Electrical connections

Table 3.7: 3 - STO connector pinout.

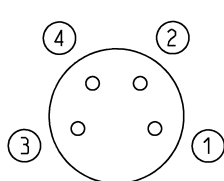PIN	Signal	Function	Symbol
1	IN1	STO1 signal	
2	COM1	Common signal of STO1	
3	IN2	STO2 signal	
4	COM2	Common signal of STO2	

#### 3.3.3.1 STO function validation

To check if the STO is correctly installed and working, follow these steps:

- Turn on the DRVI, send some movements command and check that all is ok (preliminary)
- Stop the motor and take out 24V at pin IN1 and IN2
- Verify that the torque is off and that the motor can be moved freely (if there is no motor brake mounted)
- Verify that red SYS LED blinks 3 times. It is also possible to verify that the DRVI send an error message on the field bus (see the User Manual for details)
- Verify that any movement commands the DRVI doesn't move
- Restore 24V at pin IN1 and IN2
- Verify that DRVI remains stopped in error state, with red led blinking
- Reset the error, set the torque ON, send a movement command to DRVI and check that everything is ok
- Run the motor and take out 24V at pin IN1 and IN2 while the motor is running
- Verify that the motor stops by inertia, then repeat the procedure described before with motor stopped

Below a table with the motor status due to the STO1 and STO2 signals:

### 3.3 Electrical connections


Table 3.8: STO inputs and motor status.

IN1	IN2	PWM e alimentazione motore	Descrizione
0	0	Motor disabled	The motor is disabled with DRVI in error state and there is no ways to move the motor
0	24V	Motor disabled	The motor is disabled with DRVI in error state and there is no ways to move the motor
24V	0	Motor disabled	The motor is disabled with DRVI in error state and there is no ways to move the motor
24V	24V	Motor enabled	The motor is enabled and ready to move

#### 3.3.4 4, 5 - Ethernet fieldbus interface

The Fieldbus connectors are 4-poles M12 (female) D-coded. In Table 3.9 are shown the connector pinout and the fieldbus connector (PORT 1, PORT 2).

Table 3.9: 4, 5 - Fieldbus connector pinout.

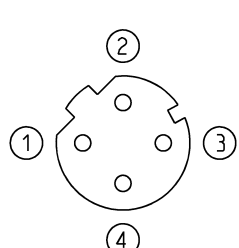PIN	Signal	Function	Symbol
1	TXP	Transmission data (+)	
2	RXP	Reception data (+)	
3	TXN	Transmission data (-)	
4	RXN	Reception data (-)	

### 3.4 LED indicators

#### Camozzi Ethernet fieldbus cables:

- CS-SB04HB-D100, co-molded cable with straight M12D 4-poles male connector, length 1m.
- CS-SB04HB-D500, co-molded cable with straight M12D 4-poles male connector, length 5m.
- CS-SB04HB-DA00, co-molded cable with straight M12D 4-poles male connector, length 10m.
- CS-SB04HB-DD00, co-molded cable with straight M12D 4-poles male connector, length 15m.
- CS-SB04HB-DG00, co-molded cable with straight M12D 4-poles male connector, length 20m.
- CS-SB04HB-DJ00, co-molded cable with straight M12D 4-poles male connector, length 25m.
- CS-SB04HB-DM00, co-molded cable with straight M12D 4-poles male connector, length 30m.
- CS-SB04HB-DS00, co-molded cable with straight M12D 4-poles male connector, length 40m.
- CS-SB04HB-DY00, co-molded cable with straight M12D 4-poles male connector, length 50m.
- CS-SE04HB-F050, molded cable with straight RJ45 male – M12D 4 pin female connector (adapter and panel mount) to connect to the controller.

#### 3.3.5 6 - USB interface

The USB port allows the drive configuration using the UVIX interface. The USB connector is a Micro USB type B.

#### Camozzi connector receptacle:

- G11W-G12W-2, standard cable with micro-USB connector length 2m.

#### 3.3.6 Earth connection

**⚠** It is mandatory to connect the motor flange to earth ( $\perp$ ). The GND must be connected to the earth, using a common central point, near to the power supply.

### 3.4 LED indicators

The integrated drive provides visual information using LED indicators. Their functionality is shown in Table 3.10, and their detailed description is given in Table 3.11.

Table 3.10: LED indicators functionality.






















Name	Color	Function	Indicator
L/A1	Green / yellow (bicolor)	Link / activity LED for Ethernet channel 1	
L/A0	Green / yellow (bicolor)	Link / activity LED for Ethernet channel 0	
ERR	Red	Error	
RUN	Green	Run	
SYS	Red / green (bicolor)	Drive system LED	

Table 3.11: LED indicators description.

Name	Color	State	Description
L/A1		OFF	No link has been established on Ethernet Port 0
		ON	Link has been established on Ethernet Port 1
		BLINK	Data is received or transmitted on Ethernet Port 1
L/A0		OFF	No link has been established on Ethernet Port 0
		ON	Link has been established on Ethernet Port 0
		BLINK	Data is received or transmitted on Ethernet Port 0
ERR		OFF	No error, device is in WORK state
		BLINK every 400 ms	Configuration error
		BLINK every 1.2 s	Watchdog error
		BLINK every 1.4 s	Communication error (cable not connected)
RUN		OFF	The device is in INIT state
		BLINK every 400 ms	The device is in PRE-OPERATIONAL state
		BLINK every 1.2 s	The device is in SAFE-OPERATIONAL state
		ON	The device is in OPERATIONAL state
SYS		1 BLINK	Servo OFF
		2 BLINK	Servo ON
		1 BLINK	VL / VDC UVLO or OVLO error
		2 BLINK	Over temperature or I <sup>2</sup> T error
		3 BLINK	STO error
		4 BLINK	Homing error / internal error / proximity lost

### 3.5 Holding Brake

---

### 3.5 Holding Brake

The DRVI is available with an optional integrated holding brake. It is controlled automatically by the DRVI: when the device is turned off, in error state and in general when the servo is off the brake is automatically activated (it keeps the motor shaft stationary), while when the motor is running or is enabled to move (the servo state is on) the brake is disengaged.

NOTE: this type of brake is not a Safety brake. It is engaged and disengaged as described before but its rule is not for a safety purpose NOTE: this type of brake is not a dynamic one: if you need a brake that automatically ensure you to stop immediately the movement with the maximum allowable load, you have to use an appropriate external brake.

# Operation Modes

This Chapter describes the possible operation modes of the drive that could be fieldbus modes or Digital Input mode

## 4.1 Fieldbus Modes

### 4.1.1 Speed

This drive mode operation requires a specific target speed, acceleration and deceleration: once the velocity target is set, the motor accelerates until the target speed is reached and then maintains the required velocity until a new request is made. The speed profile executed is trapezoidal.

In Figure 4.1 is shown an example of speed profile with the following parameters:

- Target acceleration = 60 RPM / s
- Target deceleration = 60 RPM / s
- Initial speed = 0 RPM
- Target speed = 60 RPM (target given at  $t = 0$  s)
- Target speed = 0 RPM (target given at  $t = 2$  s)

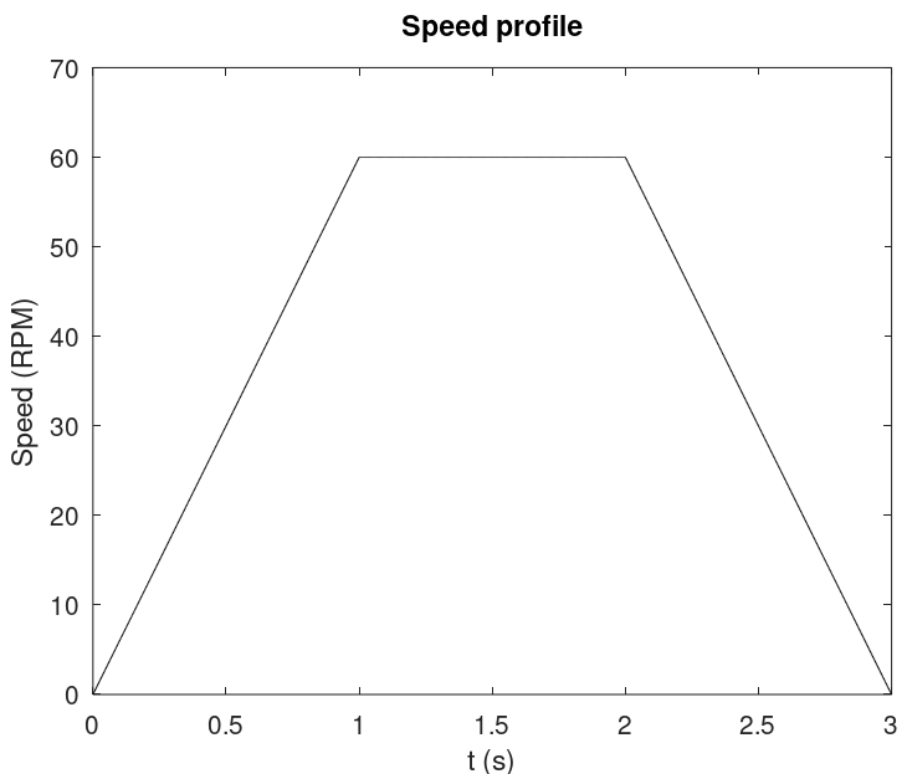


Figure 4.1: Speed profile example.

## 4.1 Fieldbus Modes

### 4.1.2 Positioning

This drive operation modes requires a specific target position, velocity, acceleration and deceleration, to compute the motion profile used to reach the target position. The position profile executed is of "S" type and the speed profile is trapezoidal.

In Figure 4.2 is shown an example of positioning profile with the following parameters:

- Initial position = 0 °
- Target position = 720 ° (target given at t = 0 s)
- Initial speed = 0 RPM
- Target speed = 60 RPM
- Target acceleration = 60 RPM / s
- Target deceleration = 60 RPM / s

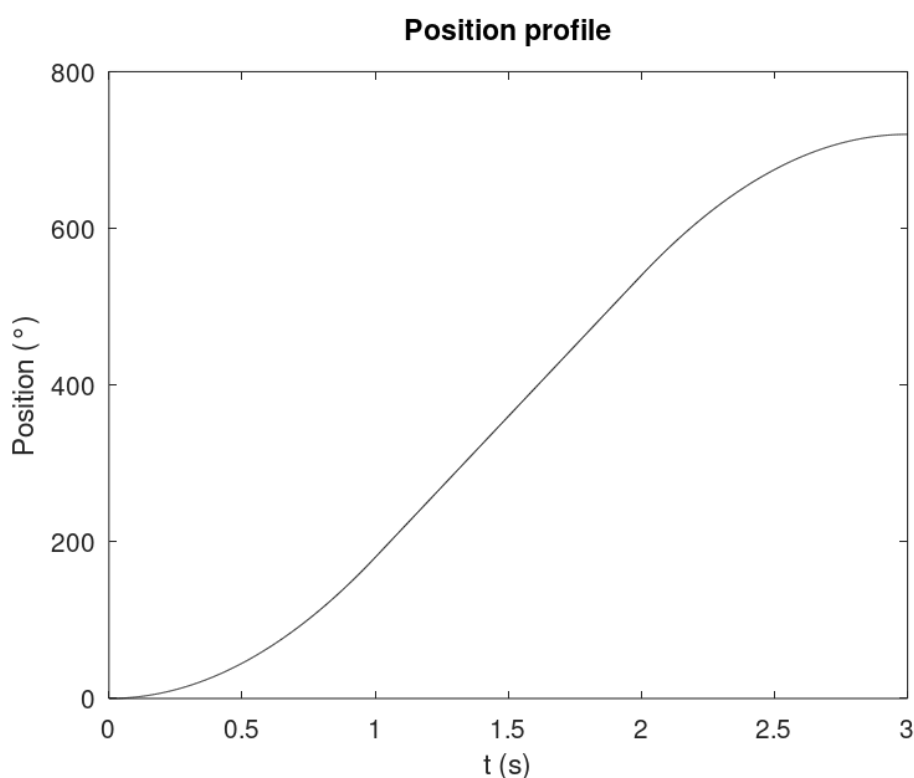


Figure 4.2: Positioning profile example.

In Figure 4.3 are represented both the position (continuous line) and speed (dashed line) profiles per unit (position / 360 ° and speed / 60 RPM).

## 4.1 Fieldbus Modes

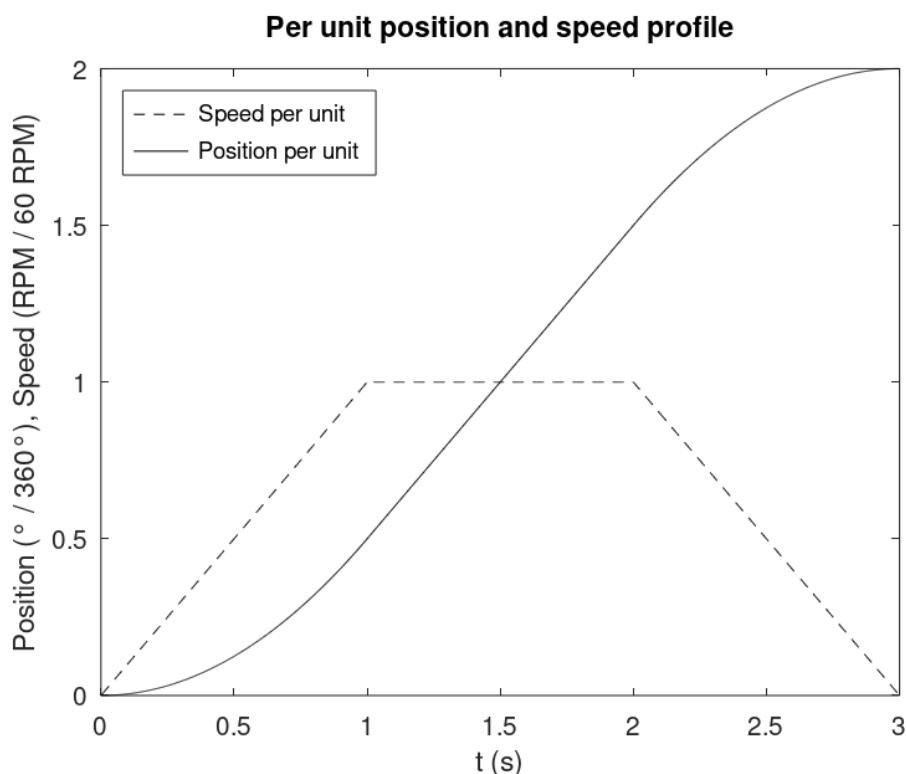


Figure 4.3: Positioning and speed profile example.

### 4.1.2.1 Relative Positioning

In relative positioning profile the target is computed as offset with respect to the current position. For example, if the actual absolute rotor position is  $360^\circ$  and the requested relative positioning target is  $360^\circ$ , the motor will rotate to reach the absolute position of  $720^\circ$ .

### 4.1.2.2 Absolute Positioning

In absolute positioning profile the target is absolute. For example, if the absolute rotor position is  $360^\circ$  and an absolute positioning target of  $360^\circ$  is given, the motor will not move.

### 4.1.3 Torque

This drive operation mode requires a specific target (current) torque, positive torque slope and negative torque slope. Target torque is expressed in mA and torque slopes in mA / s.

In Figure 4.4 is shown an example of torque profile with the following parameters:

- Positive torque slope = 1000 mA / s
- Negative torque slope = 1000 mA / s
- Initial torque = 0 mA
- Target torque = 1000 mA (target given at t = 0 s)
- Target torque = 0 mA (target given at t = 2 s)

## 4.1 Fieldbus Modes

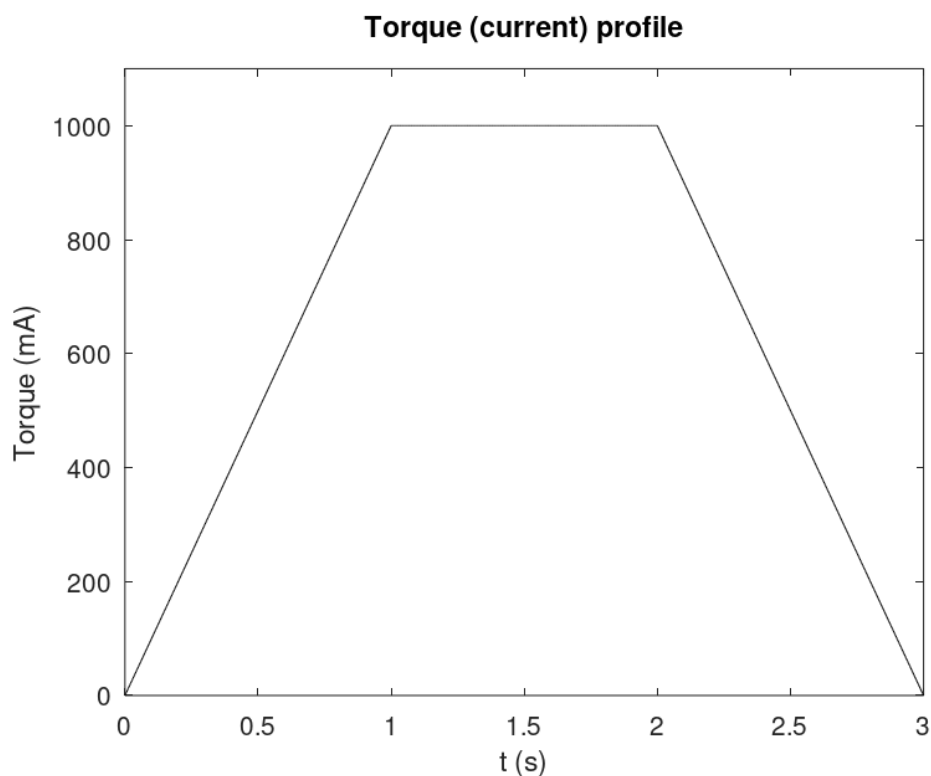


Figure 4.4: Torque (current) profile example.

### 4.1.4 Jog

The JOG mode allows to control the drive in speed mode using two bits of the controlword

Table 4.1: JOG truth table.

Bit 6	Bit 5	Effect
0	0	Stop (zero speed)
1	0	Clockwise rotation
0	1	Counter-clockwise rotation
1	1	Invalid command (previous state persists)

## 4.1 Fieldbus Modes

### 4.1.5 Homing

In this Section are described the possible homing procedures. It is mandatory to execute homing before using positioning operations. Homing parameters can be configured using UVIX interface (refer to Section 7.6.1.4). If proximity is used it must be connected to the PROXY INPUT (refer to Section 3.3.2).

#### 4.1.5.1 Positioning homing

Homing at the current position (refer to Figure 4.5). This mode does not require an external proximity

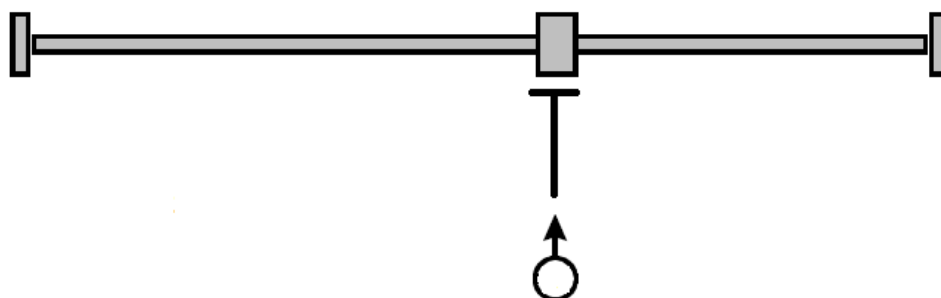


Figure 4.5: Positioning homing.

and the homing procedure consists of setting the current position (without moving the motor) as zero position.

#### 4.1.5.2 Proximity homing: negative direction

Proximity search in negative direction (refer to Figure 4.6).

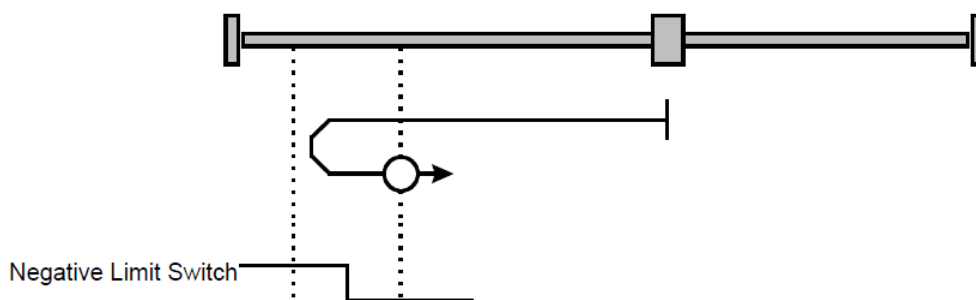


Figure 4.6: Proximity homing: negative direction.

In this mode, the motor searches for the zero proximity in the negative direction of the movement, with the velocity set to "homing speed search". As soon as the proximity is detected, the motor stops and exits the proximity, in the opposite direction, with the velocity set to "homing speed out". If the proximity is already detected on the start of the homing procedure, the motion will start with the "homing speed out" phase. If the proximity is surpassed because of the inadequate speed / deceleration combination, the homing procedure is interrupted and a homing error is returned.

#### 4.1.5.3 Proximity homing: positive direction

Proximity search in positive direction (refer to Figure 4.7).

## 4.1 Fieldbus Modes

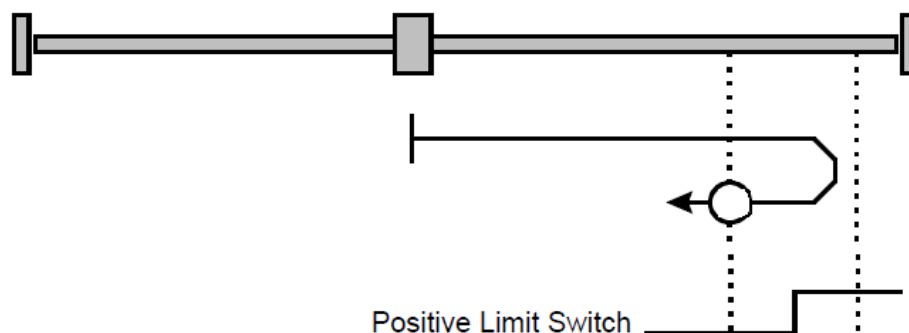


Figure 4.7: Proximity homing: positive direction.

In this mode, the motor searches for the zero proximity in the positive direction of the movement, with the velocity set to "homing speed search". As soon as the proximity is detected, the motor stops and exits the proximity, in the opposite direction, with the velocity set to "homing speed out". If the proximity is already detected on the start of the homing procedure, the motion will start with the "homing speed out" phase. If the proximity is surpassed because of the inadequate speed / deceleration combination, the homing procedure is interrupted and a homing error is returned.

### 4.1.5.4 Proximity homing: negative direction + zero encoder

Proximity search in negative direction and then search for the index pulse (zero of the encoder) in the positive direction (refer to Figure 4.8).

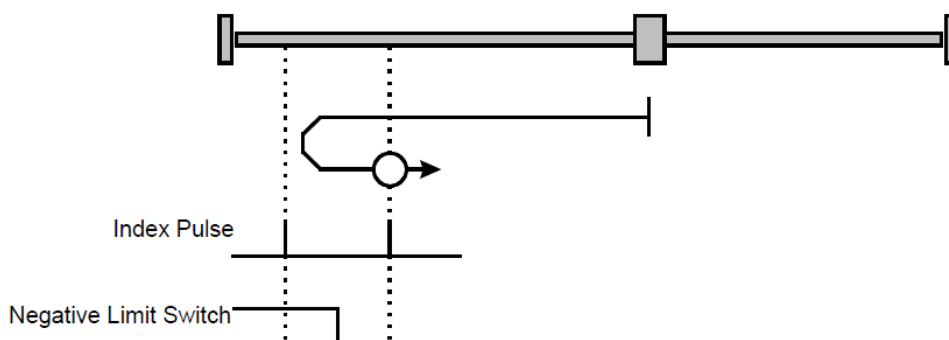


Figure 4.8: Proximity homing: negative direction + zero encoder.

In this mode, the motor searches for the zero proximity in the negative direction of the movement, with the velocity set to "homing speed search". As soon as the proximity is detected, the motor stops and exits the proximity, in the opposite direction, with the velocity set to "homing speed out", until it finds the zero encoder. If the proximity is already detected on the start of the homing procedure, the motion will start with the "homing speed out" phase. If the proximity is surpassed because of the inadequate speed / deceleration combination, the homing procedure is interrupted and a homing error is returned.

## 4.1 Fieldbus Modes

### 4.1.5.5 Proximity homing: positive direction + zero encoder

Proximity search in positive direction and then search for the index pulse (zero of the encoder) in the negative direction (refer to Figure 4.9).

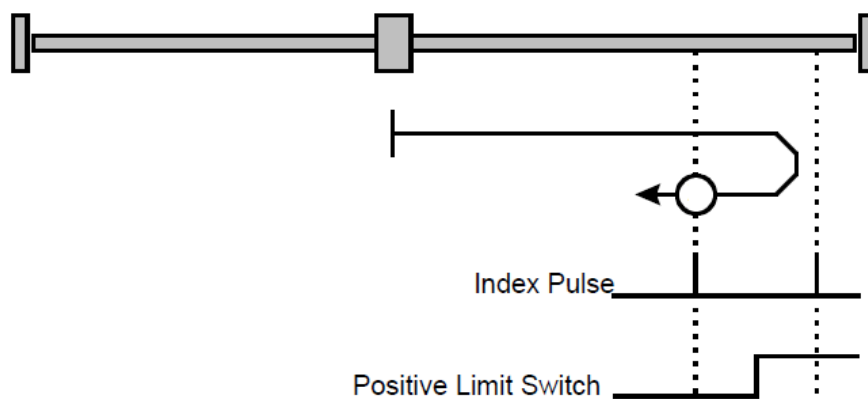


Figure 4.9: Proximity homing: positive direction + zero encoder.

In this mode, the motor searches for the zero proximity in the positive direction of the movement, with the velocity set to "homing speed search". As soon as the proximity is detected, the motor stops and exits the proximity, in the opposite direction, with the velocity set to "homing speed out", until it finds the zero encoder. If the proximity is already detected on the start of the homing procedure, the motion will start with the "homing speed out" phase. If the proximity is surpassed because of the inadequate speed / deceleration combination, the homing procedure is interrupted and a homing error is returned.

### 4.1.5.6 Torque homing: negative direction

Homing torque in negative direction (refer to Figure 4.10). In this mode the motor rotates in the neg-

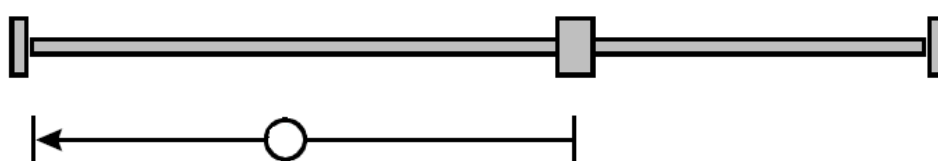


Figure 4.10: Torque homing: negative direction.

ative direction of the movement, with the velocity set to "homing speed search", until it stops against the end of the line and the  $I^2T$  reaches the homing set value.

### 4.1.5.7 Torque homing: positive direction

Homing torque in positive direction (refer to Figure 4.11). In this mode the motor rotates in the positive direction of the movement, with the velocity set to "homing speed search", until it stops against the end of the line and the  $I^2T$  reaches the homing set value.

## 4.1 Fieldbus Modes

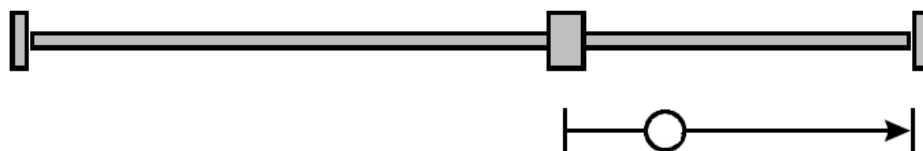


Figure 4.11: Torque homing: positive direction.

### 4.1.5.8 Torque homing: negative direction + zero encoder

Homing torque in negative direction and then search for the index pulse (zero of the encoder) in the positive direction (refer to Figure 4.12).

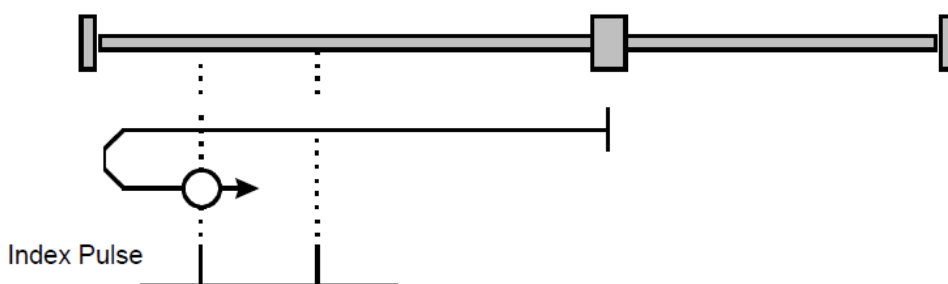


Figure 4.12: Torque homing: negative direction + zero encoder.

In this mode the motor rotates in the negative direction of the movement, with the velocity set to "homing speed search", until it stops against the end of the line and the  $I^2T$  reaches the homing set value. At this point the motor rotates in the opposite direction, with the velocity set to "homing speed out", until it finds the zero encoder.

### 4.1.5.9 Torque homing: positive direction + zero encoder

Homing torque in positive direction and then search for the index pulse (zero of the encoder) in the negative direction (refer to Figure 4.13).

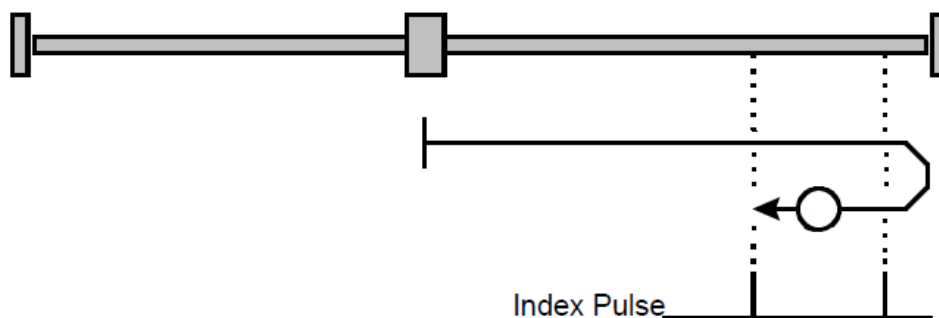


Figure 4.13: Torque homing: positive direction + zero encoder.

In this mode the motor rotates in the positive direction of the movement, with the velocity set to "homing speed search", until it stops against the end of the line and the  $I^2T$  reaches the homing set value. At this point the motor rotates in the opposite direction, with the velocity set to "homing speed out", until it finds the zero encoder.

## 4.1 Fieldbus Modes

---

### 4.1.5.10 Homing offset

The Homing offset indicates the configured difference between the **zero position** for the application and the machine **home position** (found during homing). During homing the motor moves to search the home position: it is possible to change the zero position, that by default is set at the same value of the home position, by adding an offset to the home position. This value could be positive or negative and all subsequent absolute movements shall be taken relative to this new zero position. This offset can be set by using the object 607Ch (Home offset parameter see [6.3.4.12](#))

## 4.2 Digital Input mode

### 4.2 Digital Input mode

The drive can be configured to be moved only using digital input signals. This functionality excludes the fieldbus and the motor can be moved in speed mode using only digital input.

The UVIX application must be used to set and enable the Digital Input mode and to set and store in non-volatile memory the specific parameters of this mode (see Figure 7.10). After these operations, the drive must be rebooted (turn OFF and ON the VL logic power supply) to apply the configuration.

Referring to Table 3.6 in Digital Input mode IN FW and IN BW are used to decide the direction of the movement, FRONT PROXY and REAR PROXY can be used as limits of the range of movement and the only output OUT ERR can be used to detect errors.

#### 4.2.1 Application example

Assuming the DRVI is connected at cylinder, the proximities REAR PROXY and FRONT PROXY must be mounted in two extreme positions of the cylinder: backward and forward as shown in figure 4.14.

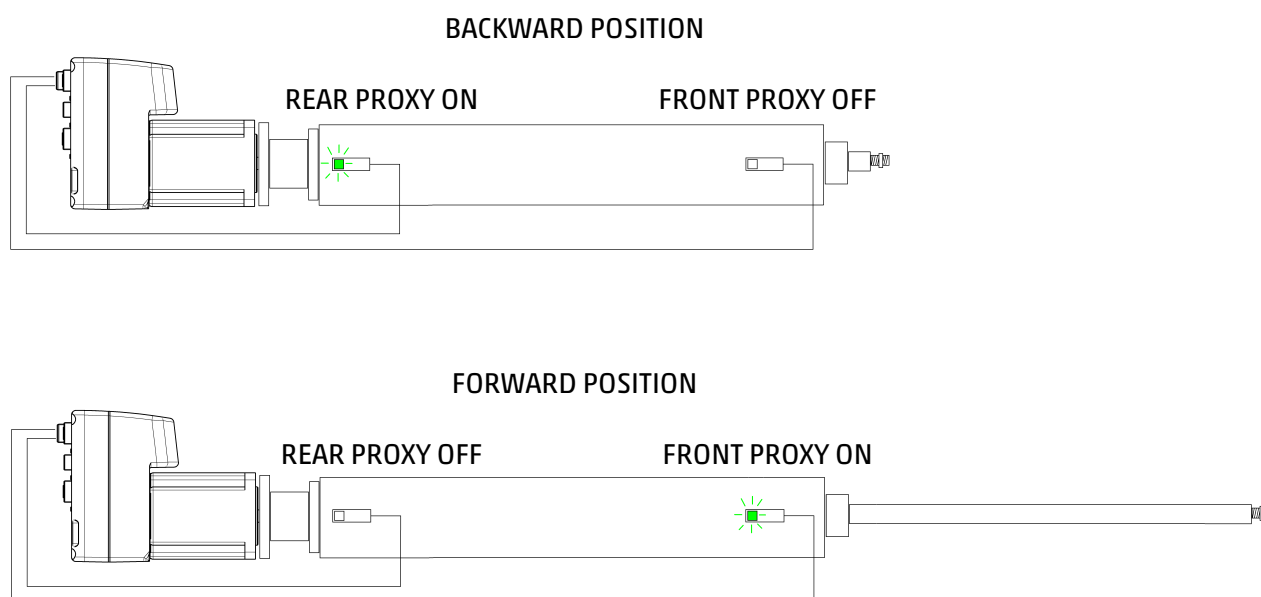


Figure 4.14: Extreme positions of cylinder.

**⚠** Each proximity sensor is linked to one single positions, be careful not reverse them.

The input IN FW and IN BW are used to command forward or backward movement respectively.

## 4.2 Digital Input mode

### 4.2.2 Functioning

Logic functioning is guaranteed by state machine, a simplified version is shown in figure 4.15.

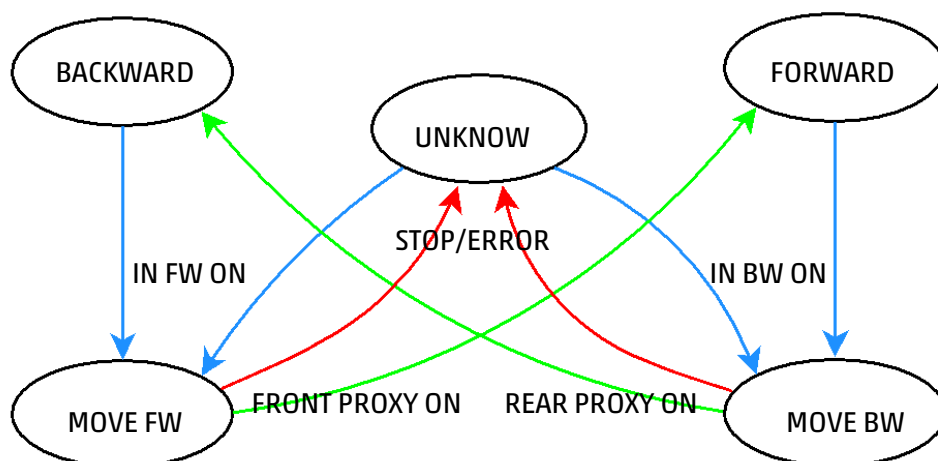


Figure 4.15: Simplified State Machine.

When device starts proximities are tested to know the position. Depending on the status of the proxies device can start in BACKWARD, UNKNOW or FORWARD state. In these three states the drive wait the rise of IN FW or IN BW to start the movement. When the movement ends by stop or error drive goes in UNKNOW state, otherwise if proxy is reached drive goes in BACKWARD or FORWARD state.

The movement is stopped when:

- IN FW and IN BW are both low and self-holding is disabled
- REAR PROXY or FRONT PROXY is reached
- drive error occurs

**▲** Self-holding of input IN FW and IN BW can be enabled using UVIX (see Figure 7.20)

Figures 4.16 and 4.17 show combinations of signals for two different self-holding settings.

## 4.2 Digital Input mode

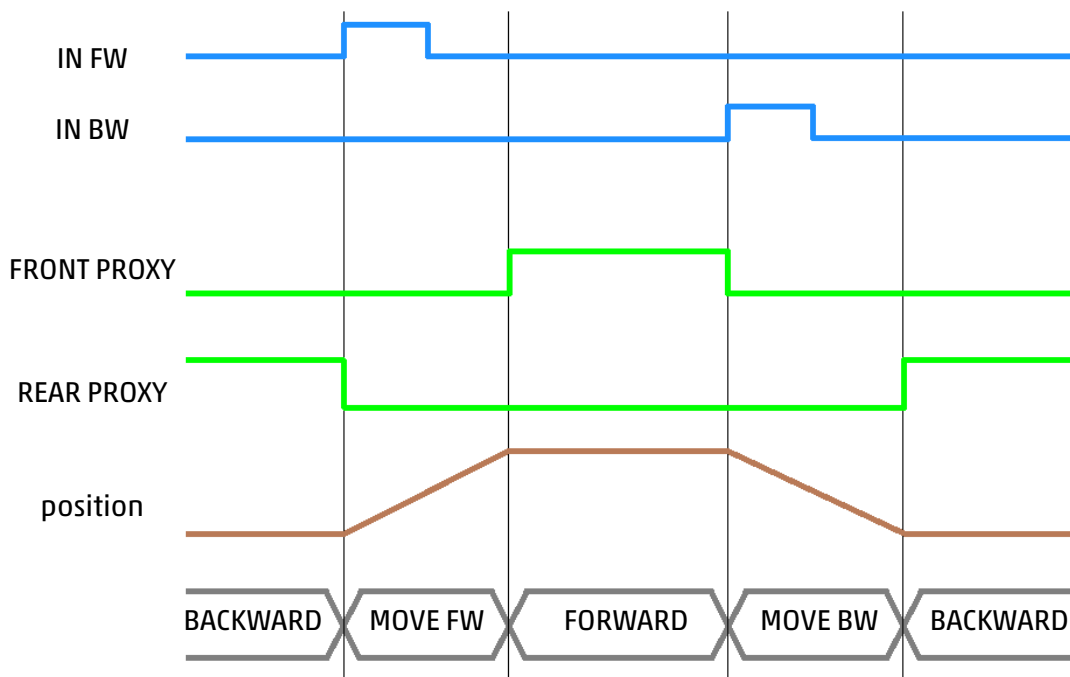


Figure 4.16: Signal combination example with self-holding enabled.

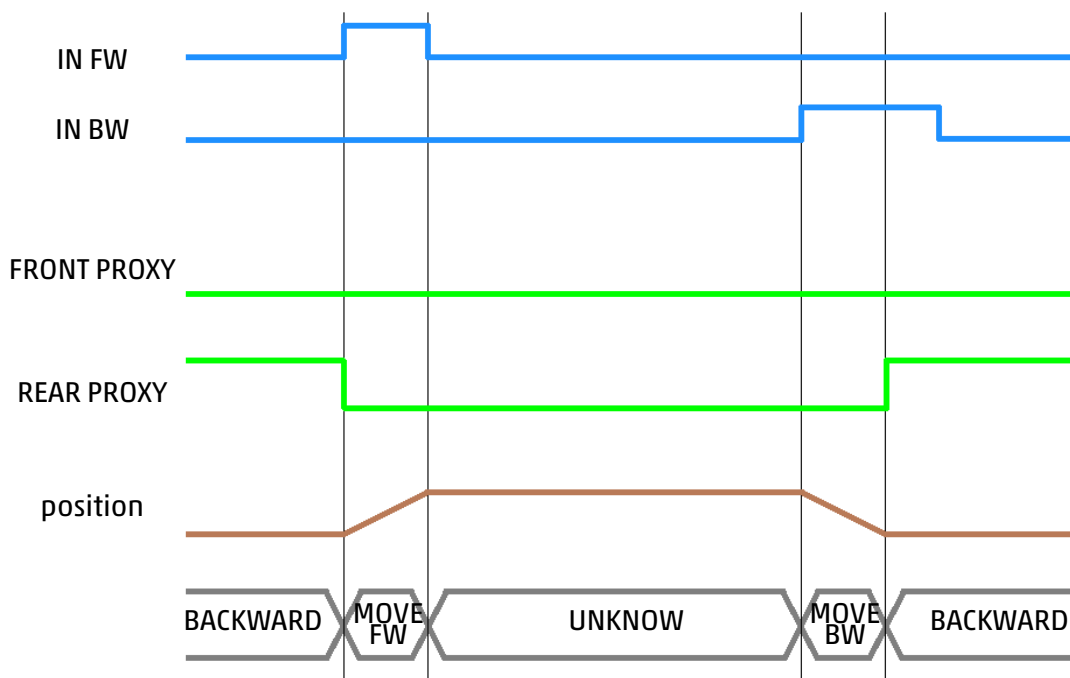


Figure 4.17: Signal combination example with self-holding disabled.

## 4.2 Digital Input mode

---

### 4.2.3 Self-holding with positioning

To achieve better performance is possible to use position control instead speed control (configurable with UVIX, see Figure 7.20). Normally in Digital Input mode the device is controlled in speed and start braking when the proxy turns on. High speed and low deceleration may cause a proximity lost error 4.2.5. With position control, the device always knows where it is and can decelerate before reaching the proximity. For this reason, *Self-holding with positioning* improves performance: it's possible to increasing speed and ensuring greater precision in reaching the position.

**▲** *Self-holding with positioning* requires a learning procedure (a sort of "double homing"): the first two movements are performed at a reduced speed with the aim of memorising the positions of the two proximities. This speed is called *Jog Speed search* (and it is configurable with UVIX, see Figure 7.21). This procedure must be repeated at each start-up, only if the device has been moved while it was off.

### 4.2.4 Error handler

When a drive error occur the movement is stopped and OUT ERR is reversed (only if not in manual mode). Reset error is possible by raising both input IN FW and IN BW, if error can be resetted OUT ERR return to previous logic state and the device turn servo ON.

## 4.2 Digital Input mode

### 4.2.5 Proximity lost error

The proximity lost error makes the SYS led blinking 4 times, according to table 3.11. This error should never occur using recommended values of acceleration deceleration and speed. When movements are fast with low deceleration, proximity may switch before drive stops. In other words the drive is unable to stop into the proximity's sensitivity zone, like shown in Figure 4.18.

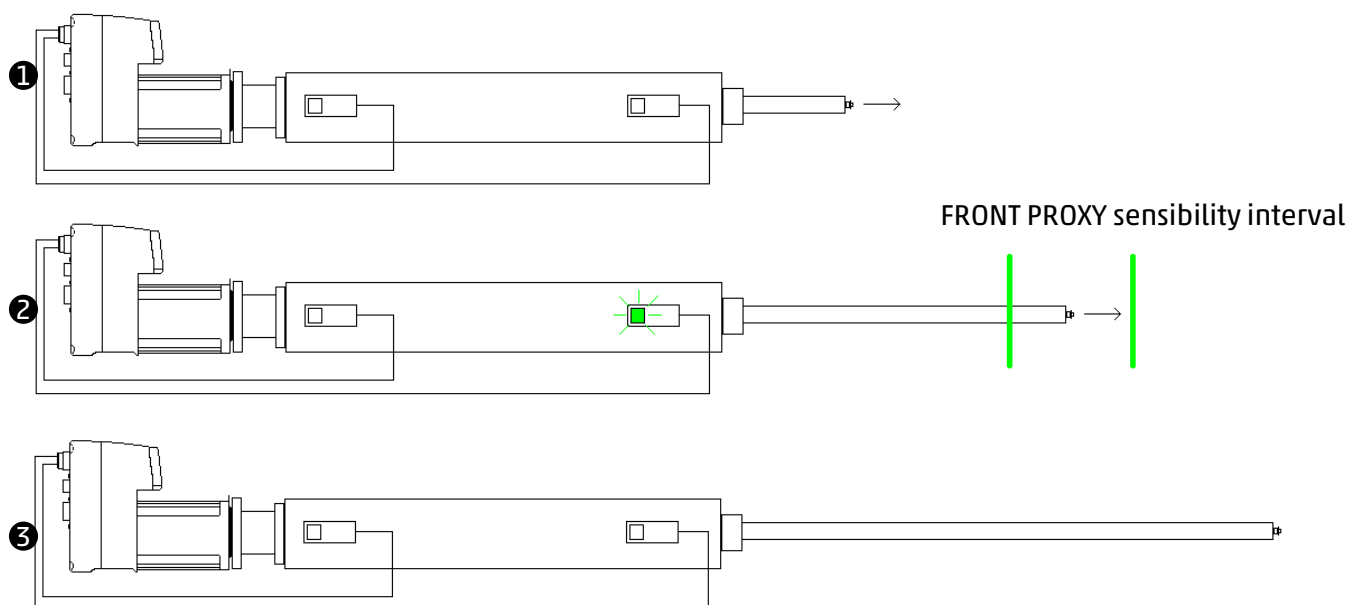


Figure 4.18: Example of proximity lost error:

- 1** cylinder moving forward unless find proximity;
- 2** FRONT PROXY turn on, so the drive starts to brake;
- 3** FRONT PROXY turned off before drive end to brake: proximity lost.

The proxy lost error is handled differently than other drive errors. Also in this case is necessary to raising both input IN FW and IN BW to reset error, after reset the drive moves in the opposite direction to re-find the proximity (using custom values of acceleration, deceleration and velocity).

# Other features

In this chapter are described other features that can be used in combination with the various modes of operation.

## 5.0.1 Profile software limits

Profile software limits can be set to restrict the motion parameters (positions, speed, acceleration and deceleration) to a desired value.

Such limits can be configured using the UVIX interface (refer to Section 7.5.1) and are valid for all the configurations different from "only motor" and for all the modes of operation.

Software limits take effect only after homing execution and if the corresponding "software limits enable" in the protocol is set (refer to Chapter 6 controlword bit11 ). In case a position software limit error is triggered (for example the servo has been set momentary OFF and the motor has been moved beyond the software position limit or the EXT PROXY INPUT signal has been caught), the drive, if it was moving, stops itself using the QUICK\_STOP that is the deceleration parameter set in UVIX (refer to Section 7.5.2) and it goes into error state and the correspondent error is raised on the fieldbus. In such situation, to bring back the motor into the allowed position range, the error must be reset first (the red error led goes off for a little time and then blinks again because the motor is still in a error position) and then restore the servo on . Then, even if the red error led blinks, it is allowed to move the motor using any of the mode of operations (even if it is still out of the allowed range, because the software limit check will be momentary disabled). The error check on positioning will be restored automatically after the first movement completion (target position for positioning control or zero speed for speed control), provided that the "software limit enable" is still set. When the motor is moved and return inside the allowed stroke range values, it is possible to clear the error sending the reset error command for 2 times.

Regarding target position, target speed, acceleration and deceleration values, if their target values exceed the limit value, the set is inhibited, that is, the parameter is not applied (the previous valid parameter remains valid) and the "command refused" warning is raised.

*Profile position hardware limit:* The position limit feature of Section 5.0.1 can be achieved also using a proximity sensor connected to the EXT PROXY INPUT (refer to Section 3.3.2). As soon as the EXT PROXY INPUT goes to HIGH state, the drive behaves as described in Section 5.0.1. Note that the hardware limit takes effect only if the "software limits enable" in the protocol is set.

## 5.0.2 Torque limit

Torque limitation is a feature that allows to limit the torque (current) supplied by the motor. This feature can be enabled and disabled using the provided "torque limit enable" in the protocol (refer to Chapter 6, controlword bit12 .) and it takes effect for all the modes of operation. The current limit value is configured using the fieldbus interface and it can be changed in real-time using the Target torque pa-

parameter(refer to Chapter 6).

### **5.0.3 Save and restore actual position**

From firmware version 2.07 has been added the management that can save and restore the actual position: in case the DRVI has already executed and completed successfully an homing procedure and the motor is stopped, if the power supply goes OFF, the DRVI try to save the information about the actual position and next time power supply is turned ON, check if the actual encoder position is the same that has been saved at shutdown (with a small tolerance) and in this case restore the position. With this procedure it should not be necessary to do the homing procedure every time you turn it on and motor can continue from the situation at shutdown.

# EtherCAT Protocol

This Chapter describes how to configure and control the drive with an EtherCAT PLC. The device supports the CANopen over EtherCAT protocol (CoE), that follows the CiA 301 standard. DS-402 is the device profile for drives and motion control. CoE carries this well-proven profile from CANopen to the EtherCAT environment. Another protocol supported by the device is Ethernet over EtherCAT (EoE) that allows Ethernet communications over an EtherCAT network.

## 6.1 Conventions

In this Section is given a description about the conventions used in this manual.

The data types used are shown in Table 6.1:

Table 6.1: Data types.

Name	Size
S32	32 bit signed
U32	32 bit unsigned
S16	16 bit signed
U16	16 bit unsigned
S8	8 bit signed
U8	8 bit unsigned
STR	string

In Table 6.2 are shown the units of measurement used by the drive.

Table 6.2: Units of measurement.

Quantity	Unit
Position	Degrees · 100 (*)
	mm · 100 (**)
Speed	RPM (*)
	mm / s (**)
Acceleration	RPM / s (*)
	mm / s <sup>2</sup> (**)
	mA / s (***)
Deceleration	RPM / s (*)
	mm / s <sup>2</sup> (**)
	mA / s (***)
Torque (current)	mA

(\*) Used when the drive is configured as "only motor".

(\*\*) Used in all other configurations different from "only motor".

(\*\*\*) Used in torque (current) control.

## 6.1 Conventions

A positive position or a positive speed target cause the motor shaft to rotate in a clockwise direction, when the motor shaft is viewed from the front. Example: a position target of 36000, when the drive is configured as "only motor", corresponds to one turn of the shaft in a clockwise direction.

### 6.1.1 EtherCAT states machine

In Figure 6.1 is shown the EtherCAT states machine, while in Table 6.3 are represented the transitions and the commands involved.

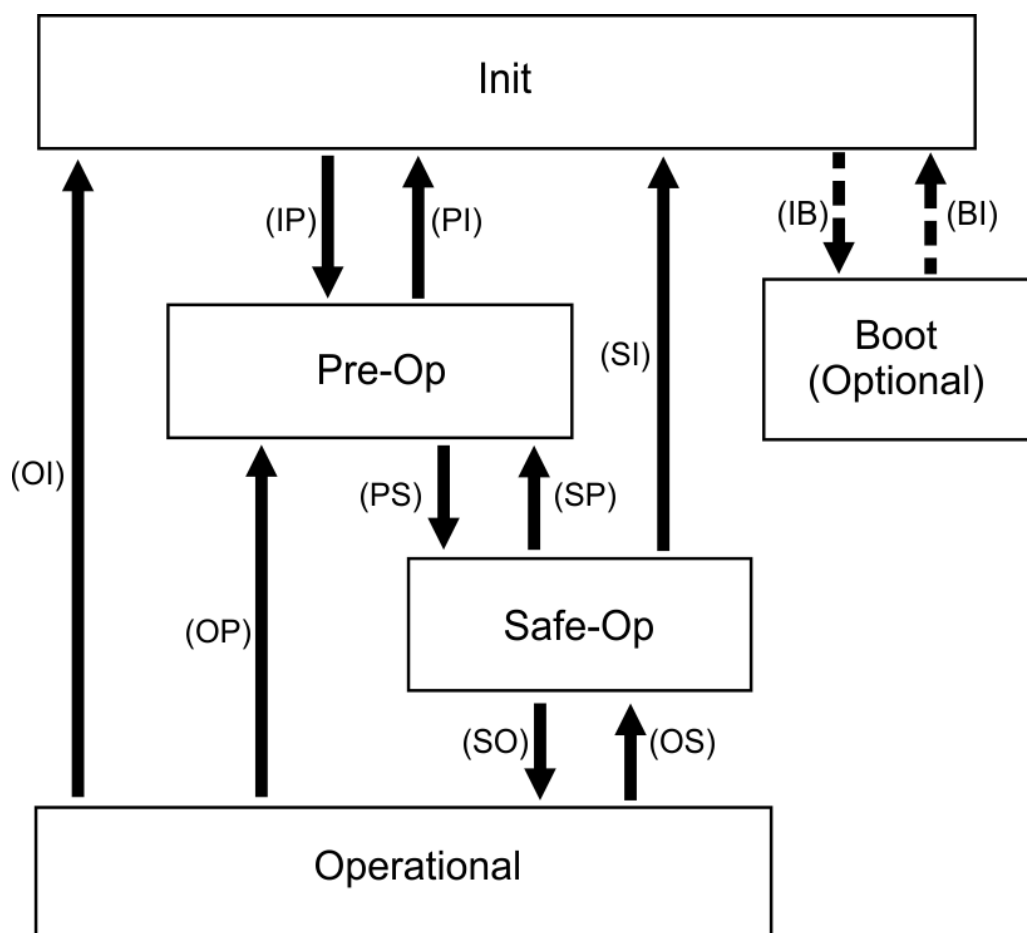


Figure 6.1: EtherCAT states machine.

Table 6.3: Transitions of the state machine.

Transition	Services
(IP)	SDO communication starts: automatically enter in this state after Power On
(PI)	SDO communication is stopped
(PS)	Start PDO communication
(SP)	Stop PDO communication
(SO)	SDO and PDO communications are enabled
(OS)	Reset node command
(OP)	Stop PDO communication
(SI)	Stop PDO and SDO communications
(OI)	Stop PDO and SDO communications

## 6.2 Configuration via ESI file

The EtherCAT states have different features enabled: they are described in Table 6.4.

Table 6.4: EtherCAT state features.

State	PDO	SDO	Description
Init	NO	NO	Enter in this state automatically after reset / power on
PreOperational	NO	YES	Configure the Sync Manager register for SDO
Safe Op	YES	YES	Configure the Sync Manager register for PDO and PDO mapping
Operational	YES	YES	Every type of messages is possible

## 6.2 Configuration via ESI file

To configure the DRVI in an EtherCAT network, the ESI (EtherCAT Slave Information) file must be imported into the programming software used for the controller. The ESI is an XML file that is used by EtherCAT master stacks, to configure the slaves and generate network description files. It also describes how data is shared with the slave, including the sync managers used and which PDOs are in each sync manager.

## 6.3 Object dictionary

Inside the ESI file is present the dictionary with all the objects necessary for the communications and for the management of the drive. Its structure follows the CANopen CiA 301 and CiA 402 standards. In the following Sections is given a description of the dictionary.

### 6.3.1 Communication Profile - CiA 301 objects

In Table 6.5 are listed the CiA 301 objects.

Table 6.5: CiA 301 objects.

ID	Sub	Description	Type	Access	PDO Mapping	Default Value
1000h	0	Device Type	U32	RO		0xFF7A0192
1001h	0	Error Register	U8	RO		
1008h	0	Manufacturer Device Name	STR	CONST		DRVI
1018h		Identity object				
	0	number of entries	U8	RO		4
	1	Vendor Id	U32	RO		0x00000097
	2	Product Code	U32	RO		0x0000005A
	3	Revision number	U32	RO		0x00000001
1600h	4	Serial number	U32	RO		0
		Receive PDO Mapping Parameter1				
	0	Number of mapped objects	U8	RW		0x01
	1	Mapping Entry 1	U32	RW		0x60400010
	2	Mapping Entry 2	U32	RW		0
	3	Mapping Entry 3	U32	RW		0

*Continued on next page.*

### 6.3 Object dictionary

Table 6.5 – Continued from previous page.

ID	Sub	Description	Type	Access	PDO Mapping	Default Value
	4	Mapping Entry 4	U32	RW		0
	5	Mapping Entry 5	U32	RW		0
	6	Mapping Entry 6	U32	RW		0
	7	Mapping Entry 7	U32	RW		0
	8	Mapping Entry 8	U32	RW		0
1601h	0	Receive PDO Mapping Parameter2				
1602h	0	Receive PDO Mapping Parameter3				
1603h	0	Receive PDO Mapping Parameter4				
1604h	0	Receive PDO Mapping Parameter5				
1605h	0	Receive PDO Mapping Parameter6				
1606h	0	Receive PDO Mapping Parameter7				
1607h	0	Receive PDO Mapping Parameter8				
1A00h		Transmit PDO Mapping Parameter 1				
	0	Number of mapped objects	U8	RW		0x01
	1	Mapping Entry 1	U32	RW		0x60410010
	2	Mapping Entry 2	U32	RW		0
	3	Mapping Entry 3	U32	RW		0
	4	Mapping Entry 4	U32	RW		0
	5	Mapping Entry 5	U32	RW		0
	6	Mapping Entry 6	U32	RW		0
	7	Mapping Entry 7	U32	RW		0
	8	Mapping Entry 8	U32	RW		0
1A01h	0	Transmit PDO Mapping Parameter 2				
1A02h	0	Transmit PDO Mapping Parameter 3				
1A03h	0	Transmit PDO Mapping Parameter 4				
1A04h	0	Transmit PDO Mapping Parameter 5				

Continued on next page.

## 6.3 Object dictionary

Table 6.5 – Continued from previous page.

ID	Sub	Description	Type	Access	PDO Mapping	Default Value
1A05h	0	Transmit PDO Mapping Parameter 6				
1A06h	0	Transmit PDO Mapping Parameter 7				
1A07h	0	Transmit PDO Mapping Parameter 8				

### 6.3.2 CiA 301 objects descriptions

In the following Sections are described the CiA 301 objects.

#### 6.3.2.1 1000h Device type

This object contains information on the device type and its functions. It consists in a two 16-bit fields, one describing the profile used and a second containing additional specific information.

#### 6.3.2.2 1001h Error register

This object contains the device's internal error mapping: it is a mandatory object for all devices and it is part of the emergency objects. The values are defined in Table 6.6.

Table 6.6: Error values.

Bit	Optional	Description
0	Mandatory	Generic error
1	Optional	Current
2	Optional	Voltage
3	Optional	Temperature
4	Optional	Communication error
5	Optional	Profile specific
6	Optional	Reserved
7	Optional	Reserved

#### 6.3.2.3 1008h Manufacturer hardware name

This object contains the device name given by the manufacturer .

#### 6.3.2.4 100Ah Manufacturer software version

This object contains the firmware version of the device.

#### 6.3.2.5 1018h Identity object

This object contains information about the device as shown in Table 6.7.

## 6.3 Object dictionary

Table 6.7: Identity object.

Sub index	Value	Description
0	4	EMCY present / valid
1	97h	Vendor ID
2	5Ah	Product code
3	1	Revision number
4	0	Serial number

### 6.3.2.6 1600h – 1607h Receive PDO Mapping Parameter

These objects contain the PDO mapping that the device is able to receive.

### 6.3.2.7 1A00h – 1A07h Transmit PDO mapping parameter

These objects contain the PDO mapping that the device is able to transmit.

## 6.3 Object dictionary

### 6.3.3 Device Profile - CiA 402 objects

In Table 6.8 are listed the CiA 402 objects.

Table 6.8: CiA 402 objects.

ID	Sub	Description	Type	Access	PDO Mapping	Default Value
603Fh	0	Error Code	U16	RO		0
6040h	0	Controlword	U16	RW	RPDO	0
6041h	0	Statusword	U16	RO	TPDO	0
6060h	0	Mode of operation	S8	RW	RPDO	0
6061h	0	Mode of operation display	S8	RO	TPDO	0
6064h	0	Position Actual Value	S32	RO	TPDO	0
606Ch	0	Velocity Actual Value	S32	RO	TPDO	0
6071h	0	Target torque	S16	RW	RPDO	0
6074h	0	Torque demand value	S16	RO		0
6077h	0	Torque actual value	S16	RO	RPDO	0
607Ah	0	Target position	S32	RW	RPDO	0
607Ch	0	Home offset	S32	RW		0
607Eh	0	Polarity	U8	RW		0
6081h	0	Profile Velocity in pp-mode	U32	RW	RPDO	0
6083h	0	Profile Acceleration	U32	RW	RPDO	0
6084h	0	Profile Deceleration	U32	RW	RPDO	0
6087h	0	Torque slope	U32	RW		0
6091h		Gear Ratio				
	0	Highest sub-index supported	U8	RO		
	1	MotorRevs	U32	RW		0
	2	ShaftRevs	U32	RW		0
6098h	0	Homing Method	S8	RW		37
6099h		Homing Speeds				
	0	Highest sub-index supported	U8	RO		
	1	Fast Homing Speed	U32	RW		100
	2	Slow Homing Speed	U32	RW		100
609Ah	0	Homing acceleration	U32	RW		100
60FFh	0	Target Velocity	S32	RW	RPDO	0
6502h	0	Supported drive modes	U32	RO		0x8003003F

### 6.3.4 CiA 402 objects descriptions

In the following Sections are described the CiA 402 objects.

#### 6.3.4.1 603Fh Error code

This object contains the last error code that occurred on the drive.

## 6.3 Object dictionary

### 6.3.4.2 6040h Controlword

This object checks the drive status and function. It is used to enable / disable the drive and to start / stop a movement.

#### Cia402 FSA state machine (parameter 0x8009h=1):

This object, together with the "status word" is used for the state machine management of the CiA402 profile (refer to the relative manual CiA402-2 and to Figure 6.2). This features can be disabled using the startup parameter 8009h (see 6.4.2.15)

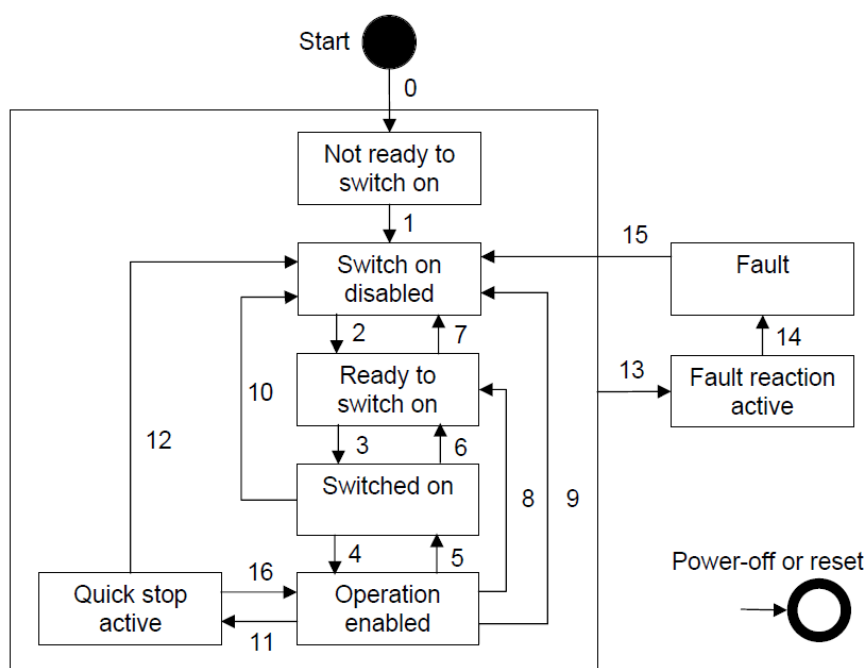


Figure 6.2: Power drive system finite state automaton.

The control word (see Figure 6.3) is subdivided into bits with the following meanings:

- so = startup
- ev = enable power
- qs = quick stop
- eo = enable command
- sm = start movement
- oms = dependent on operating mode
- fr = error reset
- h = halt
- le = limit enable
- tle = torque limit enable

 


Figure 6.3: Controlword bits with FSA state machine.

### 6.3 Object dictionary

The possible commands to change the drive status are summarized in Table 6.9.

Table 6.9: Controlword bits commands.

Controlword (bit15 ... bit0)	Commands	FSA
xxxx xxxx 0xxx x110	Shutdown	2, 6, 8
xxxx xxxx 0xxx 0111	Switch on	3
xxxx xxxx 0xxx x111	Enable operation	4, 16
xxxx xxxx 0xxx xx0x	Disable voltage	7, 9, 10, 12
xxxx xxxx 0xxx x01x	Quick stop	7, 10, 11
xxxx xxxx 0xxx 0111	Disable operation	5
xxxx xxxx 1xxx xxxx	Fault reset	
xxxx 1xxx xxxx xxxx	Sw Limits enable	
xxx1 xxxx xxxx xxxx	Torque limit enable	

The bit 8 is the halt function and it interrupts the command execution, to continue the movement it must be reset, and a new start must be triggered (depending on the operating mode).

#### Controlword with no FSA state machine (parameter 0x8009h=0):

Referring to table 6.17 if PDS FSA Enable bit is Disabled the control word must be evaluated considering the bits subdivision shown in figure 6.4 with the following meanings:

- ev = enable power
- qs = quick stop
- sm = start movement
- oms = dependent on operating mode
- fr = error reset
- h = halt
- le = software limit enable
- tle = torque limit enable

 


Figure 6.4: Controlword bits without FSA state machine.

## 6.3 Object dictionary

### 6.3.4.3 6041h Statusword

#### Cia402 FSA state machine (parameter 0x8009h=1):

The status word (see Figure 6.5) is a read-only object that represents the current status of the drive. It is subdivided into bits with the following meanings:

- rtso = ready for operation
- so = active operation
- oe = command enabled
- f = error (drive in error status)
- qs = quick stop
- sod = operation disabled
- w = warning (drive status does not change)
- tr = target reached
- ha / jl = homing attained / jog left
- tle / jr = torque limit enable / jog right
- mm = manual mode
- le = software limit enable

 


Figure 6.5: Statusword bits

The bit configurations according to drive status is summarized in Table 6.10.

Table 6.10: Statusword bits.

Statusword (bit15 ... bit0)	Drive status
xxxx xxxx x0xx 0000	Not ready to operate
xxxx xxxx x1xx 0000	Operation disabled
xxxx xxxx x01x 0001	Ready for operation
xxxx xxxx x01x 0011	Operation active
xxxx xxxx x01x 0111	Command active
xxxx xxxx x00x 0111	Quick stop active
xxxx xxxx x0xx 1111	Error during command
xxxx xxxx x0xx 1000	Drive in error status
xxxx xxxx 1xxx xxxx	Warning
xxxx x1xx xxxx xxxx	Target reached
xxx1 xxxx xxxx xxxx	Jog left
xx1x xxxx xxxx xxxx	Jog righth or Torque Limit enabled
x1xx xxxx xxxx xxxx	Manual mode
1xxx xxxx xxxx xxxx	Sw limits enabled

## 6.3 Object dictionary

### Statusword with no FSA state machine (parameter 0x8009h=0):

Referring to table 6.17 if PDS FSA Enable bit is Disabled the control word must be evaluated considering the bits subdivision shown in figure 6.6 with the following meanings:

- f = error (drive in error status)
- ve = voltage enabled (servo on/off)
- w = warning (drive status does not change)
- tr = target reached
- ha / jl = homing attained / jog left
- tle / jr = torque limit enable / jog right
- mm = manual mode
- le = software limit enable

 


Figure 6.6: Statusword bits without FSA state machine.

#### 6.3.4.4 6060h Mode of operation

This object contains the drive operating mode request. The operating modes are specified in Table 6.11.

Table 6.11: Mode of operation bits.

Value	Operating mode
0	No mode requested
1	Position profile
3	Velocity profile
4	Torque profile
6	Homing mode
14	Jog mode

#### 6.3.4.5 6061h Mode of operation display

This object contains the operating mode value in which the drive is located. It can be one of the profiles listed in Table 6.11.

#### 6.3.4.6 6064h Position actual value

This object contains the current position value measured by the drive, expressed in the set unit of measurement.

#### 6.3.4.7 606Ch Velocity actual value

This object contains the actual velocity value measured by the drive, expressed in the set unit of measurement.

## 6.3 Object dictionary

### 6.3.4.8 6071h Target torque

This object shall indicate the configured input value for the torque controller in profile torque mode, in position mode and velocity mode.

### 6.3.4.9 6074h Torque demand value

This object shall provide the output value of the trajectory generator.

### 6.3.4.10 6077h Torque actual value

This object shall provide the actual value of the torque. It shall correspond to the instantaneous torque (current) in the motor.

### 6.3.4.11 607Ah Target position

This object contains the position that the motor must reach when the operation is in the position profile, using the velocity and acceleration parameters specified by the designated objects. The target position can be considered as an absolute or relative value according to the bit "abs / rel" of the controlword (specific bits for the profile). Upon reaching the position, bit 10 "target reached" of the statusword is set.

### 6.3.4.12 607Ch Home offset

This object contains the offset to apply to the physical zero position (imposed by the proximity position) to obtain the zero position of the motor. The drive execute the homing procedure requested (stop on switch, stop on zero encoder, stop on current threasold, etc.) and when it is finished, it sets the actual position to the offset value.

### 6.3.4.13 607Eh Polarity

This object allows the motor rotation direction to be reversed, in order to change the movement direction based on the physical mounting of the motor. Setting bit 7 reverses the rotation direction.

NOTE: this parameter has an impact to ALL the mode of operation (homings, positioning, speed, torque)

Table 6.12: Polarity values.

Value	Direction
0x00	Forward
0x80	Reverse

### 6.3.4.14 6081h Profile velocity in pp-mode

This object contains the value of the velocity reached after the acceleration phase, during the position profile movement, valid for both directions.

## 6.3 Object dictionary

---

### 6.3.4.15 6083h Profile acceleration

This object contains the acceleration value used during the position profile movement, which determines the ramp with which the velocity set in the previous object will be reached.

### 6.3.4.16 6084h Profile deceleration

This object contains the deceleration value used during the position profile movement, which determines the ramp with which the zero velocity will be reached.

### 6.3.4.17 6087h Torque slope

This object shall indicate the configured rate of change of torque. The value shall be given in units of per thousand of rated torque per second.

### 6.3.4.18 6091h Motor ratio

This object has 2 subindex items:

- 6091h subindex 01: motor shaft revolutions
- 6091h subindex 02: driving shaft revolutions.

This object shall indicate the configured number of motor shaft revolutions and the number of driving shaft revolutions. The gear ratio shall be calculated by the following formula: gear ratio = motor shaft revolutions / driving shaft revolutions.

### 6.3.4.19 6098h Homing method

This object contains the zeroing method used by the device for the homing procedure, the permitted values are:

- 1 = Homing with zero proximity search in the positive direction and then search for the index pulse (zero of the encoder) in the negative direction.
- 2 = Homing with zero proximity search in the negative direction and then search for the index pulse (zero of the encoder) in the positive direction.
- 17 = Homing with zero proximity search in the negative direction.
- 18 = Homing with zero proximity search in the positive direction.
- 37 = Homing without zero proximity: the actual position will be the zero position.
- -1 = Homing on negative torque and index pulse (zero of the encoder): search in the negative direction for the current limit and then go in the positive direction, until zero encoder is found.
- -2 = Homing on positive torque and index pulse (zero of the encoder): search in the positive direction for the current limit and then go in the negative direction, until zero encoder is found.
- -3 = Homing on negative torque: search in the negative direction for the current limit and then stops there.
- -4 = Homing on positive torque: search in the positive direction for the current limit and then stops there.

## 6.3 Object dictionary

---

### 6.3.4.20 6099h Homing speeds

This object contains the speed values used during the zero procedure.

- Fast homing speed = speed used to search for the zero proximity.
- Slow homing speed = speed used to start from the zero proximity and to find the index pulse.

### 6.3.4.21 609Ah Homing acceleration

This object shall indicate the configured acceleration and deceleration to be used during homing operation.

### 6.3.4.22 60FFh Target velocity

This object contains the target velocity used during the velocity profile operation.

### 6.3.4.23 6502h Supported drive modes

This object shall provide information on the supported drive modes. This object is organized bit-wise.

The bits have the following meaning:

- bit 0: profile position mode
- bit 1: velocity mode
- bit 2: profile velocity mode
- bit 3: profile torque mode
- bit 4: reserved
- bit 5: homing mode
- bit 6: interpolated position mode
- bit 7: cyclic synchronous position mode
- bit 8: cyclic synchronous velocity mode
- bit 9: cyclic synchronous torque mode
- bit 10-15: reserved
- bit 16-31: manufacturer-specific

The bit values have the following meaning:

- bit value = 0: mode is not supported
- bit value = 1: mode is supported

## 6.3 Object dictionary

### 6.3.5 Manufacturer custom objects

In Table 6.13 are represented the manufacturer custom objects.

Table 6.13: Manufacturer custom objects.

ID	Sub	Description	Type	Access	PDO Mapping	Default Value
2002h	0	Input Status	U16	RO	TPDO	0
2003h	0	Output Status	U16	RW	TPDO	0
2004h	0	Homing Ok	U8	RO		0
2006h	0	Warnings	U16	RO	-	0
2020h	0	Diagnostic	U32	RO	TPDO	0

### 6.3.6 Manufacturer custom objects descriptions

In the following Sections are described the manufacturer custom objects.

#### 6.3.6.1 2002h Input status

This read-only parameter contains the status of the inputs present in the drive. The bit representation is described in Table 6.14. A "0" value represents a LOW input state and a "1" value represents a HIGH input state.

Table 6.14: Input Status bit.

Bit 31-4	Bit 3	Bit 2	Bit 1	Bit 0
Reserved	Proxy	Proxy Ext	In2	In1

#### 6.3.6.2 2003h Output status

This read-only object contains the status of the outputs present in the drive (only 1). The bit representation is described in Table 6.15. A "0" value represents a LOW output state and a "1" value represents a HIGH output state.

Table 6.15: Output Status bit.

Bit 31-1	Bit 0
Reserved	Out

#### 6.3.6.3 2004h Homing ok

This read-only object contains the homing status.

- 1 = Homing done
- 0 = Homing not performed

#### 6.3.6.4 2006h Warnings

This read-only object contains the possible warnings coded with 1 bit for each warning type. A complete descriptions of every bit is described in the Table 6.21

## 6.3 Object dictionary

### 6.3.6.5 2020h Diagnostic

The DIAGNOSTIC\_WORD variable returns the state of both errors and warnings.

In Table 6.16 is shown the bit-field of the diagnostic word: the upper 16 bits represent the errors, while the last 16 bits represent the warnings.

Table 6.16: Diagnostic word description.

Bit	Warnings
0	VDC UVLO (< 20V)
1	VDC OVLO (> 60V)
2	VL UVLO (< 21V)
3	VL OVLO (> 27V)
4	Temperature motor limit (> 75°C)
5	Temperature drive limit (> 75°C)
6	Calibration not done
7	RESERVED
8	Homing not done
9	Target speed not reached
10	Target position not reached
11	Command refused
12 ... 15	RESERVED
Bit	Errors
16	VDC UVLO (< 10V)
17	VDC OVLO (> 80V)
18	VL UVLO (< 16V)
19	VL OVLO (> 29V)
20	Temperature motor limit (> 100°C)
21	Temperature drive limit (> 100°C)
22	Current sensors fault
23	Control fault
24	Encoder fault
25	Non volatile memory fault
26	I <sup>2</sup> T fault
27	STO
28	Homing execution error
29	Software limits error
30 ... 31	RESERVED

### 6.4 Startup parameters

In Table 6.17 are listed the parameters that are sent by the PLC to the drive at the startup.

If the option "Stored Parameters" of "System Start" parameter is selected, the drive will load the startup parameters stored in internal memory, instead if the option "External" is used, the drive will use the parameters sent by the PLC. All the parameters are stored in non volatile memory upon variation.

The "Endianness" parameter allows to set the endianness of the communication between the PLC and the drive.

The "Diagnosis" parameter allows to enable or disable the diagnostic errors. The "PID Selection" parameter provides five different presets for speed and position PID controllers, that can be selected according to the specific application. For particular needs, the "PID Custom" configuration can be used and in this case, PID speed and position can be tuned using "PID Position" and "PID Speed" parameters. It is suggested to use the "Default" PID configuration when the drive has little or no load attached. Use instead the other presets, according to the entity of the load attached to the shaft.

The "Profile Check" parameter allows to control if the target speed (when in speed control) or the target position and speed (when in position control) are actually reached by the motor, during the motion execution. The "Profile Timeout" parameter, expressed in milliseconds, is the time after which the error is returned, in case target position or target speed are not reached.

Target scale factor "Numerator" and "Denominator" allow to apply a scaling to the profile parameters (i.e.: final targets are multiplied by "Numerator" and divided by "Denominator").

The "Motion direction" parameter allows to set the motor movement positive direction, clockwise or counterclockwise.

The "Actuator screw pitch" defines the value in mm that the axis moves for each motor revolution.

The "Homing parameters" allows to set the Homing speeds (fast and slow) and the acceleration (regarding it, in case of using the startup parameters by PLC, the value is unique for all homing accelerations In and Out, whilst using UVIX is possible to set 4 different values).

## 6.4 Startup parameters

Table 6.17: Startup parameters.

<b>Parameter</b>	<b>Description</b>	<b>Options</b>
Endianness	Data format used	Little Endian (INTEL) Big Endian (MOTOROLA)
System Start	Startup parameters to use	Stored Parameters External
Diagnosis	Errors diagnostic	Enabled Disabled
PID Selection		Default Low load Medium load High load Custom
PID position	Valid for Custom PID selection	KP Position KI Position
PID speed	Valid for Custom PID selection	KP Speed KI Speed
Profile	Control target speed / position reached	Check Timeout (ms)
Target scale factor	Scale factor applied to speed / position / acc / dec	Numerator Denominator
Motion direction	Set the motor rotation direction	clockwise counterclockwise
Actuator screw pitch		mm/motor revolution
Torque homing threshold	Torque limit during the homings	% of the I <sup>2</sup> T limit value
Actuator type		Only motor Custom Actuator
Homing parameters		Fast speed Slow speed acceleration/deceleration
PDS FSA Enable	CiA402 Finite State Automa	Enabled Disabled

## 6.4 Startup parameters

### 6.4.1 Startup parameters objects

In Table 6.18 are represented the startup parameters objects.

Table 6.18: Startup parameters objects.

ID	Sub	Description	Type	Access	Default Value
8000h	1	System endianness	U8	RW	0
8000h	2	System start	U8	RW	1
8000h	3	System Emergencies Enabled	U8	RW	1
8001h	1	Pid Selection	U8	RW	1
8002h	1	KP Position	U16	RW	1
8002h	2	KI Position	U16	RW	0
8003h	1	KP Speed	U16	RW	10000
8003h	2	KI Speed	U16	RW	10
8004h	1	Profile Check	U8	RW	1
8004h	2	Profile Timeout	U16	RW	10
8005h	1	Target Scale Numerator	U16	RW	1
8005h	2	Target Scale Denominator	U16	RW	1
8006h	0	Actuator screw pitch	U32	RW	100
8007h	0	Torque Homing Threshold	U8	RW	10
8008h	0	Actuator Type	U8	RW	0
8009h	0	PDS FSA Enable	U8	RW	1
800Ah	0	CTT	U8	RW	1

NOTE: in addition to these, it is suggested that PLC also send the Homing speeds and acceleration (parameter 6099h and 609Ah) and the motion direction (607Eh).

### 6.4.2 Startup parameters objects descriptions

In the following Sections are described the Startup parameters objects.

#### 6.4.2.1 800001h System endianness

This parameter contains the byte convention used (Little Endian or Big Endian).

- 0 = Little endian
- 1 = Big endian

#### 6.4.2.2 800002h System start

This parameter is used to decide if on startup DRVI must use the default values saved in internal memory or must use those ones sent by PLC.

- 0 = Stored parameters
- 1 = External parameters (PLC)

## 6.4 Startup parameters

---

### 6.4.2.3 80003h System Emergencies Enabled

This parameter enables the diagnostic messages (emergency)

- 0 = Disabled
- 1 = Enabled

### 6.4.2.4 800101h Pid Selection

This parameter set the PID control type

- 0 = PID default
- 1 = PID low
- 2 = PID medium
- 3 = PID high
- 4 = PID custom

### 6.4.2.5 800201h KP position

This parameter set the PID KP position value

### 6.4.2.6 800202h KI position

This parameter set the PID KI position value

### 6.4.2.7 800301h KP Speed

This parameter set the PID KP speed value

### 6.4.2.8 800302h KI Speed

This parameter set the PID KI speed value

### 6.4.2.9 800401h Profile Check

This parameter enables the check of the target reached position at the end of a movement

- 0 = Disabled
- 1 = Enabled

### 6.4.2.10 800402h Profile Timeout

This parameter set the value of the timeout after that if target position has not been reached, it will generate a warning or an error (only if Profile check is enabled). The time is started when the calculated motion profile (the theoretical value) has reached the target, so the delay is increased until the actual rotor position has not reached the target position; normally this condition could be due to the physical conditions (PID regulations, grip,....). If the timeout has expired, there are 2 possible situations: the distance between the physical vs the target position is over the warning threshold (typically 1 degree) so a warning message is generated, or the distance is over the error threshold (typically 6 degrees) so an error message is generated (error "software limits exceeded" with subcode 20).

## 6.5 Diagnostic behaviour

### 6.4.2.11 8005h Target Scale

These parameters (numerator and denominator) set the value of the gear factor reduction

### 6.4.2.12 8006h Actuator screw pitch

This parameter set value of the Actuator screw pitch. The desired value must be multiplied by 100 (example desired screw pitch is 1, so the value to sent is  $1*100$ )

### 6.4.2.13 8007h Torque Homing Threshold

This parameter set the threshold current value when the DRVI have to execute a homing procedure. The value is set as a percent of the  $I^2T$  value

### 6.4.2.14 8008h Actuator Type

This parameter set the type of the actuator. The possible values are:

- 0 = Only motor
- 7 = Custom Actuator

### 6.4.2.15 8009h PDS FSA Enable

This parameter enables the CiA402 FSA (Finite State Automa) as described in the Figure 6.2. If it is disabled, some bits of the controlword have a different management:

- bit1 = if 1, it activates the Servo ON, if 0 Servo OFF
- bit2 = if 1, it activates the quick stop procedure

### 6.4.2.16 800Ah CTT

This parameter let to use the ESI configuration files prior to revision 06 (ESI files prior to rev 06 are not compatible with the latter revisions). If this parameter has value 1, firmware works correctly with last revision of the ESI file (from rev 06), otherwise if it has value 0, it can works with previous release.

## 6.5 Diagnostic behaviour

The drive handles both errors and warnings. The difference between the two is that warnings do not impact on the drive operation (they are just signaled), whilst errors cause the motor to stop. Both errors and warnings remain latched even if the error or warning condition disappear. To reset the warning and error condition, the reset command must be given. The only warnings that auto-reset are the "homing missing" and the "command refused" ones. Errors are divided into two categories: hard and soft. Soft errors are considered less severe and they cause a controlled stop of the motor rotation by triggering the command QUICK\_STOP. The drive status can be monitored by the led status (refer to Section 3.4).

Soft errors are:

- Temperature motor limit
- Temperature drive limit
- Homing execution error

## 6.5 Diagnostic behaviour

- Fieldbus disconnection

All the others (see Table 6.20) are hard errors and they cause the power drives to be turned off, hence the motor finishes its rotation in idle state, that is, with no control applied.

### 6.5.1 Emergency Object

When the drive is in error state, it send this information through the asynchronous emergency message. Every error has its own code (ErrorCode); these codes are in turn subdivided, for example, into current errors, voltage errors, etc. The Emergency telegram is of the type shown in Table 6.19.

Table 6.19: Emergency message.

Byte 0-1	Byte 2	Byte 3-7
Error Code	Error Register	reserved

- Byte 0 and 1 have inside the ErrorCode value (see Table 6.5.2).
- Byte 2 is a bit mask and every bit signals if an error of a certain type has happened.
- Byte 3 could has inside an optional subcode parameter.

### 6.5.2 Errcode codes and Error register bits

In Table 6.20 are shown the possible values and the description of the error codes.

Table 6.20: ErrorCode and error register bits description.

ErrCode value	Error register bit	Description
0000h	b1	Alarm Reset/No alarms
2310h	b1	Over current error
2320h	b2	I <sup>2</sup> T fault
3110h	b2	Over voltage error VBUS (> 80V)
3111h	b2	Over voltage error VLOG (> 29V)
3120h	b2	Under voltage error VBUS (< 10V)
3121h	b2	Under voltage error VLOG (< 16V)
4210h	b3	Over temperature motor error (> 100°C)
4210h	b3	Over temperature drive error (> 100°C)
5530h	b4	Non volatile memory fault
5540h	b4	Error HW Enable is not present (STO)
6100h	b5	Control fault
6120h	b7	Software Limits exceed
7305h	b6	Encoder fault
8613h	b7	Homing execution error

To erase the errors and try to restore the drive to operational status, it is necessary to perform the following procedure:

- Reset the fault bit inside the Controlword (Figure ??).
- Make the NMT state machine transition to Ready to switch on.

## 6.5 Diagnostic behaviour

- Make the NMT state machine transition to Switched on.
- Make the NMT state machine transition to Operation enable.

If the PDS FSA state machine is not enabled (see 6.4.2.15), the procedure to erase the errors is described below:

- Reset the fault bit inside the Controlword (Figure ??).
- Check that no error conditions is still present by reading the error bit of the statusword (Figure ??)
- Restore the enable power bit of the controlword

### 6.5.3 Warnings

The drive can manage warnings information in the following way:

- When a warning condition happens, the bit 7 of the statusword is set.
- The user can ask to the drive to send the coded information of the active warnings, reading the object 2006h.
- The procedure to erase the warnings is the same as for the errors.

In Table 6.21 are shown the possible values and the descriptions of the warnings bits readed in the object 2006h.

Table 6.21: Diagnostic word description.

Bit	Warnings
0	VDC UVLO (< 20V)
1	VDC OVLO (> 60V)
2	VL UVLO (< 21V)
3	VL OVLO (> 27V)
4	Temperature motor limit (> 75°C)
5	Temperature drive limit (> 75°C)
6	Positive position limit reached
7	Negative position limit reached
8	Homing missing
9	Target speed not reached
10	Target position not reached
11	Command refused
12 ... 15	RESERVED

NOTE: Temperature warnings don't affect the drive functionality, but they indicate the hot surface of the motor and/or the drive.

## 6.6 Profile position

### 6.6 Profile position

The drive provides the operations for the profile position described in the CiA 402 specifications. This drive operation mode requires a specific target position, setting the velocity, acceleration and deceleration, with which to reach the target position. The target cannot be changed during a movement, the movement in progress must be terminated or interrupted before being able to set a new target.

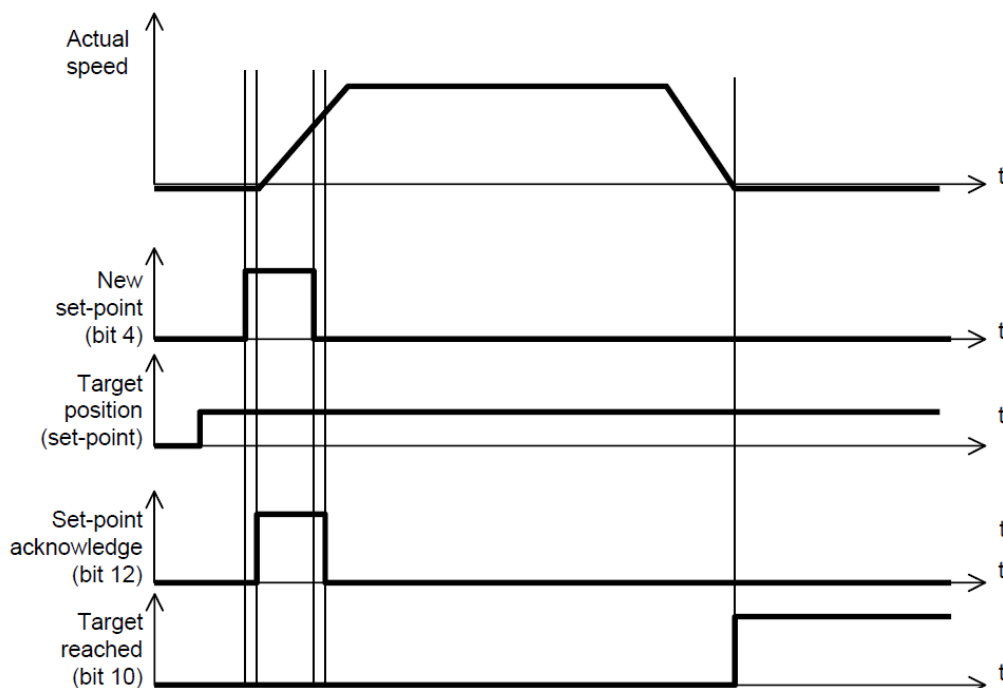


Figure 6.7: Profile position.

To enable this operation, set the operating mode to value 1 via object 6060h "Modes of operation" and check that the drive is effectively in the correct status with object 6061h "Modes of operation display".

## 6.6 Profile position

In this operating mode the **controlword** (profile-specific) bits become:

- Bit 4 "new set point" = this bit must be raised to indicate the start of the movement to the reach the target.
- Bit 6 "abs / rel" = this bit is used to indicate the type of movement that must be done, 0 = absolute position movement, 1 = relative position movement.

At the end of the movement the **statusword** bits become:

- Bit 10 "target reached" = this bit indicates the achievement of the target at the end of the positioning.

The dictionary objects related to this operating profile are listed in Table 6.22.

Table 6.22: Profile position objects.

Object	Description
<b>6060h</b>	"Mode of operation" to be set to value 1 to select the operating mode
<b>607Ah</b>	"Target position" to set the position to be reached
<b>6081h</b>	"Profile velocity in pp. mode" to set the velocity of the movement
<b>6083h</b>	"profile acceleration" to set the acceleration of the movement
<b>6084h</b>	"profile deceleration" to set the deceleration of the movement

The start and stop of the movement is always controlled by 2 bit of the "Controlword": transition of bit 4 from 0 to 1 will start the movement, whilst the bit 8 can be used to stop immediately the movement.

## 6.7 Profile velocity

### 6.7 Profile velocity

The drive provides the operations for the velocity profile described in the CiA 402 specifications. This drive operation mode requires a specific target velocity, acceleration and deceleration: once the velocity target is set, the motor accelerates until the target is reached and then maintains the required velocity until a new request is made (refer to Figure 6.8).

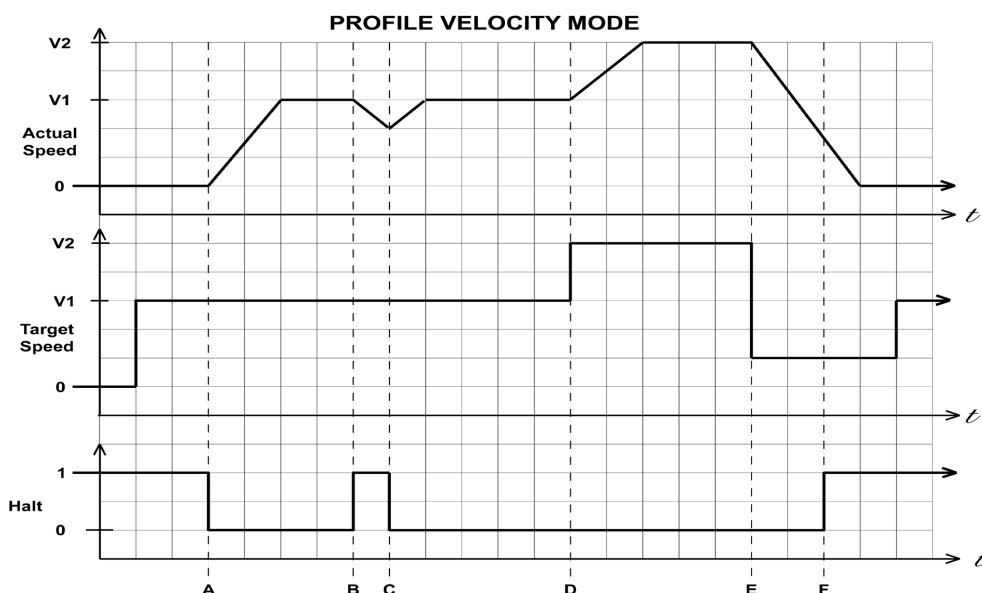


Figure 6.8: Profile velocity.

To enable this operation, set the operating mode to value 3 via object 6060h "Modes of operation" and check that the drive is effectively in the correct status with object 6061h "Modes of operation display". In this operating mode the **controlword** (profile-specific) bits become:

- Bit 4 "new set point" = this bit must be raised to indicate the start of the movement to the reach target, the drive response on the statusword is through bit 10.
- Bit 8 "halt bit" = this bit is used to stop immediately the movement: 0 = continue the movement, 1 = stop the movement.

The **statusword** is updated as follows:

- Bit 10 "target reached" = with the "halt" bit equal to zero this bit indicates the achievement of the velocity target, with the "halt" bit equal to one this bit indicates if motor is stopped: 1 = motor stopped, 0 = motor decelerating.

The dictionary objects related to this operating profile are listed in Table 6.23.

Table 6.23: Profile velocity objects.

Object	Description
<b>60FFh</b>	"Target velocity" to set a velocity target and then start the movement
<b>6083h</b>	"Profile acceleration" to set the acceleration profile
<b>6084h</b>	"Profile deceleration" to set the deceleration profile

## 6.8 Profile Torque

### 6.8 Profile Torque

The drive provides the operations for the Profile Torque mode described in the CiA 402 specifications. To enable this operation, set the operating mode to value 4 via object 6060h "Modes of operation" and check that the drive is effectively in the correct status with object 6061h "Modes of operation display".

In this operating mode the **controlword** (profile-specific) bits become as shown in Figure 6.9:

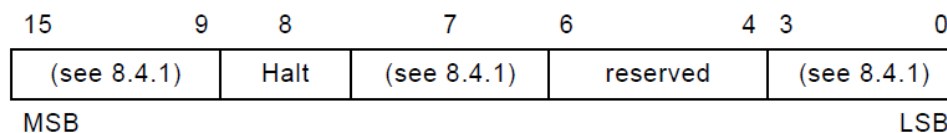


Figure 6.9: Control word for torque mode profile.

Table 6.24: Control word - definition of bit 8.

Bit	Value	Definition
8	0	The motion shall be executed or continued
	1	Stop the motor movement

The **statusword** is updated as shown in Figure 6.10:

 


Figure 6.10: Status word for torque mode profile.

Table 6.25: Status word - definition of bit 10.

Bit 10	Value	Definition
10	0	Halt (bit 8 in controlword) = 0: Target torque not reached Halt (bit 8 in controlword) = 1: Axis decelerates
	1	Halt (bit 8 in controlword) = 0: Target torque reached Halt (bit 8 in controlword) = 1: Velocity of axis is 0

### 6.9 Homing mode

The drive provides the operations for the Homing mode described in the CiA 402 specifications. Homing is the procedure by which the motor searches for the zero position (e.g.: identified by the zero proximity position). From this position the counting of all movements starts. This is the procedure that must be performed immediately after startup to setup correctly the motor position.

To enable this operation, set the operating mode to value 6 via object 6060h "Modes of operation" and check that the drive is effectively in the correct status with object 6061h "Modes of operation display".

In this operating mode the **controlword** (profile-specific) bits become as shown in Figure 6.11:

 


Figure 6.11: Control word for homing mode.

## 6.9 Homing mode

Table 6.26: Control word - definition of bit 4 and bit 8.

Bit	Value	Definition
4	0	Do not start homing
	1	Start homing
8	0	Enable bit 4
	1	Stop the motor movement

The **statusword** is updated as shown in Figure 6.12:

 


Figure 6.12: Status word for homing mode.

Table 6.27: Status word - definition of bit 10 and bit 12.

Bit 12	Bit 10	Definition
0	0	Homing procedure is in progress or turn on condition
0	1	Homing procedure is interrupted or not started
1	0	Homing is attained, but target is not reached
1	1	Homing procedure is completed successfully

The 2004h "Homing Ok" dictionary object contains the drive homing status:

- 0 = homing not performed.
- 1 = homing done (ready for movement commands).

To configure the execution movement of the homing procedure, the following objects must be configured as shown in Table 6.28:

Table 6.28: Homing mode objects.

Object	Description
<b>6060h</b>	"Mode of operation" to set the homing mode
<b>609901h</b>	"Homing velocity fast speed" velocity for proximity search
<b>609902h</b>	"Homing velocity slow speed" proximity out velocity
<b>6098h</b>	"Homing method" the number of the type of homing that must be performed
<b>609Ah</b>	"Homing acceleration" set the acceleration/deceleration to be used during the homing movement
<b>607Ch</b>	"Home offset" offset to be applied to the physical zero position to move the motor zero

NOTE: in case of Torque Homings, in addition to the start bit, it is necessary to set also the torque limit bit inside the controlword

In Table 6.29 is shown the correspondence between the homing object 6060h value and the modes of operation described in Chapter 4.

## 6.10 Jog mode

Table 6.29: Supported homing types.

Value (object 6060h)	Mode of operation
1	Proximity homing: negative direction + zero encoder
2	Proximity homing: positive direction + zero encoder
17	Proximity homing: negative direction
18	Proximity homing: positive direction
37	Positioning homing
-1	Torque homing: negative direction + zero encoder
-2	Torque homing: positive direction + zero encoder
-3	Torque homing: negative direction
-4	Torque homing: positive direction

## 6.10 Jog mode

This operation mode makes it possible to move the drive in speed mode using 2 bits of the controlword. To enable this operation, set the operating mode to value 14 via object 6060h "Modes of operation" and check that the drive is effectively in the correct status with object 6061h "Modes of operation display". In this operating mode the **controlword** (profile-specific) bits become as shown in Figure 6.13:

 


Figure 6.13: Control word for jog mode.

Table 6.30: Control word - definition of bit 5 and bit 6.

Bit 6	Bit 5	Definition
0	0	Stop (zero speed)
1	0	Clockwise rotation
0	1	Counter-clockwise rotation
1	1	Invalid command (previous state persists)

The **statusword** is updated as shown in Figure 6.14:

 


Figure 6.14: Status word for jog mode.

Table 6.31: Status word - definition of bit 12 and bit 13.

Bit 13	Bit 12	Definition
0	0	Jog OFF
0	1	Jog movement Clockwise
1	0	Jog movement Counter-clockwise
1	1	Forbidden state

To configure the execution jog movements, the following objects must be configured as shown in Table 6.32:

## 6.11 Inputs GPIO

Table 6.32: Jog mode objects.

Object	Description
<b>6060h</b>	"Mode of operation" to set the Jog mode
<b>60FFh</b>	"Target velocity" set the target speed used during jog movements
<b>6083h</b>	"Profile acceleration" set the acceleration to be used during the jog movements
<b>6084h</b>	"Profile deceleration" set the deceleration to be used during the jog movements

## 6.11 Inputs GPIO

The status of the input GPIOs present on the I/O connector (refer to Chapter 3.3.2) can be monitored according to the bitmask described in Table 6.33. A "0" value indicates an input LOW state while a "1" value indicates an input HIGH state.

Table 6.33: Input GPIO bitmask.

Bit	Description
0	IN1
1	IN2
2	PROXY EXT
3	PROXY INPUT

The inputs status can be read with the CoE object 0x2002 Input Status.

## 6.12 Output GPIO

The status of the output GPIO present on the I/O connector (refer to Chapter 3.3.2) can be changed according to the bitmask described in Table 6.34.

Table 6.34: Output GPIO bitmask.

Bit	Value	Description
0	0	OUT LOW
0	1	OUT HIGH

The output status can be modified with the CoE object 0x2003 Output Status.

# Uvix

## 7.1 Introduction

Camozzi's proprietary environment, called UVIX, allows the user to monitor and configure all new generation Camozzi devices (*Camozzi Smart Devices*) that support connection to it. Devices can be connected to UVIX via USB or Ethernet (see [7.8.2](#)). This system has been implemented with a web-based architecture so that information can be accessed straightforwardly using a browser. Monitoring consists of displaying all the device variables, whether they relate to operation, diagnostics, or parameterization. For details on the UVIX architecture, its installation, and general operations, see the [UVIX Manual](#).

## 7.2 General information

### 7.2 General information

The devices connected to the UVIX are displayed in a tree diagram **1** consisting of *Device Groups*, *Family* and *Devices*. Select one of the components to view in the main window **2** all the information on the various devices and perform configuration operations or manual commands.

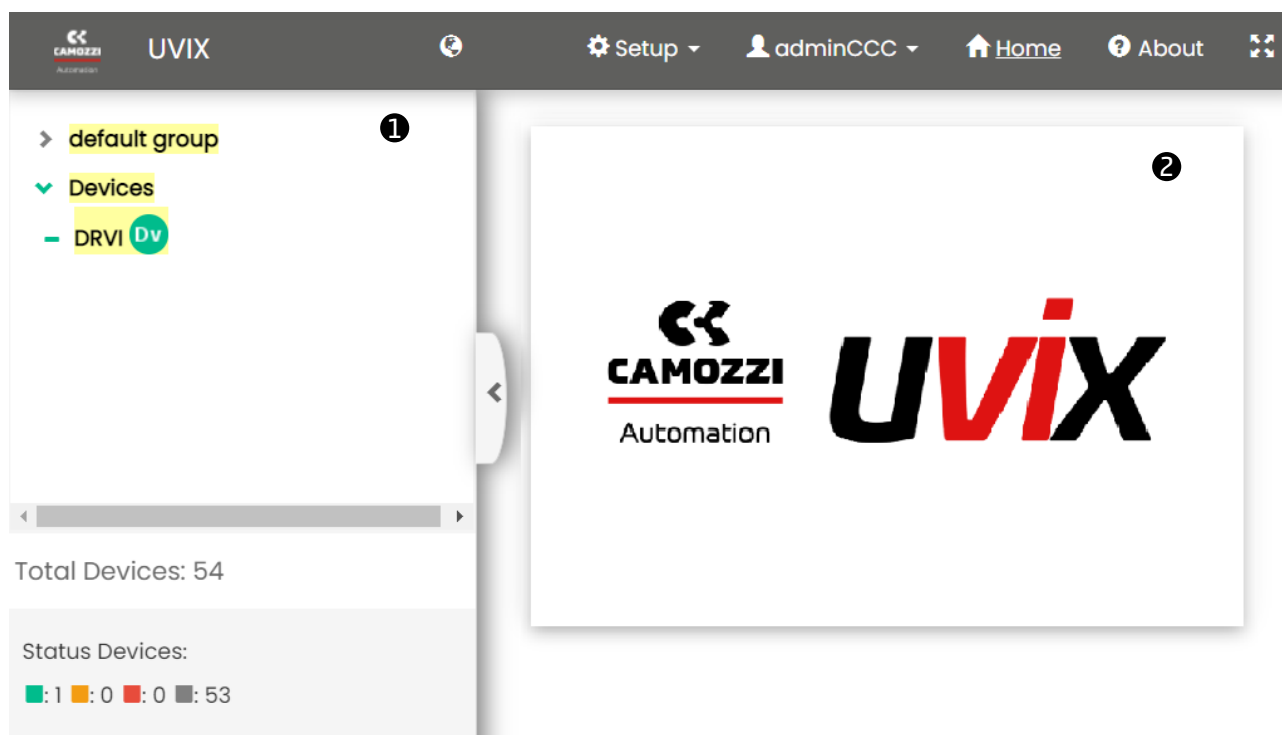


Figure 7.1: Main page of the UVIX interface.


Select the DRVI device to view the general status information [7.3](#) and details [7.4](#). Furthermore, it is possible to set the DRVI parameters and to communicate with the device in real-time (*Commissioning*).

## 7.3 Status information

### 7.3 Status information

- ❶ Image of the DRVI series.
- ❷ Assigned name of the device.
- ❸ Identification number of the device (17 chars).
- ❹ Family name of the device: *Series Integrated Foc Drive*.
- ❺ Subtype of the device family: *Stepper/BLDC* and *Nema23/Nema24*.
- ❻ Firmware version.
- ❼ Date and time of the last data transmission.
- ❽ General status of the device: ● Not available, ● Ok, ● Warning, ● Alarm.
- ❾ Operational status of the device:
  - *Work*: normal operation.
  - *Manual*: manual operation.
- ❿ Connection status: ● Ok, ● Offline.
- ⓫ Fieldbus communication: Profinet/EtherCAT/CANopen.
- ⓬ Communication status of the Fieldbus: ● Ok, ● Offline.
- ⓭ Fieldbus configuration.
- ⓮ DRVI parameters configuration (par. 7.5).
- ⓯ Commissioning device (par. 7.6).

Status information: ▼

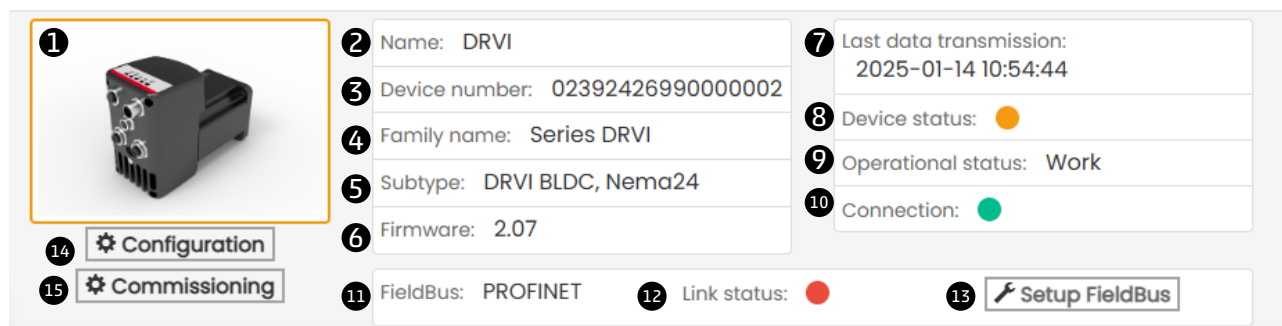

The screenshot displays the main page of the UVIX interface. On the left, there is a device image (1) and two buttons: 'Configuration' (14) and 'Commissioning' (15). The main area contains a table of device information:

❷ Name: DRVI	❼ Last data transmission: 2025-01-14 10:54:44
❸ Device number: 02392426990000002	❽ Device status: <span style="color: orange;">●</span>
❹ Family name: Series DRVI	❾ Operational status: Work
❺ Subtype: DRVI BLDC, Nema24	❿ Connection: <span style="color: green;">●</span>
❻ Firmware: 2.07	

At the bottom, there is a row with: 'FieldBus: PROFINET' (11), 'Link status: ●' (12), and a 'Setup FieldBus' button (13).

Figure 7.2: Main page of the UVIX interface.

### 7.4 Details

The details section is divided into five tabs:

- Variables [7.4.1](#)
- Alarms [7.4.2](#)
- Commands [7.4.3](#)
- Error History [7.4.4](#)

#### 7.4.1 Variables


The first tab of details shows the variables that are monitored by the DRVI device as shown in Figure [7.3](#).

The variables are listed below:

- Motor Size: *Nema 17, Nema 23, Nema 24*.
- Brake: *Present* or *Not present*.
- STO: *Present* or *Not present*.
- Actuator type:
  - *Only motor*
  - *Custom actuator*
- Servo state: *On* or *Off*.
- Mode of operation:
  - *Homing*
  - *Speed*
  - *Relative positioning*
  - *Absolute positioning*
  - *Torque*
- Actual pos: actual position measured in angular degrees or mm.
- Actual vel: actual velocity measured in RPM or mm / s.
- Total stroke: total stroke measured in m.
- Total time on: total time on measured in hours.
- Total time off: total time off measured in hours.
- Total time run: total time run measured in hours.
- Actuator screw pitch: measured in mm / round allows the conversion to linear measurement units, when an actuator is connected to the drive.
- Gear ratio: when a gear is placed between the drive and the actuator, this parameter is used to apply an automatic scale of the target.
- Product part number: drive descriptive code.
- Busy state: *True* or *False*.
- Total count power on: incremented every time device is turned on.
- Homing state: *Present* or *Not present*.
- Self Holding: *True* or *False*.
- Output GPIO: *On* or *Off*.

## 7.4 Details

Details:

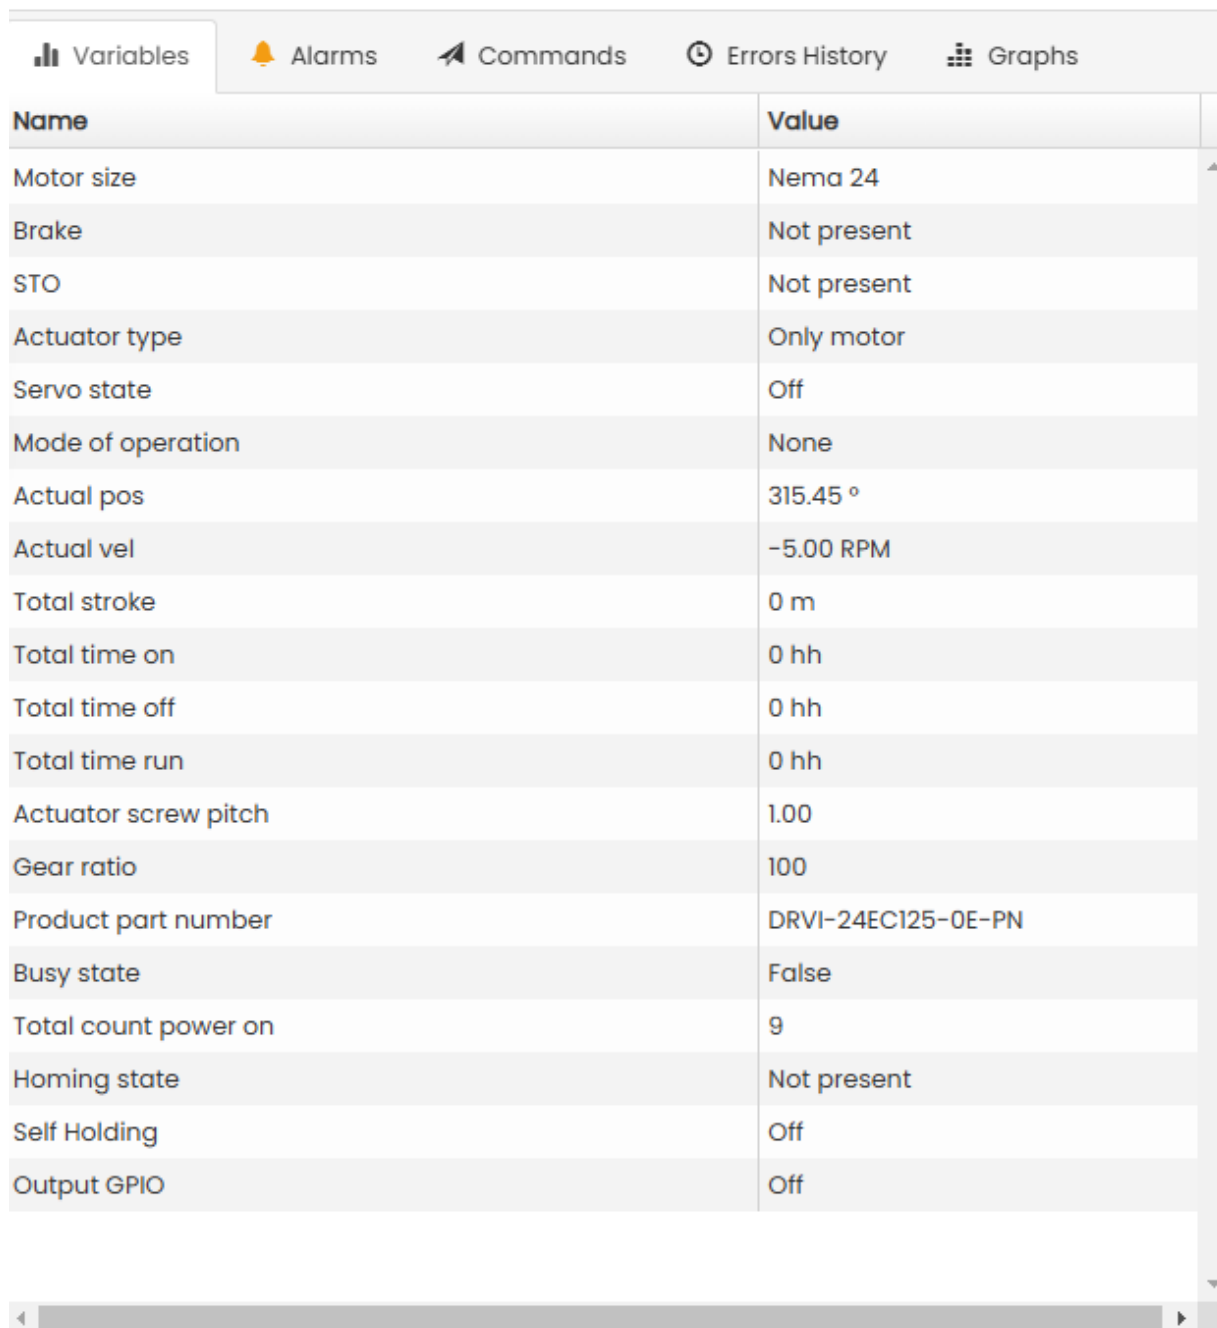

Name	Value
Motor size	Nema 24
Brake	Not present
STO	Not present
Actuator type	Only motor
Servo state	Off
Mode of operation	None
Actual pos	315.45 °
Actual vel	-5.00 RPM
Total stroke	0 m
Total time on	0 hh
Total time off	0 hh
Total time run	0 hh
Actuator screw pitch	1.00
Gear ratio	100
Product part number	DRVI-24EC125-0E-PN
Busy state	False
Total count power on	9
Homing state	Not present
Self Holding	Off
Output GPIO	Off





Figure 7.3: Section for the variables monitored by the DRVI device.

## 7.4 Details

### 7.4.2 Alarms

The second tab of details displays possible DRVI alarms as shown in Figure 7.4.

All possible alarms are listed below:

- Error alarms: *Alarm active* , *Alarm not active*  .
  - VBUS under voltage.
  - VBUS over voltage.
  - VLOG under voltage.
  - VLOG over voltage.
  - Motor temperature.
  - Drive temperature,
  - Over current.
  - Fault in control loop.
  - Encoder fault.
  - Non-volatile memory fault.
  - Energy dissipation fault.
  - STO fault.
  - Homing fault.
- Warning alarms: *Alarm active* , *Alarm not active*  .
  - VBUS under voltage.
  - VBUS over voltage.
  - VLOG under voltage.
  - VLOG over voltage
  - Motor temperature.
  - Drive temperature.
  - Homing not done.
  - Target speed not reached.
  - Target position not reached.
  - Invalid command.
  - Position limit reached.

Details: ▼

<span>▮ Variables</span> <span>🔔 Alarms</span> <span>📏 Commands</span> <span>🕒 Errors History</span> <span>📊 Graphs</span>		
Event Name	Status ▼	Event Onset
Homing not done	⚠️	2025-01-14 10:46:59
VBUS under voltage	ⓘ	
VBUS over voltage	ⓘ	
VLOG under voltage	ⓘ	
VLOG over voltage	ⓘ	
Motor temperature	ⓘ	
Drive temperature	ⓘ	
Over current	ⓘ	
Fault in control loop	ⓘ	
Encoder fault	ⓘ	
Non-volatile memory fault	ⓘ	
I2t limit exceeded	ⓘ	
STO fault	ⓘ	
Homing	ⓘ	
Position limit reached	ⓘ	
Supply voltage DCDC/V15	ⓘ	
Brake Fault	ⓘ	
VBUS under voltage	⚠️	
VBUS over voltage	⚠️	
VLOG under voltage	⚠️	
VLOG over voltage	⚠️	
Motor temperature	⚠️	


Figure 7.4: Section for the alarms monitored by the DRVI device.

## 7.4 Details

### 7.4.3 Commands

The third tab of details shows the commands that can be sent via UVIX to the device. The manual mode command ① allows you to control the system manually from UVIX, sending configuration parameters to the DRVI. In manual mode, it is possible to reset the alarms ②, to set the digital output ③, to start or stop the motor movement ④, and to switch on/off the servo ⑤. The history of the commands sent to the DRVI since the communication with UVIX was started can be viewed under *Last Commands* ⑥.

Details: ▼

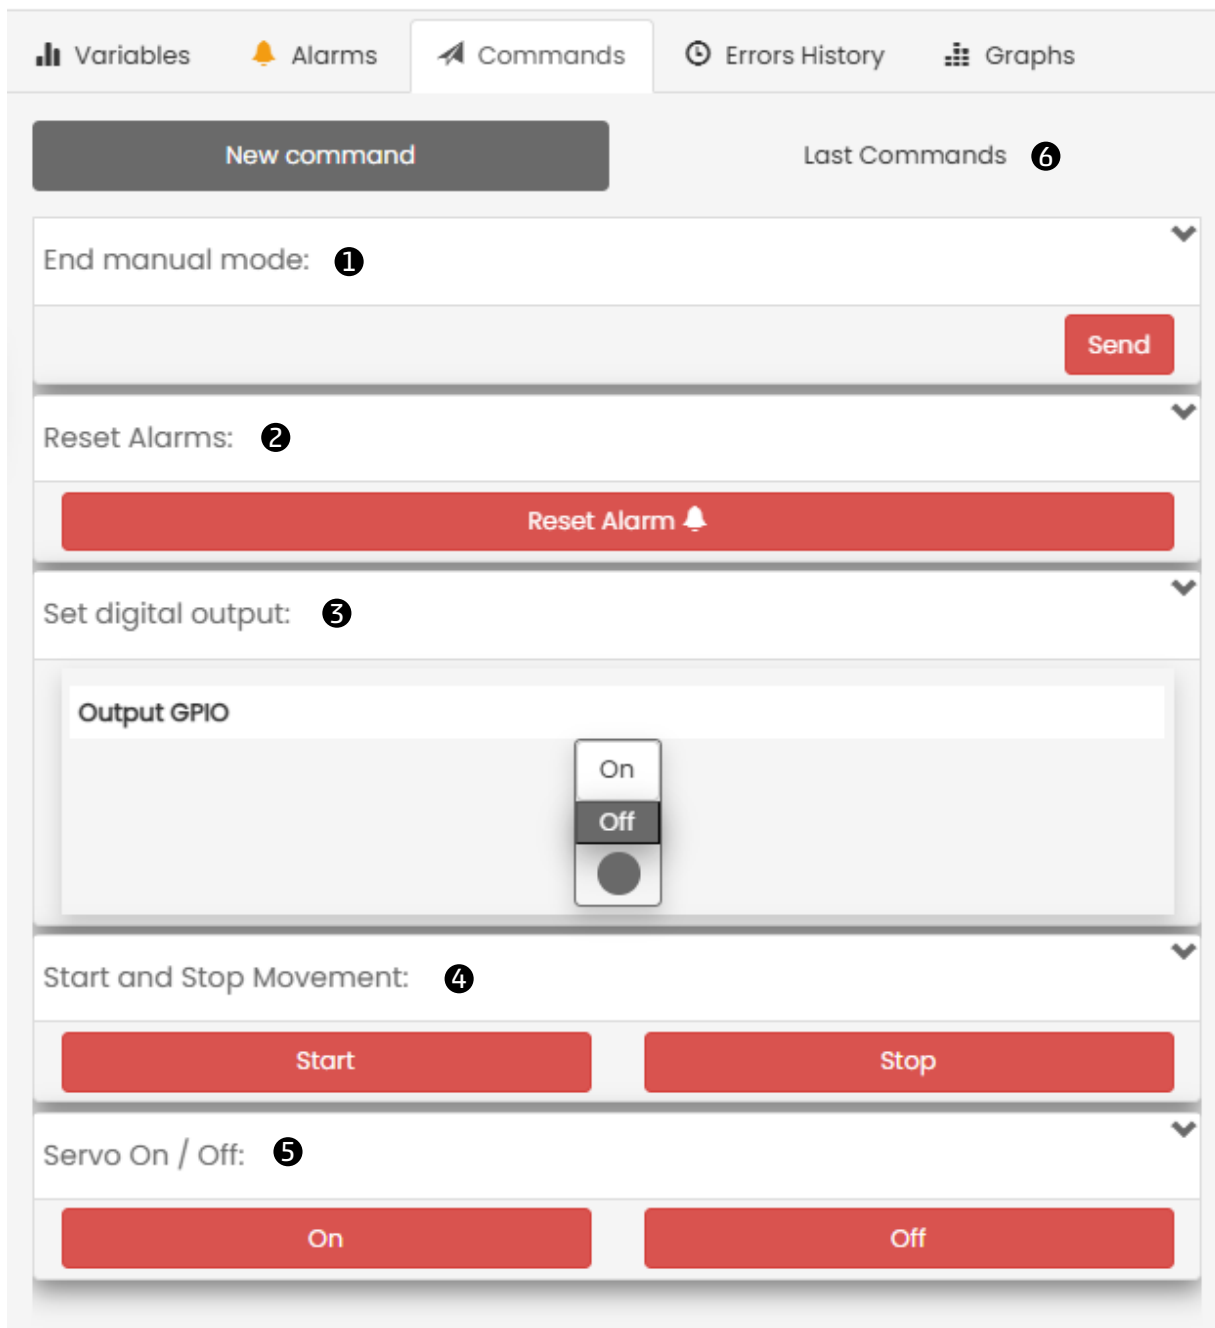

The screenshot displays the 'Commands' tab in the UVIX interface. At the top, there are navigation tabs: Variables, Alarms, Commands (selected), Errors History, and Graphs. Below the tabs, there is a 'New command' button and a 'Last Commands' link with a circled 6. The main area contains six command categories, each with a dropdown arrow on the right:

- End manual mode: ①**: Includes a red 'Send' button.
- Reset Alarms: ②**: Includes a red 'Reset Alarm' button with a bell icon.
- Set digital output: ③**: Includes an 'Output GPIO' section with 'On', 'Off', and a radio button.
- Start and Stop Movement: ④**: Includes 'Start' and 'Stop' buttons.
- Servo On / Off: ⑤**: Includes 'On' and 'Off' buttons.

Figure 7.5: Section for the commands managed by the DRVI device.

## 7.4 Details


### 7.4.4 Errors History

The fourth tab of details shows a table, which contains the last seven alarms that occurred, as shown in Figure 7.6. The table is made up of three columns:

- ❶ *Event Name*: alarm occurred
- ❷ *Count Power On*: incremented every time device is turned on
- ❸ *Error Time*: milliseconds elapsed since the last power on

The table is filled from top to bottom, so the most recent errors are in the top rows.

Details: ▼

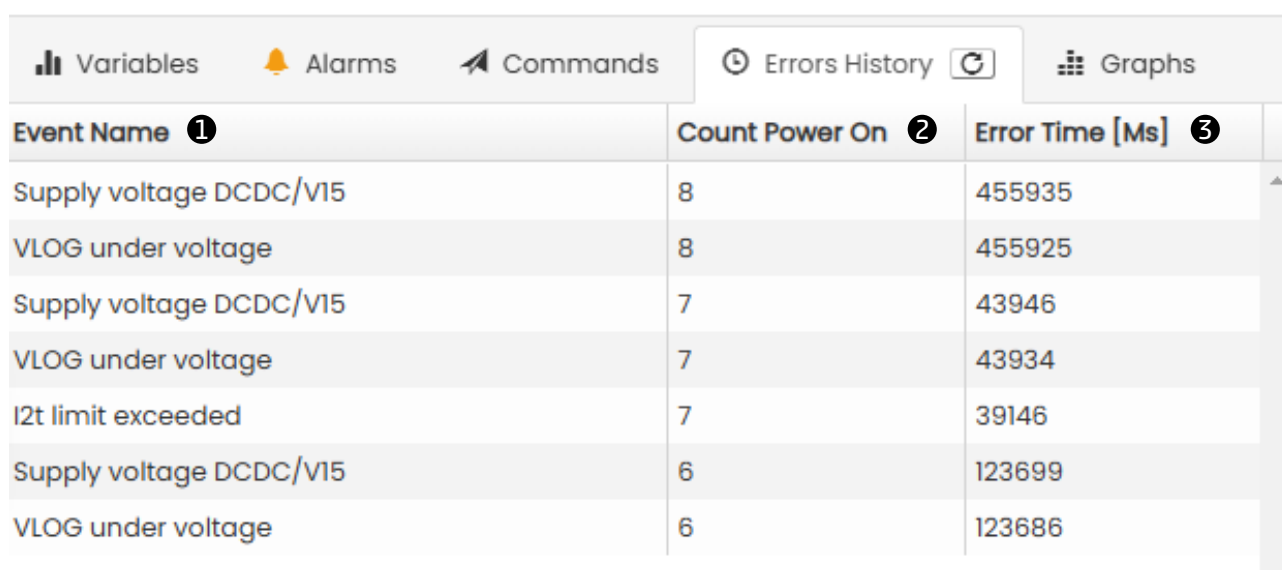

Event Name ❶	Count Power On ❷	Error Time [Ms] ❸
Supply voltage DCDC/V15	8	455935
VLOG under voltage	8	455925
Supply voltage DCDC/V15	7	43946
VLOG under voltage	7	43934
I2t limit exceeded	7	39146
Supply voltage DCDC/V15	6	123699
VLOG under voltage	6	123686

Figure 7.6: Error history section.

### 7.4.5 Graphs

The fifth tab of details on the DRVI device contains graphs that show the trend of variables 7.4.1 over time, as shown in Figure 7.7. It is possible to choose the variables to acquire ❶, start acquisition ❷, stop acquisition ❸, clear graph ❹ and save data in .csv format ❺.

Below the graph there is a thumbnail ❻ that allows to select an observation interval over time. There is also a flag ❼, which gives the possibility to select the same observation interval for all variables under acquisition. Otherwise, if the flag is not set, the observation interval can be chosen independently for each variable, as shown in Figure 7.8.

The graphs are printed starting from the values saved in a circular buffer. When the buffer fills up it is rewritten from the beginning, overwriting the old data. To avoid losing data it is possible to set a flag ❽, which enables automatic saving of data in .csv format every time the circular buffer is filled. The time it takes for the buffer to fill corresponds to *Graph UVIX window* and can be set in the *Communication* section 7.5.3 of configuration page 7.5. Depending on the choice of *Graph UVIX window*, a different sampling period for the variables is set.

## 7.4 Details

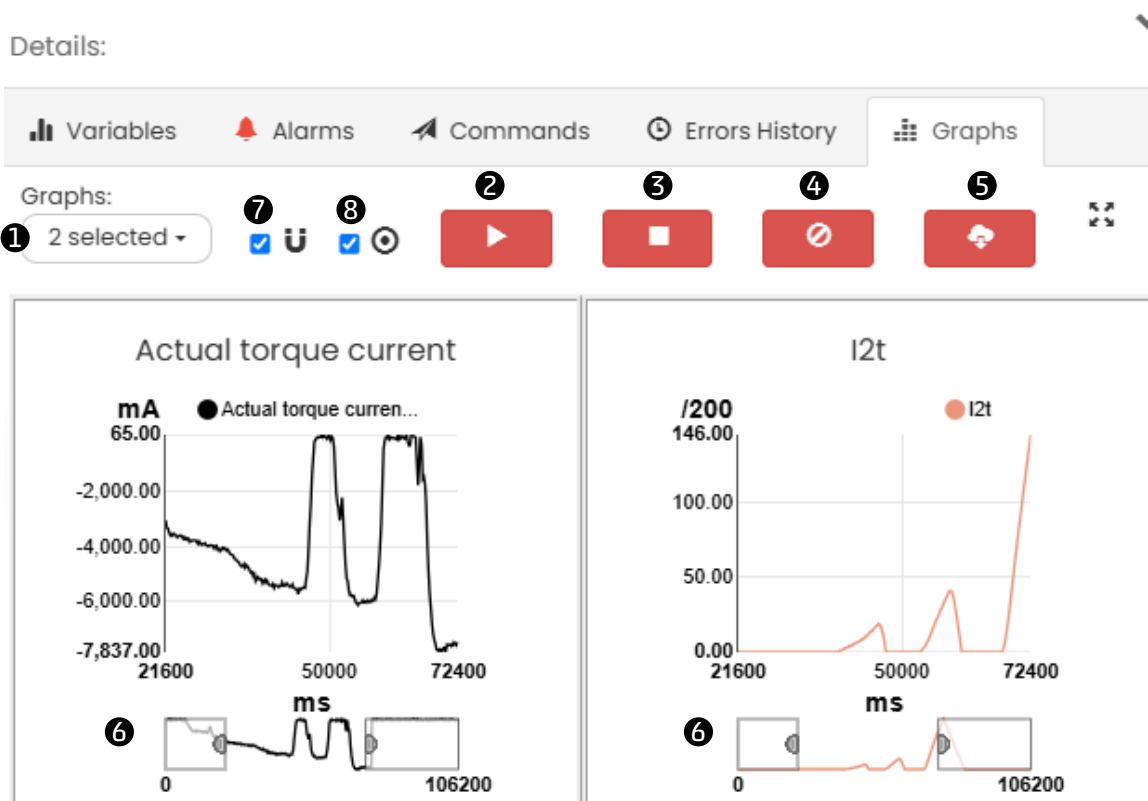


Figure 7.7: Section for graphing variables over time. In this example flag ⑦ is set, so *Actual torque current* and *I2t* are graphed over the same observation interval.

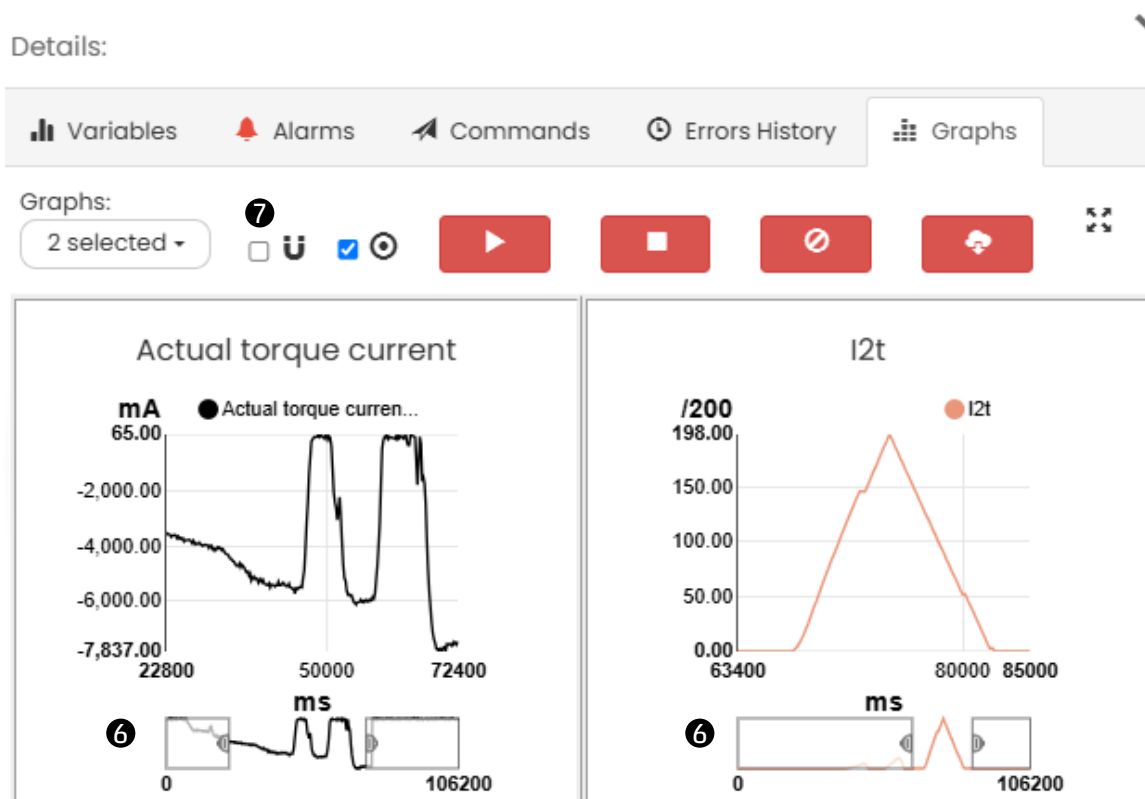


Figure 7.8: Section for graphing variables over time. In this example flag ⑦ is not set, so *Actual torque current* and *I2t* are graphed over different observation intervals.

## 7.5 Configuration

### 7.5 Configuration

From the status information page 7.3, it is possible to access to configuration page, where it is possible to configure certain operating-related parameters of the DRVI: actuator, motion and communication. All these parameters can be stored into the non volatile memory of the drive by clicking the buttons *Send* and subsequently *Save on device*.

#### 7.5.1 Actuator

In the actuator section it is possible to set the following parameters:

- ❶ *Actuator type* can be:
  - *Only motor*
  - *Custom Actuator*
- ❷ *Gear ratio* is used to apply an automatic scale of the target (i.e.: profile parameters are multiplied by the gear ratio value).

The following items are software limits, that can be used to restrict the profile parameters:

- ❸ *Actuator screw pitch* measured in mm / round. This parameter allows the conversion to linear measurement units, when an actuator is connected to the drive.
- ❹ *Actuator limits* when enabled allow to modify the limit values.
- ❺ *Actuator minimum stroke* measured in mm (such value must be lesser than ❻).
- ❻ *Actuator maximum stroke* measured in mm (such value must be greater than ❺).
- ❼ *Actuator max speed* measured in mm / s.
- ❽ *Actuator max acceleration* measured in mm / s<sup>2</sup>.
- ❾ *Actuator max deceleration* measured in mm / s<sup>2</sup>.

ACTUATOR ▼

<b>Actuator type</b> <span style="float: right;">2025-01-14 16:00:51</span> <input type="radio"/> Only motor <input checked="" type="radio"/> Custom Actuator <span style="float: right;">❶</span>	<b>Actuator minimum stroke [mm]:</b> <span style="float: right;">2025-01-14 16:00:51</span> <input type="text" value="-21474836"/> <span style="float: right;">❺</span>
<b>Gear ratio</b> <span style="float: right;">2025-01-14 16:00:51</span> <input type="text" value="1.00"/> <span style="float: right;">❷</span>	<b>Actuator maximum stroke [mm]:</b> <span style="float: right;">2025-01-14 16:00:51</span> <input type="text" value="21474836"/> <span style="float: right;">❻</span>
<b>Actuator screw pitch [min:0 , max:2000] mm/round:</b> <span style="float: right;">2025-01-14 16:00:51</span> <input type="text" value="1.00"/> <span style="float: right;">❸</span>	<b>Actuator max speed [mm/s]:</b> <span style="float: right;">2025-01-14 16:00:51</span> <input type="text" value="20000"/> <span style="float: right;">❼</span>
<b>Actuator limits</b> <span style="float: right;">2025-01-14 16:00:51</span> Off <input type="checkbox"/> On <span style="float: right;">❹</span>	<b>Actuator max acceleration [mm/s<sup>2</sup>]:</b> <span style="float: right;">2025-01-14 16:00:51</span> <input type="text" value="65535"/> <span style="float: right;">❽</span>
	<b>Actuator max deceleration [mm/s<sup>2</sup>]:</b> <span style="float: right;">2025-01-14 16:00:51</span> <input type="text" value="65535"/> <span style="float: right;">❾</span>

Figure 7.9: Section for actuator configuration.

## 7.5 Configuration

### 7.5.2 Motion

In the motion section it is possible to set the follows parameters:

- 10 **Profile check**: *No* or *Yes*. Enable or disable the check of the actual rotor position, with respect to the target imposed.
- 11 **Profile check timeout** measured in ms. If "Profile check" is enabled, this parameters represents the time after which an advice is returned, if the actual rotor physical position does not match the target one. The time is started when the calculated motion profile (the theoretical value) has reached the target, so the delay is increased until the actual rotor position has not reached the target position; normally this condition could be due to the physical conditions (PID regulations, grip,...). If the timeout has expired, there are 2 possible situations: the distance between the physical vs the target position is over the warning threshold (typically 1 degree) so a warning message is generated, or the distance is over the error threshold (typically 6 degrees) so an error message is generated (error "software limits exceeded" with subcode 20).
- 12 **Direction of movements**: *standard* or *inverse* (with respect to convention, see Paragraph 6.1).
- 13 **Quick stop deceleration** measured in  $\text{mm} / \text{s}^2$ .
- 14 **Digital Input Mode**: *No* or *Yes*. Enable or disable the Digital Input Mode (4.2).
- 15 **Target torque limit for Digital Input Mode** measured in mA . Available only if Digital Input mode is enabled.

MOTION ▼

PROFILE

<div style="border: 1px solid #ccc; padding: 5px; margin-bottom: 5px;"> <span style="float: right; font-size: 0.8em;">2025-01-14 16:00:51</span> <p>Check <span style="float: right;">10</span></p> <p>No <input checked="" type="checkbox"/> Yes</p> </div>	<div style="border: 1px solid #ccc; padding: 5px; margin-bottom: 5px;"> <span style="float: right; font-size: 0.8em;">2025-01-14 16:00:51</span> <p>Check timeout [ms]: <span style="float: right;">11</span></p> <p>30</p> </div>
<div style="border: 1px solid #ccc; padding: 5px; margin-bottom: 5px;"> <span style="float: right; font-size: 0.8em;">2025-01-14 16:00:51</span> <p>Direction of movements <span style="float: right;">12</span></p> <p><input checked="" type="radio"/> standard</p> <p><input type="radio"/> inverse</p> </div>	<div style="border: 1px solid #ccc; padding: 5px; margin-bottom: 5px;"> <span style="float: right; font-size: 0.8em;">2025-01-14 16:00:51</span> <p>Quick Stop Deceleration [mm/s<sup>2</sup>]: <span style="float: right;">13</span></p> <p>4000</p> </div>
<div style="border: 1px solid #ccc; padding: 5px; margin-bottom: 5px;"> <span style="float: right; font-size: 0.8em;">2025-01-14 16:00:51</span> <p>Digital Input Mode <span style="float: right;">14</span></p> <p>Off <input checked="" type="checkbox"/> On</p> </div>	<div style="border: 1px solid #ccc; padding: 5px; margin-bottom: 5px;"> <span style="float: right; font-size: 0.8em;">2025-01-14 16:00:51</span> <p>Target torque limit [min:-15000 , max:15000] mA: <span style="float: right;">15</span></p> <p>4000</p> </div>

Figure 7.10: Section for motion configuration.

## 7.5 Configuration

### 7.5.3 Communication

In the communication section (represented in Figure 7.11) it is possible to set the data endianness used by the fieldbus: *little endian* or *big endian*. It is also possible to select the *Graph UVIX window*, which is the maximum temporal width of Graphs (see 7.4.5). The sampling period of variables 7.4.1 depends on the choice of *Graph UVIX window*. The corresponding sampling period of each window is shown next to it in parentheses.

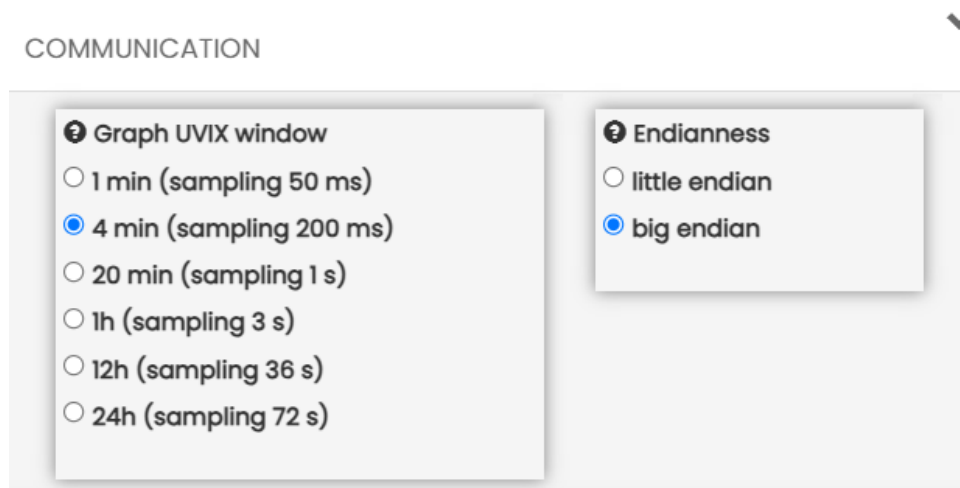


Figure 7.11: Section for communication configuration.

### 7.5.4 GPIO

In the GPIO section (represented in Figure 7.12) it is possible to set the polarity of the I/O.

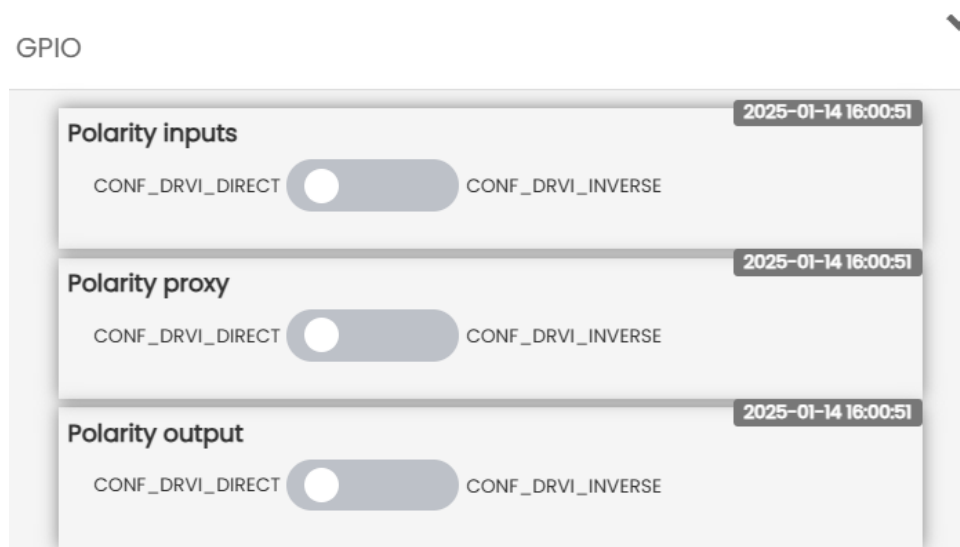


Figure 7.12: Section for I/O polarity.

## 7.6 Commissioning

### 7.6 Commissioning

From the status information page 7.3, it is possible to access to commissioning page, where it is possible to move the drive, as well as configure some of its parameters. Homing parameters and PID configuration can be stored into the non volatile memory of the drive by clicking the buttons *Send* and subsequently *Save on device*. Depending on enabling of Digital Input Mode there are two different commissioning pages: Standard 7.6.1 and Digital Input mode 7.6.2.

#### 7.6.1 Standard commissioning page

Standard commissioning page (Figure 7.13) is visualized when Digital Input mode is disabled.

Name	Value	Min	Max	
Actual pos	-0.01 °	-0.02 °	0.01 °	🔄
Actual vel	0.03 RPM	-0.09 RPM	0.09 RPM	🔄
Actual torque current	-67 mA	-215 mA	168 mA	🔄
I2t	0 /200	0 /200	0 /200	🔄
Filtered torque current	0 mA	0 mA	0 mA	🔄
Bus current	33 mA	0 mA	138 mA	🔄
Target reached	0	0	0	🔄
T drive	26.5 °C	22.8 °C	26.5 °C	🔄
T Motor	23.1 °C	22.9 °C	23.1 °C	🔄
V Logic	23.5 V	23.5 V	23.5 V	🔄
V Bus	47.8 V	47.8 V	47.8 V	🔄
Power	0 W	0 W	0 W	🔄

Figure 7.13: Standard commissioning page.

The page is composed by:

- ① States of the DRVI: it is possible to watch the state of the DRVI, the state of the inputs, set the state of the output and if a fault is active
- ② Details tabs, the same ones presented in Chapter 7.4.
- ③ Command of the manual mode: *Start* or *End*.
- ④ Command of the servo: *On* or *Off*.
- ⑤ Mode operation selector (7.6.1.1).
- ⑥ Command of the movement (7.6.1.2) depending on operation mode selected.
- ⑦ Mode operation section (7.6.1.3), depending on operation mode selected.
- ⑧ PID configuration section, see Chapter 7.6.3.
- ⑨ Reset errors and warnings: *Reset Alarm*.

## 7.6 Commissioning

### 7.6.1.1 Mode operation selector

Mode operation selector **5** is used to select one of the following operation modes:

- *None*
- *Homing*
- *Speed*
- *Absolute position*
- *Relative position*
- *Torque*

**⚠** When switching operation mode the Standard commissioning page changes slightly.

### 7.6.1.2 Command of the movement

Command of the movement **6** depends on operation mode selected. In case mode operation is set to *None* or *Homing* the only commands available are *Start* and *Stop* movement, as shown in Figure 7.13. Otherwise the Command of the movement changes, as shown in Figure 7.14.

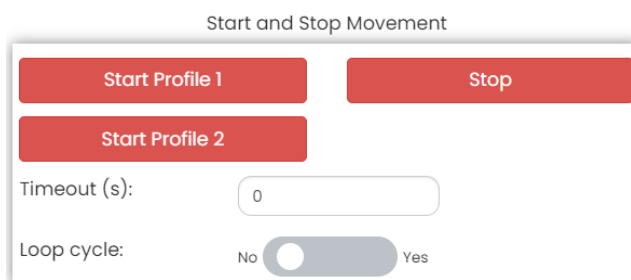


Figure 7.14: Section of the Start and Stop for not Homing modes.

- *Start Profile1*: this is the first target value.
- *Start Profile2*: this is the (optional) second target value.
- *Stop*: it ends the current movement.
- *Timeout*: it set the delay in seconds between profile1 and profile2 target. Be careful: set a value that is greater than the time elapsed to execute the movement.
- Loop cycle *No, Yes*: it enables the loop of movements between profile1 and profile2 target.

### 7.6.1.3 Mode operation section

Mode operation section **7** is generated when a mode operation other than *None* is selected. Each mode operation has its own section (except for *None*), so there are five Mode operation sections:

- *Homing section 7.6.1.4*
- *Speed section 7.6.1.5*
- *Absolute position section 7.6.1.6*
- *Relative position section 7.6.1.7*
- *Torque section 7.6.1.8*

## 7.6 Commissioning

### 7.6.1.4 Homing section

In the homing section (represented in Figure 7.15) it is possible to configuring homing parameters and select a type of homing:

- *Without proximity*
- *Proximity left*
- *Proximity right*
- *Proximity left + zero encoder*
- *Proximity right + zero encoder*
- *Torque left*
- *Torque right*
- *Torque left + zero encoder*
- *Torque right + zero encoder*

HOMING ▼

**Homing type**

Without proximity

Proximity positive direction

Proximity negative direction

Proximity positive direction + zero encoder

Proximity negative direction + zero encoder

Torque positive direction

Torque negative direction

Torque positive direction + zero encoder

Torque negative direction + zero encoder

**A**

**Homing speed out [RPM]:**

6.00 **E**

**Homing acc out [RPM/s]:**

3000 **F**

**Homing dec out [RPM/s]:**

3000 **G**

**Homing Offset [°]:**

0.00 **H**

**Torque homing threshold [min:0 , max:100] %:**

30 **I**

**Torque limit**

Off  On **L**

**Target torque limit [min:-15000 , max:15000] mA:**

300 **M**

**Homing speed search [RPM]:**

12.00 **B**

**Homing acc search [min:0 , max:65535] RPM/s:**

3000 **C**

**Homing dec search [RPM/s]:**

3000 **D**

Figure 7.15: Section of the homing parameters.

## 7.6 Commissioning

---

The homing section is composed of:

- **A** Homing type selector
- **B** Homing speed search measured in RPM or mm / s.
- **C** Homing acceleration search measured in RPM / s or mm / s<sup>2</sup>.
- **D** Homing deceleration search measured in RPM / s or mm / s<sup>2</sup>.
- **E** Homing speed out measured in RPM or mm / s.
- **F** Homing acceleration out measured in RPM / s or mm / s<sup>2</sup>.
- **G** Homing deceleration out measured in RPM / s or mm / s<sup>2</sup>.
- **H** Homing offset measured in angular degrees or mm.
- **I** Torque homing threshold % with respect to the I<sup>2</sup>T value.
- **L** Torque limit enable *No*, *Yes*.
- **M** Target torque limit measured in mA.

Homing "search" parameters (e.g.: *Homing speed search*) are the ones used to find the proximity (or the end of the line), while "out" parameters (e.g.: *Homing speed out*) are the ones used to exit from the proximity (or the end of the line).

## 7.6 Commissioning

### 7.6.1.5 Speed Profile section

In the speed profile section (represented in Figure 7.16) it is possible to set the motion profile parameters for the speed control for two target speed, profile1 and (optional) profile2. Moreover it is possible to enable/disable the check of the Torque limit and its threshold value in mA.

#### SPEED PROFILE ▼

PROFILE 1	PROFILE 2
<b>Target speed [RPM]:</b> <input type="text" value="1000.00"/> <b>A</b>	<b>Target speed [RPM]:</b> <input type="text" value="2000.00"/>
<b>Target acceleration [RPM/s]:</b> <input type="text" value="100"/> <b>B</b>	<b>Target acceleration [RPM/s]:</b> <input type="text" value="100"/>
<b>Target deceleration [RPM/s]:</b> <input type="text" value="100"/> <b>C</b>	<b>Target deceleration [RPM/s]:</b> <input type="text" value="100"/>
<b>Torque limit</b> Off <input checked="" type="checkbox"/> On <b>D</b>	<b>Target torque limit [min:-15000 , max:15000] mA:</b> <input type="text" value="300"/> <b>E</b>

Figure 7.16: Section of the speed profile parameters.

The speed profile section is composed of:


- **A** Target speed measured in RPM or mm / s.
- **B** Target acceleration measured in RPM / s or mm / s<sup>2</sup>.
- **C** Target deceleration measured in RPM / s or mm / s<sup>2</sup>.
- **D** Torque limit enable *No*, *Yes*.
- **E** Target torque limit measured in mA.

## 7.6 Commissioning

### 7.6.1.6 Absolute position section

In the absolute position section (represented in Figure 7.17) it is possible to set the motion profile parameters for the absolute position control for two target positions, profile1 and (optional) profile2. Moreover it is possible to enable/disable the check of the Torque limit and its threshold value in mA:

#### ABSOLUTE POSITION PROFILE

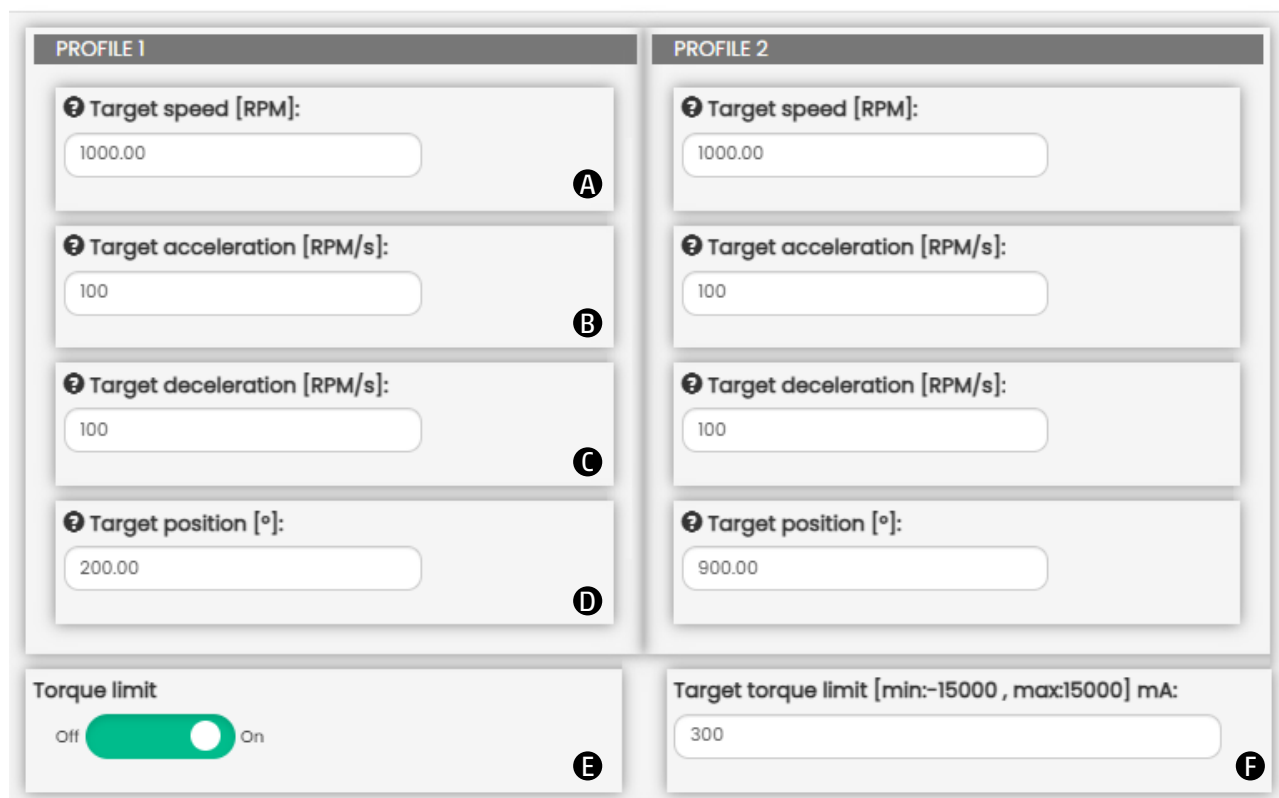

PROFILE 1	PROFILE 2
Target speed [RPM]: 1000.00 (A)	Target speed [RPM]: 1000.00
Target acceleration [RPM/s]: 100 (B)	Target acceleration [RPM/s]: 100
Target deceleration [RPM/s]: 100 (C)	Target deceleration [RPM/s]: 100
Target position [°]: 200.00 (D)	Target position [°]: 900.00
Torque limit Off <input checked="" type="checkbox"/> On (E)	Target torque limit [min:-15000, max:15000] mA: 300 (F)

Figure 7.17: Section of the absolute position profile parameters.

The absolute position section is composed of:

- **A** Target speed search measured in RPM or mm / s.
- **B** Target acceleration measured in RPM / s or mm / s<sup>2</sup>.
- **C** Target deceleration measured in RPM / s or mm / s<sup>2</sup>.
- **D** Target position measured in angular degrees or mm.
- **E** Torque limit enable *No*, *Yes*.
- **F** Target torque limit measured in mA.

## 7.6 Commissioning

### 7.6.1.7 Relative position section

In the relative position section (represented in Figure 7.18) it is possible to set the motion profile parameters for the relative position control for 2 target positions, profile1 and (optional) profile2. Moreover it is possible to enable/disable the check of the Torque limit and its threshold value in mA:

RELATIVE POSITION PROFILE ▼

PROFILE 1	PROFILE 2
<p>Target speed [RPM]: 1000.00 <span style="float: right;">A</span></p>	<p>Target speed [RPM]: 1000.00</p>
<p>Target acceleration [RPM/s]: 100 <span style="float: right;">B</span></p>	<p>Target acceleration [RPM/s]: 100</p>
<p>Target deceleration [RPM/s]: 100 <span style="float: right;">C</span></p>	<p>Target deceleration [RPM/s]: 100</p>
<p>Target position [°]: 200.00 <span style="float: right;">D</span></p>	<p>Target position [°]: 900.00</p>
<p>Torque limit Off <input checked="" type="checkbox"/> On <span style="float: right;">E</span></p>	<p>Target torque limit [min:-15000 , max:15000] mA: 300 <span style="float: right;">F</span></p>

Figure 7.18: Section of the relative position profile parameters.

The relative position section is composed of:

- **A** Target speed search measured in RPM or mm / s.
- **B** Target acceleration measured in RPM / s or mm / s<sup>2</sup>.
- **C** Target deceleration measured in RPM / s or mm / s<sup>2</sup>.
- **D** Target position measured in angular degrees or mm.
- **E** Torque limit enable *No*, *Yes*.
- **F** Target torque limit measured in mA.

## 7.6 Commissioning

### 7.6.1.8 Torque profile section

In the torque profile section (represented in Figure 7.19) it is possible to set the motion profile parameters for the torque (current) control for two target positions, profile1 and (optional) profile2:

TORQUE PROFILE ▼

PROFILE 1	PROFILE 2
Target torque (current) [min:-15000 , max:15000] mA: <input type="text" value="300"/> <b>A</b>	Target torque (current) [min:-15000 , max:15000] mA: <input type="text" value="5000"/>
? Torque Slope Acceleration [mA/s]: <input type="text" value="50"/> <b>B</b>	? Torque Slope Acceleration [mA/s]: <input type="text" value="1000"/>
? Torque Slope Deceleration [mA/s]: <input type="text" value="50"/> <b>C</b>	? Torque Slope Deceleration [mA/s]: <input type="text" value="1000"/>

Figure 7.19: Section of the torque profile parameters.


The torque profile section is composed of:

- **A** Target torque (current) measured in mA.
- **B** Target slope acceleration measured in mA / s.
- **C** Target slope deceleration measured in mA / s.

## 7.6 Commissioning

### 7.6.2 Digital Input mode commissioning page

Digital Input mode commissioning page (Figure 7.20) is visualized when Digital Input mode is enabled.

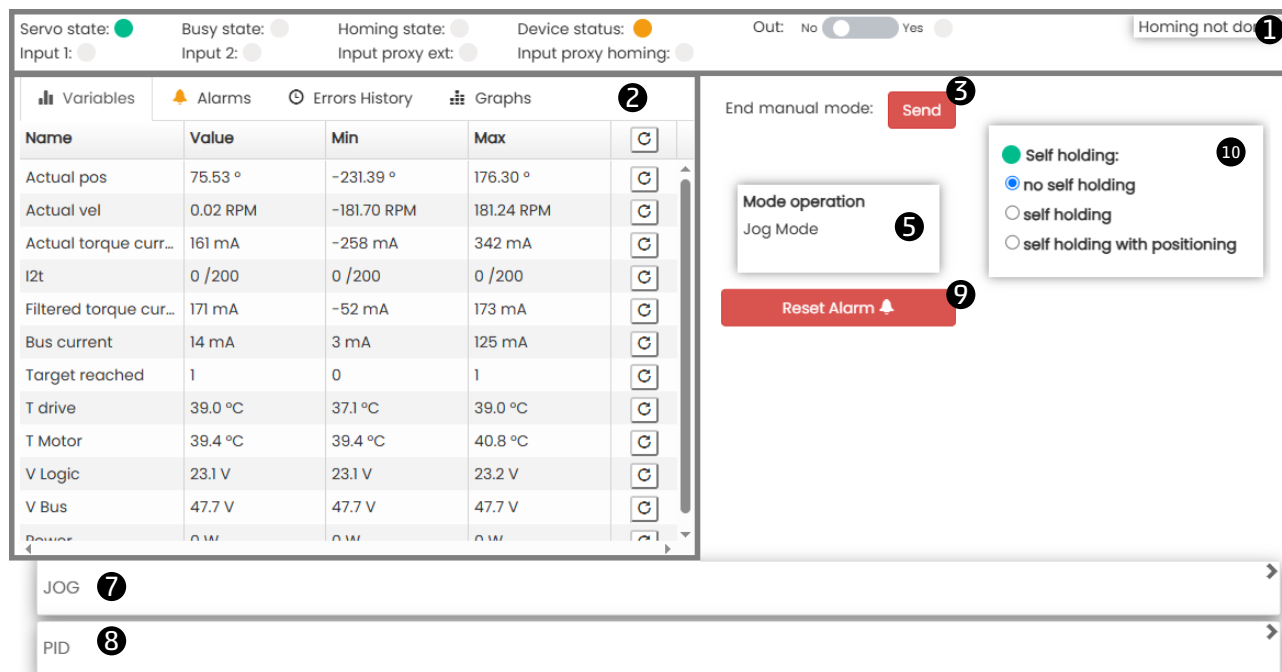

Name	Value	Min	Max
Actual pos	75.53 °	-231.39 °	176.30 °
Actual vel	0.02 RPM	-181.70 RPM	181.24 RPM
Actual torque curr...	161 mA	-258 mA	342 mA
I2t	0 /200	0 /200	0 /200
Filtered torque cur...	171 mA	-52 mA	173 mA
Bus current	14 mA	3 mA	125 mA
Target reached	1	0	1
T drive	39.0 °C	37.1 °C	39.0 °C
T Motor	39.4 °C	39.4 °C	40.8 °C
V Logic	23.1 V	23.1 V	23.2 V
V Bus	47.7 V	47.7 V	47.7 V
Power	0 W	0 W	0 W

Figure 7.20: Digital Input mode commissioning page.

Only some sections of the standard commissioning page (Figure 7.13) are visible:

- ① States of the DRVI: it is possible to watch the state of the DRVI, the state of the inputs, set the state of the output and if a fault is active
- ② Details tabs, see 7.4.
- ③ Command of the manual mode: *Start* or *End*.
- ⑤ Mode operation selector, useless because there is only one operating mode.
- ⑦ Mode operation section which corresponds to Jog section (7.6.2.1).
- ⑧ PID configuration section, see 7.6.3.
- ⑨ Reset errors and warnings: *Reset Alarm*.

There is an additional section dedicated to the Digital Input mode:

- ⑩ *Self holding* configuration. The LED turns green when the device configuration is consistent with the one selected by UVIX.

Command of the servo ④ is not visible, because in Digital Input mode device is always servo on. Command of the movement ⑥ is not visible because the movement is controlled by the inputs.

## 7.6 Commissioning

### 7.6.2.1 Jog section

In the jog section (represented in Figure 7.21) it is possible to set parameters for Digital Input mode:

JOG

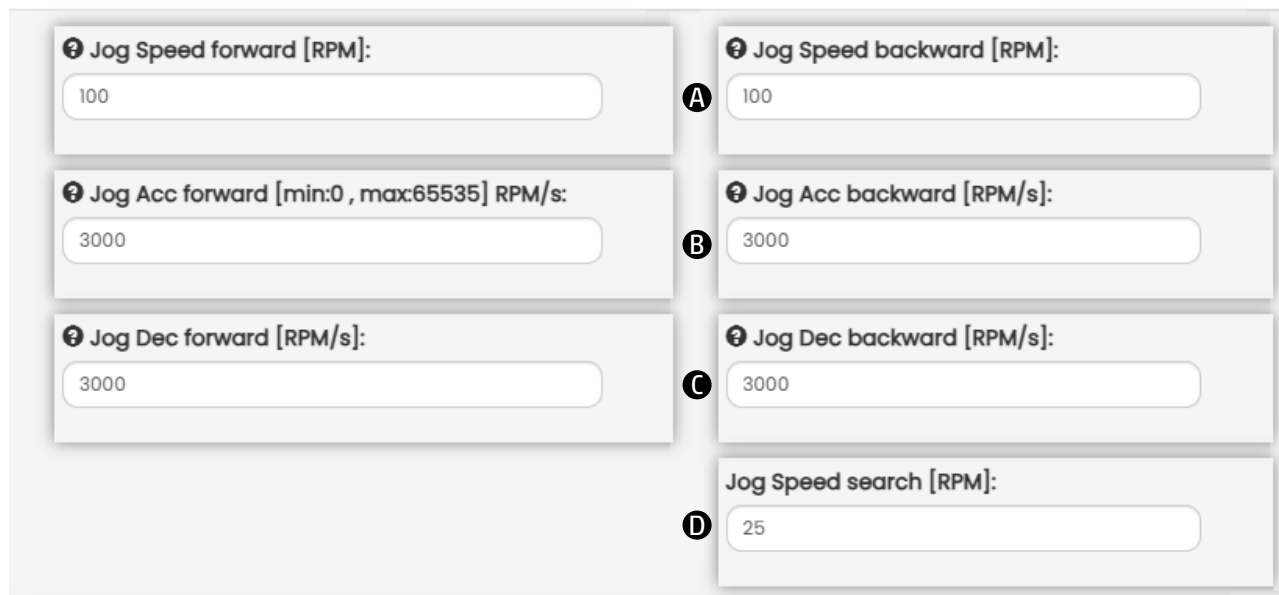


Figure 7.21: Digital Input mode parameters.

The jog section is composed of:

- **A** Jog target speed measured in RPM or mm / s.
- **B** Jog target acceleration measured in RPM / s or mm / s<sup>2</sup>.
- **C** Jog target deceleration measured in RPM / s or mm / s<sup>2</sup>.
- **D** Jog target speed search measured in RPM or mm / s. Used only in *Self holding with positioning* 4.2.3.

Note: in Digital Input mode it is possible to set torque limit, but this must be done in configuration, within the Motion section 7.5.2.

## 7.6 Commissioning

### 7.6.3 PID configuration section

The PID configuration section (represented in Figure 7.22) is always available, regardless of Digital Input mode enablement. This section allows to set the PID values used in the motion profiles (KP speed, KI speed and KP position) by choosing between five configurations:

- Default
- Low load
- Medium load
- High load
- Custom

Default configuration is used for moving motor not connected to cylinder or axis. Low, medium and high load configurations are used to move motor mounted on cylinders/axes with increasing stiffness or larger loads.

The PID values of these configurations depends on type of motor:

- DRVI-24EC125 (Brushless) see Table 7.1
- DRVI-23ST012 (Nema 23) see Table 7.2
- DRVI-24ST022 (Nema 24) see Table 7.3

Table 7.1: PID values for DRVI-24EC125 (brushless).

	<b>Default</b>	<b>Low Load</b>	<b>Medium Load</b>	<b>High Load</b>
<b>KP speed</b>	1000	1500	3000	5000
<b>KI speed</b>	1	1,5	3	5
<b>KP position</b>	0,1	0,15	0,3	0,5

Table 7.2: PID values for DRVI-23ST012 (Nema23).

	<b>Default</b>	<b>Low Load</b>	<b>Medium Load</b>	<b>High Load</b>
<b>KP speed</b>	100	1000	2000	3000
<b>KI speed</b>	1	1	2	3
<b>KP position</b>	0,1	0,1	0,2	0,3

Table 7.3: PID values for DRVI-24ST022 (Nema24).

	<b>Default</b>	<b>Low Load</b>	<b>Medium Load</b>	<b>High Load</b>
<b>KP speed</b>	500	600	1000	1500
<b>KI speed</b>	0,5	0,6	1	1,5
<b>KP position</b>	0,05	0,06	0,1	0,1

## 7.6 Commissioning

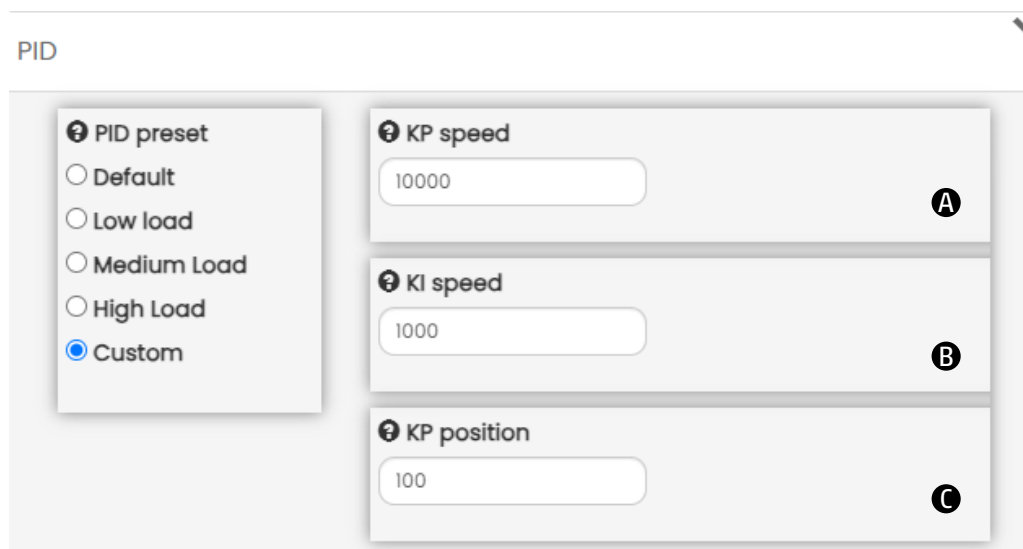


Figure 7.22: Section of the custom PID control.

The PID values can be fully customized only if Custom configuration is selected, only in this case three label appears:

- **A** KP speed
- **B** KI speed
- **C** KP position

**⚠** Consider that the UVIX values of KP speed, KI speed and KP position are divided by the division factors, respectively 10, 1000 and 10. For example, by inserting into UVIX:

KP speed (UVIX) = 10000 ; KI speed (UVIX) = 1000 ; KP position (UVIX) = 1

they are actually set at:

KP speed = 1000,0 ; KI speed = 1,000 ; KP position = 0,1.

## 7.7 EtherCAT configuration

### 7.7 EtherCAT configuration

From the status information page, you can access the window for configuring the station alias **1** field-bus parameter. Using the buttons in the bottom bar of the configuration window **2**, the configured parameters can be sent to the module, saved on the PC, saved on the device, or reset to default values.

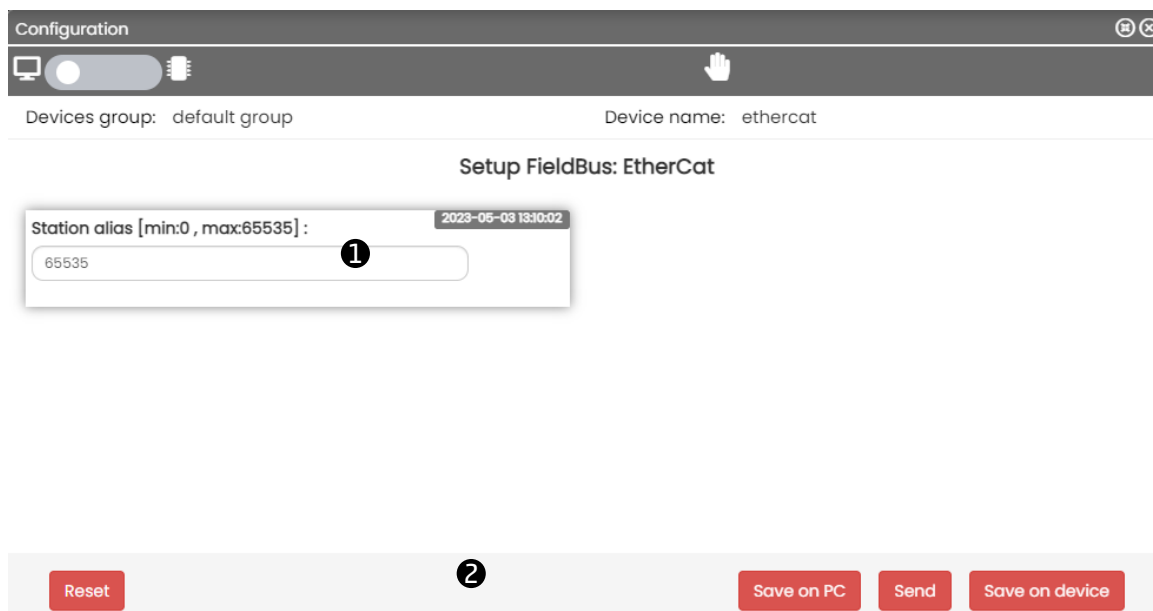


Figure 7.23: Section of the EtherCAT parameters configuration.

The fieldbus default values are shown in Table 7.4.

Table 7.4: Fieldbus default values.

Parameter	Value
Station alias	65535

## 7.8 UVIX USB Gateway

### 7.8 UVIX USB Gateway

The DRVI can be connected to a PC via a USB cable. This connection - subject to prior installation of UVIX on the PC - allows you to communicate with the module through the Camozzi USB Gateway.

#### 7.8.1 Main page

- ① Toolbar: for managing all the functionalities of the USB Gateway.
- ② USB Gateway Commands: to start or stop the USB Gateway and open the webApp.
- ③ Status: indicates the status of the USB Gateway.
- ④ Open COMs: List of devices currently communicating.
- ⑤ Virtual COM ports available and addresses of TCP connection for the connected COM ports.
- ⑥ Data received from the COM port
- ⑦ Data received on the FEP of the UVIX system.

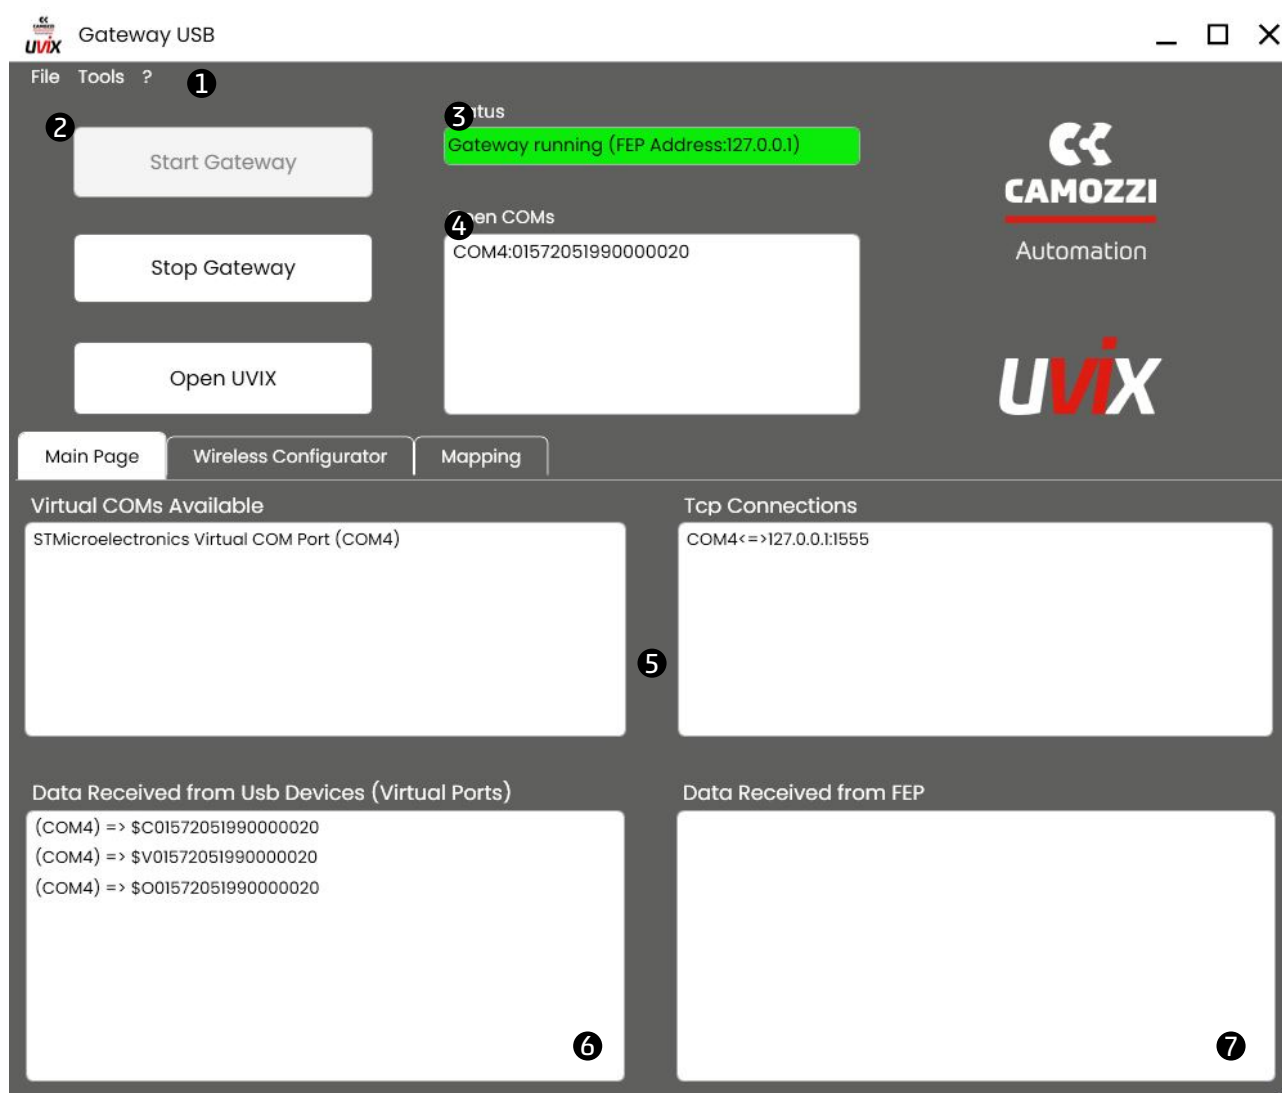


Figure 7.24: Gateway USB.

## 7.8 UVIX USB Gateway

### 7.8.2 Ethernet device configuration

The USB Gateway also allows to connect to the DRVI using Ethernet instead USB, but is necessary to enable Ethernet over EtherCAT (or "EoE") functionality before. To enable this feature, refer to the manual of the PLC you are using. After enabling EoE you can configure GatewayUSB to connect with your device via Ethernet ⑧ (see Figure 7.25).

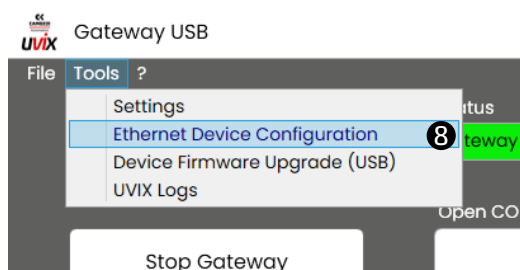


Figure 7.25: Ethernet device configuration section.

The *Ethernet device configuration* window will appear (see Figure 7.26). Choose the correct network adapter from the drop-down menu ①. After that the device connected will be visible ②.

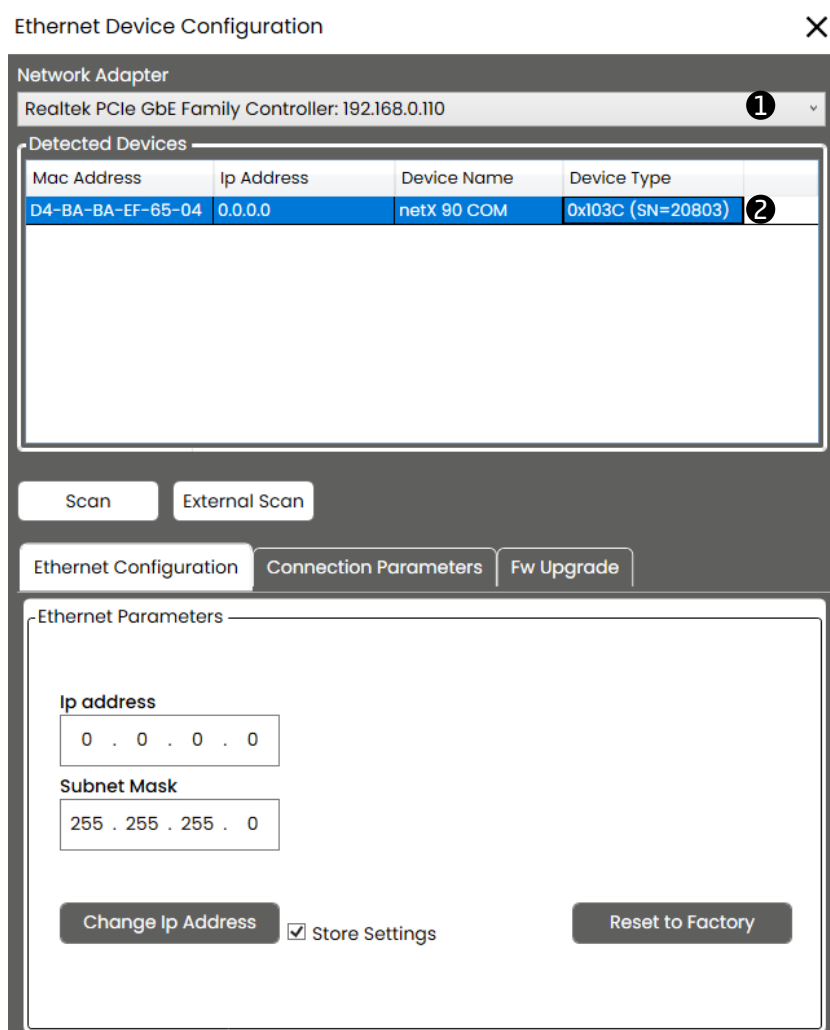


Figure 7.26: Ethernet device configuration window.

## 7.8 UVIX USB Gateway

Switch to *Connection Parameters* tab **3** and check if the new device is available (see Figure 7.27). If you don't see the device you can start a new scan manually by clicking the *Scan* button **4**. Then select the device and click the *Start Communication* button **5**.

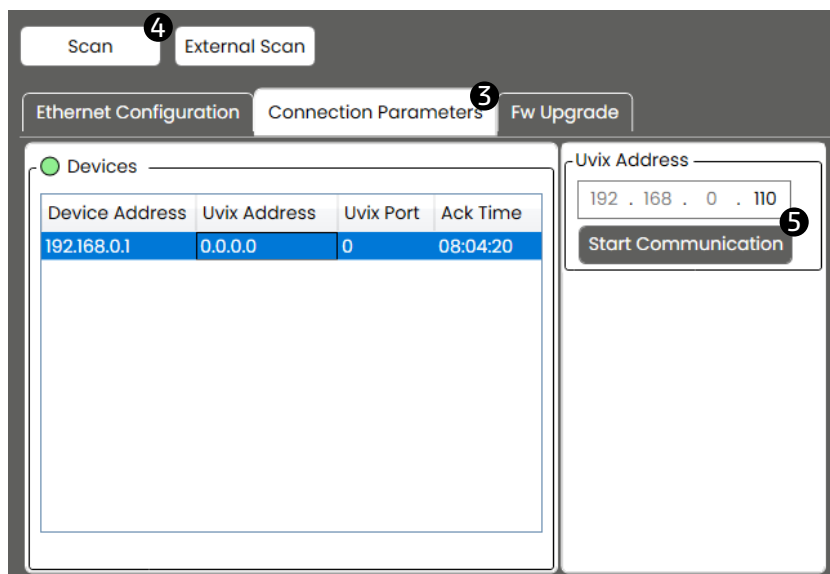


Figure 7.27: Connection Parameters tab, part of Ethernet device configuration window.

Another pop-up will appear (see Figure 7.28), confirm your choice.

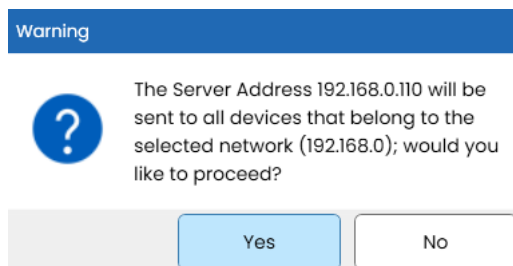


Figure 7.28: Pop-up to confirm sending to all devices of the server address.

If everything is ok you should be in the same condition of Figure 7.29.

Now you can close the *Ethernet device configuration* window and click on *Open uvix* button, visible in Figure 7.24. UVIX page will open and it will communicate with the device via Ethernet.

**⚠** Variables 7.4.1 are not available via Ethernet, to see them you need to communicate via USB.

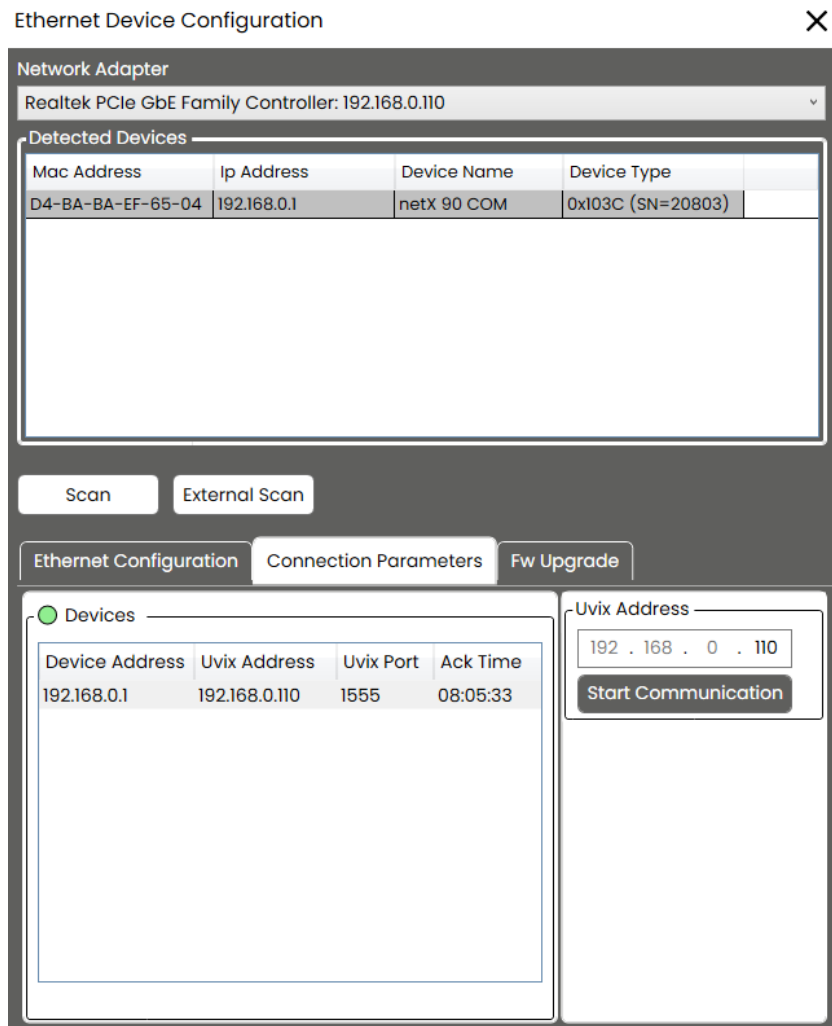


Figure 7.29: Ethernet device configuration window after a successful configuration.



Il sottoscritto, rappresentante il seguente costruttore

**Camozzi Automation S.p.A.**

Sede Legale:  
Via R. Rubattino, 81  
20134 Milano (Italy)

Sede Operativa:  
Via Eritrea, 20/I  
25126 Brescia - Italy

Tel: +39 030 37921  
Fax: +39 030 2400464  
E-mail: info@camozzi.com  
<http://www.camozzi.com>

Sotto la propria ed esclusiva responsabilità **DICHIARA** che :

**Azionamento integrato con controllo vettoriale Serie DRVI**

Nelle versioni elencate a pagina 4

**Anno fabbricazione: 2024-2028**

L'oggetto della dichiarazione di cui sopra è conforme alla pertinente normativa di armonizzazione dell'Unione:

2006/42/CE	DIRETTIVA 2006/42/CE DEL PARLAMENTO EUROPEO E DEL CONSIGLIO del 17 maggio 2006 relativa alle macchine e che modifica la direttiva 95/16/CE
2014/30/EU	DIRETTIVA 2014/30/UE DEL PARLAMENTO EUROPEO E DEL CONSIGLIO del 26 febbraio 2014 concernente l'armonizzazione delle legislazioni degli Stati membri relative alla compatibilità elettromagnetica

e che sono state applicate tutte le norme e/o specifiche tecniche indicate a pagina 2.

La presente dichiarazione di conformità è rilasciata sotto la responsabilità esclusiva del fabbricante

Brescia, Italia

Camozzi Automation S.p.A.  
Product Certification Manager  
Guerrini Fabrizio

Alle seguenti principali norme armonizzate:

NORMA	TITOLO
EN ISO 12100:2010	Sicurezza del macchinario - Principi generali di progettazione - Valutazione del rischio e riduzione del rischio
ISO/TR 14121-2:2013	Sicurezza del macchinario - Valutazione del rischio - Parte 2: Guida pratica ed esempi di metodi
EN 61800-5-2:2007	Azionamenti elettrici a velocità variabile Parte 5-2: Prescrizioni di sicurezza - Sicurezza funzionale
EN 60204-1:2018	Sicurezza del macchinario - Equipaggiamento elettrico delle macchine - Parte 1: Regole generali
EN ISO 13849-1:2015	Sicurezza del macchinario - Parti dei sistemi di comando legate alla sicurezza - Parte 1: Principi generali per la progettazione
EN ISO 13849-2:2012	Sicurezza del macchinario - Parti dei sistemi di comando legate alla sicurezza - Parte 2: Validazione
EN 61000-6-4:2007/A1:2011	Compatibilità elettromagnetica (EMC) - Parte 6-4: Norme generiche - Emissione per ambienti industriali
EN 61000-6-2:2005/AC:2005	Compatibilità elettromagnetica (EMC) - Parte 6-2: Norme generiche - Immunità per ambienti industriali
EN ISO 13857:2019	Sicurezza del macchinario - Distanze di sicurezza per impedire il raggiungimento di zone pericolose con gli arti superiori e inferiori
EN ISO 14120:2015	Sicurezza del macchinario - Ripari - Requisiti generali per la progettazione e la costruzione di ripari fissi e mobili

Alle seguenti principali norme:

NORMA	TITOLO
EN 61800-5-1:2007	Azionamenti elettrici a velocità variabile Parte 5-1: Prescrizioni di sicurezza - Sicurezza elettrica, termica ed energetica
EN 61800-5-2:2017	Azionamenti elettrici a velocità variabile Parte 5-2: Prescrizioni di sicurezza - Sicurezza funzionale (Applicato capitolo 9 "Test requirements")
EN 61508 DA 1 A 7:2011	Sicurezza funzionale dei sistemi elettrici, elettronici ed elettronici programmabili per applicazioni di sicurezza

procedura di valutazione di conformità utilizzata

Allegato IX più Allegato VII (controllo interno della fabbricazione)

organismo notificato incaricato della valutazione

Bureau Veritas Italia  
n. 1370

Viale Monza, 347  
20126 Milano (MI)

numero identificativo del certificato di esame CE di tipo

CE-1370-xxxxxxx

La documentazione tecnica pertinente è stata redatta conformemente all' Allegato VII A della Direttiva 2006/42/CE.

Il certificato è conservato presso il nostro ufficio tecnico e copia conforme verrà inviata su richiesta.

Persona AUTORIZZATA a costituire il fascicolo tecnico

**Nome** Fabrizio  
**Cognome** Guerrini  
**Società** Camozzi Automation S.p.A.  
**Indirizzo** Sede Legale  
Via R. Rubattino, 81  
20134 Milano (MI)

Sede Operativa  
Via Cav. Attilio Camozzi, 13/15  
25080 Polpenazze d/G (BS)



Automation

## Dichiarazione di Conformità CE

(In accordo con l'allegato IIA della  
Direttiva 2006/42/CE)

Doc.code: 5000072578

Ver.

-

Rev.

00

Pag 4 di 4

### ESEMPIO DI CODIFICA

DRVI	-	23	ST	012	-	0	E	-	PN	SF	S	01
------	---	----	----	-----	---	---	---	---	----	----	---	----

DRVI	SERIE
23	FLANGIA MOTORE 23 = Nema 23 24 = Nema 24
ST	TIPO MOTORE ST = stepper EC = brushless DC
012	COPPIA 012 = 1,2 Nm (Nema 23) 022 = 2,2 Nm (Nema 24) 125 = 125 W (solo per EC)
0	FRENO MOTORE 0 = senza freno B = con freno
E	RETROAZIONE DEL MOTORE E = Encoder assoluto, singolo giro
PN	PROTOCOLLO PN = Profinet CO = CANopen EC = EtherCAT EI = EtherNet/IP
SF	FUNZIONI AGGIUNTIVE SF = Safe torque off
S	VERSIONE = versione standard S = versione Custom
01	Numero progressivo versione (solo per versioni custom)* *Nota: le versioni custom coperte dal presente certificato riguardano varianti meccaniche non impattanti la funzione di sicurezza, quali: connessioni, flange, riduttori, giunti, lunghezza dell'albero di trasmissione, scanalature e forma dello stesso albero di trasmissione, colore del prodotto



Automation

A Camozzi Group Company

[camozzi.com](http://camozzi.com)

## Contacts

**Camozzi Automation S.p.A.**

Società Unipersonale

REGISTERED OFFICE

Via R. Rubattino, 81

20134 Milano

Italy

OPERATIONAL HEADQUARTERS

Via Eritrea, 20/1

25126 Brescia

Italy

Tel. +39 030 37921

[marketing@camozzi.com](mailto:marketing@camozzi.com)

**Customer Service**

Tel. +39 030 3792790

[service@camozzi.com](mailto:service@camozzi.com)

**Export Department**

Tel. +39 030 3792253

[sales@camozzi.com](mailto:sales@camozzi.com)